

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

OIL CONSERVATION DIVISION

P. O. Box 2088
Santa Fe, New Mexico 87504-2088

DISTRICT I

P. O. Box 1986 Hobbs, NM 88240

DISTRICT II

P. O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd, Aztec, NM 87410

Well API NO.	30-025-32234
5. Indicate Type or Lease	STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.	
7. Lease Name or Unit Agreement Name	SANTA FE EXPLORATION
8. Well No.	2
9. Pool name or Wildcat	UNDES. CORBIN WC, SOUTH

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well
OIL GAS DRY & ABANDONED
WELL WELL OTHER

2. Name of Operator
Harvey E. Yates Company

3. Address of Operator
P.O. Box 1993, Roswell, NM 88202 1-505-623-6601

4. Well Location
Unit Letter I : 1,980 Feet From The SOUTH Line and 660 Feet From The EAST Line

Section 6 Township 18S Range 33E NMPM LEA County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3964.9' GR.

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work.) SEE RULE 1103

- 3-8-96 SET CIBP @ 5500'. CAP CIBP w/ 25 SK PLUG.
- 3-8-96 SPOT 25 SK PLUG @ 3150' (ACROSS INTERM. SHOE 3100').
- 3-8-96 CUT CASING @ 950', 850' & 450' (PIPE FREE @ 450).
(UNABLE TO PUMP INTO CUTS @ 950 & 850') LAY DOWN 450' CASING.
- 3-11-96 SPOT 25 SK PLUG @ 950' (FOR 950 & 850 CUTS).
- 3-11-96 PUMP 35 SK PLUG IN & OUT CUTOFF. (FOR CUT OFF & SHOE PLUG). TAG @ 392'.
- 3-11-96 SPOT 10 SK PLUG AT SURFACE. CUT OFF HEAD.
- 3-11-96 INSTALL DRY HOLE MARKER. BACKFILL PIT. CLEAN LOCATION.

P&A WITNESSED BY OCD I (MR. BUDDY HILL).

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Ray F. Nokes TITLE PROD. MGR. / ENGINEER. Date 3/12/96
 TYPE OR PRINT NAME RAY F. NOKES TELEPHONE NO. 1-505-623-6601

(This space for State use)

Approved by Johnny Robinson Title Date
 Conditions of approval, if any:

5
L