

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ well gas ☐ well other ☐

2. NAME OF OPERATOR
TEXACO Inc.

3. ADDRESS OF OPERATOR
P.O. Box 728, Hobbs, New Mexico 88240

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 660' FNL & 1980' FWL
AT TOP PROD. INTERVAL: (Unit Letter 'C')
AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO: SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF	<input type="checkbox"/>	<input type="checkbox"/>
FRACTURE TREAT	<input type="checkbox"/>	<input type="checkbox"/>
SHOOT OR ACIDIZE	<input type="checkbox"/>	<input type="checkbox"/>
REPAIR WELL	<input type="checkbox"/>	<input type="checkbox"/>
PULL OR ALTER CASING	<input type="checkbox"/>	<input type="checkbox"/>
MULTIPLE COMPLETE	<input type="checkbox"/>	<input type="checkbox"/>
CHANGE ZONES	<input type="checkbox"/>	<input type="checkbox"/>
ABANDON*	<input type="checkbox"/>	<input type="checkbox"/>
(other) OF: Downhole Commingle		

5. LEASE
LC-032104

6. IF INDIAN, ALLOTTEE OR TRIBE NAME
-

7. UNIT AGREEMENT NAME
-

8. FARM OR LEASE NAME
A. H. Blinebry NCT-1

9. WELL NO.
23

10. FIELD OR WILDCAT NAME
Blinebry, Drinkard & Tubb Gas

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 29, T-22-S, R-38-E

12. COUNTY OR PARISH
Lea

13. STATE
New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
3381' (GR)

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

NMOCDCase NO. # 5278
Order NO. # R-4837

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. RIGGED UP. PULL RODS AND PUMP FROM DRINKARD STRING. INSTALL BOP. PULL TUBING. PULL TUBING FROM BLINEBRY STRING. RUN TUBING, RODS AND PUMP INTO DRINKARD STRING.
2. SET PKR IN BLINEBRY/TUBB STRING @ 6737'. ACIDIZE PERFS 6855'- 6860' & 6883'- 6888' W/ 750 GALS 15% NEFE ACID. FLUSH W/25 BBLs 8.9# BRINE.
3. INSTALL PUMPING EQUIPMENT (DRINKARD STRING).
4. ON 24 HR POTENTIAL TEST ENDING 7-8-84, WELL PUMPED 8 BO, 20 BW, & 185 MCFG. WELL COMPLETED AS TRIPLE DOWNHOLE COMMINGLE IN THE DRINKARD, TUBB AND BLINEBRY ZONES.

18. I hereby certify that the foregoing is true and correct

SIGNED [Signature] TITLE Asst. Dist. Mgr. DATE 7-23-84

(This space for Federal or State office use)

APPROVED BY [Signature] TITLE Asst. Dist. Mgr. DATE 12-27-84

CONDITIONS OF APPROVAL, IF ANY:

Subject to
Like Approval
by State

*See Instructions on Reverse Side

RECEIVED

DEC 31 1984

COPIES
HOBBS OFFICE