

1. Move in Workover Rig.
2. Drill out plug in 7"OD casing at 380'.
3. Attempt to pull 7"OD casing.
4. Clean out to original total depth 1360'.
5. Deepen to 1600'.
6. Set 4-1/2"OD casing, (9.39 J-55 "A" Condition), from surface to T.D. 1600', cement and circulate cement to surface.
7. Perforate 4-1/2"OD casing with two shots per foot 1560-1585' - 25' - 30 shots.
8. Run 2-3/8"OD internally cased tubing with Venturi Type pump.
9. Connect to Salt Water Disposal System and dispose of produced Archa water from the Marine-Fed "F" Well No. 1 into Another Name.
10. Pump and plug process will be used in cementing the 4-1/2"OD casing.