

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease  
State  Fee   
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT --" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator <b>TEXAS PACIFIC OIL CO., INC.</b>	8. Farm or Lease Name <b>Eaton, H. W.</b>
3. Address of Operator <b>P. O. Box 1069 - Hobbs, New Mexico 88240</b>	9. Well No. <b>16</b>
4. Location of Well UNIT LETTER <b>E</b> <b>1980</b> FEET FROM THE <b>North</b> LINE AND <b>990</b> FEET FROM THE <b>West</b> LINE, SECTION <b>12</b> TOWNSHIP <b>25-S</b> RANGE <b>37-E</b> NMPM. 10. Field and Pool, or Wildcat <b>Justis Blinebry</b>	11. County <b>Lea</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>3116.4' GR</b>	

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <b>Drill by junk in hole</b> <input checked="" type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Following procedure to be used to drill by 605' of 6-3/4" drill collars left in hole at depth of 4565'.

1. Spot 115 sacks Class H cement with 2% CaCl<sub>2</sub> and 15# sand per sack. WOC 24 hours.
2. GIH with bit and dress off cement plug. Circulate hole clean and pull bit.
3. GIH with Dynadril with 2-1/2" bent sub.
4. Drill by fish, pull Dynadril and resume normal drilling operations.

*Notify offset*

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Original Signed by Lloyd Wright TITLE Area Superintendent DATE 3-27-74

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY: \_\_\_\_\_