



Certificate of Analysis

Number: 6030-21060187-001A

Artesia Laboratory

200 E Main St.
Artesia, NM 88210
Phone 575-746-3481Chandler Montgomery
Occidental Petroleum
1502 W Commerce Dr.
Carlsbad, NM 88220

June 21, 2021

Field: Lost Tank
 Station Name: Lost Tank 30-19 Fed Com 1H
 Station Number: 16102T
 Station Location: CTB
 Sample Point: Meter
 Formation: Quarterly
 County: Lea
 Type of Sample: : Spot-Cylinder
 Heat Trace Used: N/A
 Sampling Method: : Fill and Purge
 Sampling Company: : SPL

Sampled By: Michael Mirabal
 Sample Of: Gas Spot
 Sample Date: 06/16/2021 02:20
 Sample Conditions: 113 psia, @ 92 °F Ambient: 95 °F
 Effective Date: 06/16/2021 02:20
 Method: GPA-2261M
 Cylinder No: 1111-002369
 Instrument: 70104124 (Inficon GC-MicroFusion)
 Last Inst. Cal.: 06/21/2021 0:00 AM
 Analyzed: 06/21/2021 12:21:17 by EJ R

Analytical Data

Components	Un-normalized Mol %	Mol. %	Wt. %	GPM at 14.65 psia		
Hydrogen Sulfide	0.000	0.000	0.000		GPM TOTAL C2+	5.748
Nitrogen	3.714	3.705	4.543		GPM TOTAL C3+	2.964
Methane	72.207	72.042	50.591		GPM TOTAL iC5+	0.710
Carbon Dioxide	4.233	4.223	8.135			
Ethane	10.455	10.431	13.730	2.784		
Propane	5.365	5.353	10.332	1.472		
Iso-butane	0.671	0.669	1.702	0.219		
n-Butane	1.794	1.790	4.554	0.563		
Iso-pentane	0.444	0.443	1.399	0.162		
n-Pentane	0.510	0.509	1.608	0.184		
Hexanes Plus	0.837	0.835	3.406	0.364		
	100.230	100.000	100.000	5.748		

Calculated Physical Properties

Relative Density Real Gas	Total	C6+
	0.7915	3.2176
Calculated Molecular Weight	22.84	93.19
Compressibility Factor	0.9962	

GPA 2172 Calculation:

Calculated Gross BTU per ft³ @ 14.65 psia & 60°F

Real Gas Dry BTU	1209	5113
Water Sat. Gas Base BTU	1188	5024
Ideal, Gross HV - Dry at 14.65 psia	1204.2	5113.2
Ideal, Gross HV - Wet	1183.1	5023.7
Net BTU Dry Gas - real gas	1098	
Net BTU Wet Gas - real gas	1079	

Comments: H2S Field Content 0 ppm
 Mcf/day 3276

Data reviewed by: Eric Ramirez, Analyst

Quality Assurance: The above analyses are performed in accordance with ASTM, UOP, GPA guidelines for quality assurance, unless otherwise stated. 44

UPSET FLARING EVENT SPECIFIC JUSTIFICATIONS FORM**Facility:** Lost Tank 18 CPF**Flare Date:** 1/25/2023**Duration of event:** 2 Hours 20 Minutes**MCF Flared:** 1836.97**Start Time:** 12:00 AM**End Time:** 02:20 AM**Cause:** Emergency Flare > Third Party > USA Compression > Lost Tank 13 Boo CS > Compression Equipment Issues**Method of Flared Gas Measurement:** Gas Flare Meter**Comments:** This event was previously reported as a major flare event to NMOCD via incident id nAPP2302577044, which began on 01/24/2023. The second half of the flaring event carried over to 01/25/2023, which was unforeseen, and could not be included in the original incident id nAPP2302577044.

1. Reason why this event was beyond Operator's control:

The emissions event was caused by the unforeseen, unexpected, sudden, and unavoidable interruption, restriction or complete shut-in of a gas pipeline by a third-party pipeline compressor station operator, which impacted Oxy's ability to send gas to them. This interruption, restriction or complete shut-in of the gas pipeline by a third-party pipeline compression station operator is downstream of Oxy's custody transfer point and out of Oxy's control to foresee, avoid or prevent from happening and did not stem from any of Oxy's upstream facility activity that could have been foreseen and avoided, and could not have been avoided by good design, operation, and preventative maintenance practices. In this case, Lost Tank Boo 13 compressor station, third party owned and operated by USA Compression, lost (3) units due to compression malfunctions, which then instigated a sudden and unexpected restriction of gas flow intake by the Lost Tank Boo 13 compressor station, which in turn, prompted Oxy's Lost Tank 18 CPF to pressure up automatically and trigger a flaring event to occur, which began on 01/24/2023, about 09:55 PM and ended on 01/25/2023, about 02:20 AM, when the repairs were completed and their compression equipment was running normal. USA Compression had problems with the dehy and fuel scrubber at their compressor station. A phone call was made to have a USA compression mechanic dispatched, after several attempts to restart the compression equipment by the USA compression tech, who was on-site. A USA compression mechanic arrived at the Lost Tank Boo 13 compressor station location, approximately 1.5 hours after the initial callout by their own technician. The USA compression mechanic is able to correct the issues with the dehy and fuel scrubber frozen line, which took approximately 2.5 hours to troubleshoot. After their compression equipment was restarted, did then units manage to stay on-line and they were able to take Oxy's sales gas again. This event could not have been foreseen, avoided or prevented from happening as this event occurred with no advance notice or warning to Oxy and its field personnel from USA Compression personnel. Lost Tank 13 Boo compressor station is the first stopping point, where OXY sends its sales gas from its facility, before it is pushed further down the pipeline for further processing at Mark West, a downstream gathering system facility, which is downstream of Oxy's control.

2. Steps Taken to limit duration and magnitude of venting or flaring:

It is OXY's policy to route its stranded gas to a flare during an unforeseen and unavoidable emergency or malfunction, that is beyond Oxy's control to avoid, prevent or foresee, to minimize emissions as much as possible as part of the overall steps taken to limit duration and magnitude of flaring. The flare at this facility

has a 98% combustion efficiency to lessen emissions as much as possible. In this case, Lost Tank Boo 13 compressor station, third party owned and operated by USA Compression, lost (3) units due to compression malfunctions, which then instigated a sudden and unexpected restriction of gas flow intake by the Lost Tank Boo 13 compressor station, which in turn, prompted Oxy's Lost Tank 18 CPF to pressure up automatically and trigger a flaring event to occur, which began on 01/24/2023, about 09:55 PM and ended on 01/25/2023, about 02:20 AM, when the repairs were completed and their compression equipment was running normal. USA Compression had problems with the dehy and fuel scrubber at their compressor station. As soon as the Oxy production tech, who was on-site, saw flaring occur, he quickly made adjustments to the gas lift injection optimizer to help reduce the flare rate. The Oxy production tech then contacted USA Compression personnel on-site to troubleshoot their facility issues. USA Compression had problems with the dehy and fuel scrubber at their compressor station. A phone call was made to have a USA compression mechanic dispatched, after several attempts to restart the compression equipment by the USA compression tech, who was on-site. A USA compression mechanic arrived at the Lost Tank Boo 13 compressor station location, approximately 1.5 hours after the initial callout by their own technician. The USA compression mechanic repairs the issues with the dehy and fuel scrubber frozen line, which took approximately 2.5 hours to troubleshoot. This event is out of OXY's control, yet OXY made every effort to control and minimize emissions as much as possible.

3. Corrective Actions taken to eliminate the cause and reoccurrence of venting or flaring:

Oxy cannot take any corrective actions to eliminate the cause and potential reoccurrence of a third-party owned and operated compressor station's sudden and unexpected gas flow intake restriction or shut-in, as this control issue is downstream of Oxy's custody transfer point and out of Oxy's control to foresee, avoid, prevent from happening or reoccur. Third-party downstream compression station owner operators may have equipment issues, which will reoccur from time to time, which in turn, directly impacts Oxy's ability to send its sales gas to them, and potentially triggering a flaring event. OXY makes every effort to control and minimize emissions as much as possible. The only actions that Oxy can take and handle that is within its control, is to continually communicate with USA Compression personnel, who operate the Lost Tank 13 Boo Compressor Station, when possible, during these types of circumstances.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720
District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720
District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

DEFINITIONS

Action 185724

DEFINITIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 185724
	Action Type: [C-129] Venting and/or Flaring (C-129)

DEFINITIONS

For the sake of brevity and completeness, please allow for the following in all groups of questions and for the rest of this application: • this application's operator, hereinafter "this operator"; • venting and/or flaring, hereinafter "vent or flare"; • any notification or report(s) of the C-129 form family, hereinafter "any C-129 forms"; • the statements in (and/or attached to) this, hereinafter "the statements in this"; • and the past tense will be used in lieu of mixed past/present tense questions and statements.
--

District I

1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II

811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 185724

QUESTIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 185724
	Action Type: [C-129] Venting and/or Flaring (C-129)

QUESTIONS

Prerequisites	
Any messages presented in this section, will prevent submission of this application. Please resolve these issues before continuing with the rest of the questions.	
Incident Well	Unavailable.
Incident Facility	[fAPP2226965761] Lost Tank 18 CPF

Determination of Reporting Requirements	
Answer all questions that apply. The Reason(s) statements are calculated based on your answers and may provide additional guidance.	
Was this vent or flare caused by an emergency or malfunction	Yes
Did this vent or flare last eight hours or more cumulatively within any 24-hour period from a single event	No
Is this considered a submission for a vent or flare event	Yes, major venting and/or flaring of natural gas.
An operator shall file a form C-141 instead of a form C-129 for a release that, includes liquid during venting and/or flaring that is or may be a major or minor release under 19.15.29.7 NMAC.	
Was there at least 50 MCF of natural gas vented and/or flared during this event	Yes
Did this vent or flare result in the release of ANY liquids (not fully and/or completely flared) that reached (or has a chance of reaching) the ground, a surface, a watercourse, or otherwise, with reasonable probability, endanger public health, the environment or fresh water	No
Was the vent or flare within an incorporated municipal boundary or within 300 feet from an occupied permanent residence, school, hospital, institution or church in existence	No

Equipment Involved	
Primary Equipment Involved	Other (Specify)
Additional details for Equipment Involved. Please specify	Emergency Flare > Third Party > USA Compression > Lost Tank 13 Boo CS > Compression Equipment Issues

Representative Compositional Analysis of Vented or Flared Natural Gas	
Please provide the mole percent for the percentage questions in this group.	
Methane (CH4) percentage	72
Nitrogen (N2) percentage, if greater than one percent	4
Hydrogen Sulfide (H2S) PPM, rounded up	0
Carbon Dioxide (CO2) percentage, if greater than one percent	4
Oxygen (O2) percentage, if greater than one percent	0
If you are venting and/or flaring because of Pipeline Specification, please provide the required specifications for each gas.	
Methane (CH4) percentage quality requirement	Not answered.
Nitrogen (N2) percentage quality requirement	Not answered.
Hydrogen Sulfide (H2S) PPM quality requirement	Not answered.
Carbon Dioxide (CO2) percentage quality requirement	Not answered.
Oxygen (O2) percentage quality requirement	Not answered.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico

Energy, Minerals and Natural Resources

Oil Conservation Division

1220 S. St Francis Dr.

Santa Fe, NM 87505

QUESTIONS, Page 2

Action 185724

QUESTIONS (continued)

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 185724
	Action Type: [C-129] Venting and/or Flaring (C-129)

QUESTIONS

Date(s) and Time(s)	
Date vent or flare was discovered or commenced	01/25/2023
Time vent or flare was discovered or commenced	12:00 AM
Time vent or flare was terminated	02:20 AM
Cumulative hours during this event	3

Measured or Estimated Volume of Vented or Flared Natural Gas	
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Cause: Other Other (Specify) Natural Gas Flared Released: 1,837 Mcf Recovered: 0 Mcf Lost: 1,837 Mcf.
Other Released Details	Not answered.
Additional details for Measured or Estimated Volume(s). Please specify	Gas Flare Meter
Is this a gas only submission (i.e. only significant Mcf values reported)	Yes, according to supplied volumes this appears to be a "gas only" report.

Venting or Flaring Resulting from Downstream Activity	
Was this vent or flare a result of downstream activity	No
Was notification of downstream activity received by this operator	Not answered.
Downstream OGRID that should have notified this operator	Not answered.
Date notified of downstream activity requiring this vent or flare	Not answered.
Time notified of downstream activity requiring this vent or flare	Not answered.

Steps and Actions to Prevent Waste	
For this event, this operator could not have reasonably anticipated the current event and it was beyond this operator's control.	True
Please explain reason for why this event was beyond this operator's control	This event was previously reported as a major flare event to NMOCD via incident id nAPP2302577044, which began on 01/24/2023. The second half of the flaring event carried over to 01/25/2023, which was unforeseen, and could not be included in the original incident id nAPP2302577044.In this case, Lost Tank Boo 13 compressor station, third party owned and operated by USA Compression, lost (3) units due to compression malfunctions, which then instigated a sudden and unexpected restriction of gas flow intake by the Lost Tank Boo 13 compressor station, which in turn, prompted Oxy's Lost Tank 18 CPF to pressure up automatically and trigger a flaring event to occur, which began on 01/24/2023, about 09:55 PM and ended on 01/25/2023, about 02:20 AM, when the repairs were completed and their compression equipment was running normal. USA Compression had problems with the dehy and fuel scrubber at their compressor station. A phone call was made to have a USA compression mechanic dispatched, after several attempts to restart the compression equipment by the USA compression tech, who was on- site. A USA compression mechanic arrived at the Lost Tank Boo 13 compressor station location, approximately 1.5 hours after the initial callout by their own technician. The USA compression mechanic is able to correct the issues with the dehy and fuel scrubber frozen line, which took approximately 2.5 hours to troubleshoot. After their compression equipment was restarted, did then units manage to stay on-line and they were able to take Oxy's sales gas again. This event could not have been foreseen, avoided or prevented from happening as this event occurred with no advance notice or warning to Oxy and its field personnel from USA Compression personnel.
Steps taken to limit the duration and magnitude of vent or flare	It is OXY's policy to route its stranded gas to a flare during an unforeseen and unavoidable emergency or malfunction, that is beyond Oxy's control to avoid, prevent or foresee, to minimize emissions as much as possible as part of the overall steps taken to limit duration and magnitude of flaring. The flare at this facility has a 98% combustion efficiency to lessen emissions as much as possible. In this case, Lost Tank Boo 13 compressor station, third party owned and operated by USA Compression, lost (3) units due to compression malfunctions, which then instigated a sudden and unexpected restriction of gas flow intake by the Lost Tank Boo 13 compressor station, which in turn, prompted Oxy's Lost Tank 18 CPF to pressure up automatically and trigger a flaring event to occur, which began on 01/24/2023, about 09:55 PM and ended on 01/25/2023, about 02:20 AM, when the repairs were completed and their compression equipment was running normal. USA Compression had problems with the dehy and fuel scrubber at their compressor station. As soon as the Oxy production tech, who was on-site, saw flaring occur, he quickly made adjustments to the gas lift injection optimizer to help reduce the flare rate. The Oxy production tech then contacted USA Compression personnel on-site to troubleshoot their facility issues. USA Compression had problems with the dehy and fuel scrubber at their compressor station. A phone call was made to have a USA compression mechanic dispatched, after several attempts to restart the compression equipment by the USA compression tech, who was on- site. A USA compression mechanic arrived at the Lost Tank Boo 13 compressor station location, approximately 1.5 hours after the initial callout by their own technician. The USA compression mechanic repairs the issues with the dehy and fuel scrubber frozen line, which took approximately 2.5 hours to troubleshoot.
Corrective actions taken to eliminate the cause and reoccurrence of vent or flare	Oxy cannot take any corrective actions to eliminate the cause and potential reoccurrence of a third-party owned and operated compressor station's sudden and unexpected gas flow intake restriction or shut-in, as this control issue is downstream of Oxy's custody transfer point and out of Oxy's control to foresee, avoid, prevent from happening or reoccur. Third-party downstream compression station owner operators may have equipment issues, which will reoccur from time to time, which in turn, directly impacts Oxy's ability to send its sales gas to them, and potentially triggering a flaring event. OXY makes every effort to control and minimize emissions as much as possible. The only actions that Oxy can take and handle that is within its control, is to continually communicate with USA Compression personnel, who operate the Lost Tank 13 Boo Compressor Station, when possible, during these types of circumstances.

District I

1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II

811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

ACKNOWLEDGMENTS

Action 185724

ACKNOWLEDGMENTS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 185724
	Action Type: [C-129] Venting and/or Flaring (C-129)

ACKNOWLEDGMENTS

☒	I acknowledge that I am authorized to submit a <i>Venting and/or Flaring</i> (C-129) report on behalf of this operator and understand that this report can be a complete C-129 submission per 19.15.27.8 and 19.15.28.8 NMAC.
☒	I acknowledge that upon submitting this application, I will be creating a new incident file (assigned to this operator) to track any C-129 forms, pursuant to 19.15.27.7 and 19.15.28.8 NMAC and understand that this submission meets the notification requirements of Paragraph (1) of Subsection G and F respectively.
☒	I hereby certify the statements in this report are true and correct to the best of my knowledge and acknowledge that any false statement may be subject to civil and criminal penalties under the Oil and Gas Act.
☒	I acknowledge that the acceptance of any C-129 forms by the OCD does not relieve this operator of liability should their operations have failed to adequately investigate, report, and remediate contamination that poses a threat to groundwater, surface water, human health, or the environment.
☒	I acknowledge that OCD acceptance of any C-129 forms does not relieve this operator of responsibility for compliance with any other applicable federal, state, or local laws and/or regulations.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 185724

CONDITIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 185724
	Action Type: [C-129] Venting and/or Flaring (C-129)

CONDITIONS

Created By	Condition	Condition Date
marialuna2	If the information provided in this report requires an amendment, submit a [C-129] Amend Venting and/or Flaring Incident (C-129A), utilizing your incident number from this event.	2/13/2023