



AKM MEASUREMENT SERVICES,LLC. Natural Gas Analysis Report
GPA 2172-09/API 14.5 Report with GPA 2145-16 Physical Properties

Sample Information	
Sample Name	SALT FLAT CTB TRAIN 1 CHECK (FMP)
Technician	ANTHONY DOMINGUEZ
Analyzer Make & Model	INFICON MICRO GC
Last Calibration/Validation Date	11-30-2023
Meter Number	18721C
Air temperature	82
Flow Rate (MCF/Day)	155556.36
Heat Tracing	HEATED HOSE & GASIFIER
Sample description/mtr name	SALT FLAT CTB TRAIN 1 CHECK (FMP)
Sampling Method	FILL & EMPTY
Operator	OCCIDENTAL PETROLEUM, OXY USA INC
State	NEW MEXICO
Region Name	PERMIAN_RESOURCES
Asset	NEW MEXICO
System	WEST
FLOC	OP-L2116-BT002
Sample Sub Type	GAS LIFT
Sample Name Type	WELL
Vendor	AKM MEASUREMENT
Cylinder #	5565
Sampled by	LUIS JIMENEZ
Sample date	11-21-2023
Analyzed date	12-2-2023
Method Name	C9
Injection Date	2023-12-02 12:37:54
Report Date	2023-12-02 12:41:23
EZReporter Configuration File	1-16-2023 OXY GPA C9+ H2S #2.cfgx
Source Data File	2224b3ab-5b91-40a7-ba7c-878a9ad59783
NGA Phys. Property Data Source	GPA Standard 2145-16 (FPS)
Data Source	INFICON Fusion Connector

Component Results

Component Name	Peak Area	Raw Amount	Response Factor	Norm Mole%	Gross HV (Dry) (BTU / Ideal cu.ft.)	Relative Gas Density (Dry)	GPM (Dry) (Gal. / 1000 cu.ft.)
Nitrogen	39257.6	2.2350	0.00005693	2.2430	0.0	0.02169	0.248
Methane	1023303.0	74.6272	0.00007293	74.8951	758.2	0.41484	12.742
CO2	70455.8	3.3418	0.00004743	3.3538	0.0	0.05096	0.574
Ethane	221198.0	10.1712	0.00004598	10.2077	181.1	0.10598	2.740
H2S	0.0	0.0000	0.00000000	0.0000	0.0	0.00000	0.000
Propane	152804.8	4.9951	0.00003269	5.0130	126.4	0.07632	1.386
iso-butane	59880.2	0.6653	0.00001111	0.6677	21.8	0.01340	0.219
n-Butane	153261.1	1.6911	0.00001103	1.6972	55.5	0.03406	0.537
iso-pentane	48760.5	0.4796	0.00000984	0.4813	19.3	0.01199	0.177
n-Pentane	60478.1	0.5713	0.00000945	0.5733	23.0	0.01428	0.209
hexanes	53280.0	0.5251	0.00000986	0.5270	25.1	0.01568	0.217
heptanes	42025.0	0.2546	0.00000606	0.2555	14.1	0.00884	0.118
octanes	14982.0	0.0811	0.00000541	0.0814	5.1	0.00321	0.042
nonanes+	1092.0	0.0039	0.00000360	0.0040	0.3	0.00018	0.002
Total:		99.6424		100.0000	1229.9	0.77144	19.211

Results Summary

Result	Dry	Sat.
Total Un-Normalized Mole%	99.6424	
Pressure Base (psia)	14.730	
Temperature Base (Deg. F)	60.00	
Flow	71.2	

Result	Dry	Sat.
Flowing Pressure (psia)	94.9	
Gross Heating Value (BTU / Ideal cu.ft.)	1229.9	1208.5
Gross Heating Value (BTU / Real cu.ft.)	1234.6	1213.6
Relative Density (G), Real	0.7741	0.7718

Monitored Parameter Report

Parameter	Value	Lower Limit	Upper Limit	Status
Total un-normalized amount	99.6424	97.0000	103.0000	Pass

UPSET FLARING EVENT SPECIFIC JUSTIFICATIONS FORM**Facility:** Salt Flat CTB**Flare Date:** 08/13/2024**Duration of Event:** 6 Hours**MCF Flared:** 240**Start Time:** 12:20 PM**End Time:** 06:20 PM**Cause:** Emergency Flare > Downstream Activity > Enterprise > Continuing Compression Equipment Issues**Method of Flared Gas Measurement:** Gas Flare Meter

1. Reason why this event was beyond Operator's control:

This emissions event was caused by the unforeseen, unexpected, sudden, and unavoidable breakdown of equipment or process that was beyond the owner/operator's control and did not stem from activity that could have been foreseen and avoided, and could not have been avoided by good design, operation, and preventative maintenance practices. Oxy engages in respectable and good facility operation practices while also maintaining its continuous facility equipment preventative maintenance program. In this case, there were continuing third party issues which were affecting Oxy's ability to push forward its gas, which resulted in a flaring event to occur. Due to compression issues experienced by a third-party downstream operator, Enterprise, from Oxy's Salt Flat CTB facility, Oxy was compelled to flare its excess sales gas. Enterprise's ongoing compression equipment malfunctions has resulted in a persistent bottleneck, preventing the safe and efficient transportation of Oxy's sales gas through their sales pipeline network. To ensure the safety and integrity of Oxy's facility operations, and to prevent potential overpressure situations within our facility, flaring has been initiated as a controlled and safety measure. This action is necessary as it allows Oxy to safely burn its excess gas, thereby preventing potential hazards such as equipment damage, leaks, or even explosions. While flaring is not Oxy's chosen method of handling excess gas, it is a vital and necessary step under these exceptional circumstances to maintain the integrity and safety of its operations. Oxy attempts to actively work with the affected third-party downstream operators to resolve these types of issues as quickly as possible and to minimize the environmental impact of flaring. This flaring situation was beyond OXY's control, but Oxy took all possible measures to reduce emissions effectively. The duration and volume of this flaring event is a combination of multiple intermittent flaring instances within a 24-hour period.

2. Steps Taken to limit duration and magnitude of venting or flaring:

This facility is unmanned, except when Oxy production techs are gathering data daily or conducting daily walk-throughs to ensure that there are no problems, circumstances and/or assist other personnel on-site for maintenance purposes. It is OXY's policy to route its stranded gas to a flare during an unforeseen and unavoidable emergency or malfunction, as the part of the overall process or steps to take to limit duration and magnitude of flaring. Oxy personnel are in the field 24/7 and can physically see when we are flaring which in turn are communicated to additional Oxy field personnel. Internal OXY procedures ensure that upon notice of flaring, malfunction gas compressor unit and/or multiple unit shutdown alarms, increased sensor line pressure alarms, etc., field production technician personnel are promptly notified, and are instructed to assess the issue as soon as possible to take prompt corrective action and minimize emissions. Oxy production technicians must assess whether the issue or circumstance is due to damage and repair is needed, or whether there are other reasons for its cause. In this case, there were continuing third party issues which were affecting Oxy's ability to push forward its gas, which resulted in a flaring event to occur. Due to compression issues experienced by a third-party downstream operator, Enterprise, from Oxy's Salt Flat CTB facility, Oxy was compelled to flare its excess sales

gas. Enterprise's ongoing compression equipment malfunctions has resulted in a persistent bottleneck, preventing the safe and efficient transportation of Oxy's sales gas through their sales pipeline network. To ensure the safety and integrity of Oxy's facility operations, and to prevent potential overpressure situations within our facility, flaring has been initiated as a controlled and safety measure. This action is necessary as it allows Oxy to safely burn its excess gas, thereby preventing potential hazards such as equipment damage, leaks, or even explosions. While flaring is not Oxy's chosen method of handling excess gas, it is a vital and necessary step under these exceptional circumstances to maintain the integrity and safety of its operations. Oxy attempts to actively work with the affected third-party downstream operators to resolve these types of issues as quickly as possible and to minimize the environmental impact of flaring. As soon as flaring began, the well optimizer adjusted injection rates and shut in a several high GOR wells to minimize emissions and cease flaring. OXY made every effort to control and minimize emissions as much as possible during this event.

3. Corrective Actions taken to eliminate the cause and reoccurrence of venting or flaring:

Oxy cannot take any corrective actions to eliminate the cause and potential reoccurrence of an Enterprise gas flow pipeline restriction or shut-in, as this control issue is downstream of Oxy's custody transfer point and out of Oxy's control to avoid, prevent from happening or reoccurring. Enterprise downstream facilities and associated facilities and/or secondary pipeline operators, such as ETC., may have operational issues which will reoccur from time to time and may trigger a spike in their gas line pressure, which in turn, directly impacts Oxy's ability to send gas to them. When Enterprise or ETC has downstream activity issues or greatly struggles to handle the volume of gas being sent to them by Oxy, Enterprise and/or ETC then restricts Oxy's ability to send gas, which then prompts Oxy to route all of its stranded gas not pushed into their gas pipelines, to flare. OXY makes every effort to control and minimize emissions as much as possible. The only actions that Oxy can take and handle that is within its control, is to keep continually communicate with Enterprise and/or ETC personnel during these types of situations.

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720

District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

DEFINITIONS

Action 377726

DEFINITIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 377726
	Action Type: [C-129] Venting and/or Flaring (C-129)

DEFINITIONS

For the sake of brevity and completeness, please allow for the following in all groups of questions and for the rest of this application:

- this application's operator, hereinafter "this operator";
- venting and/or flaring, hereinafter "vent or flare";
- any notification or report(s) of the C-129 form family, hereinafter "any C-129 forms";
- the statements in (and/or attached to) this, hereinafter "the statements in this";
- and the past tense will be used in lieu of mixed past/present tense questions and statements.

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720
District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720
District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS

Action 377726

QUESTIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 377726
	Action Type: [C-129] Venting and/or Flaring (C-129)

QUESTIONS

Prerequisites	
<i>Any messages presented in this section, will prevent submission of this application. Please resolve these issues before continuing with the rest of the questions.</i>	
Incident Well	Unavailable.
Incident Facility	[fAPP2126563666] SALT FLAT CTB

Determination of Reporting Requirements	
<i>Answer all questions that apply. The Reason(s) statements are calculated based on your answers and may provide additional guidance.</i>	
Was this vent or flare caused by an emergency or malfunction	Yes
Did this vent or flare last eight hours or more cumulatively within any 24-hour period from a single event	No
Is this considered a submission for a vent or flare event	Yes, minor venting and/or flaring of natural gas.
<i>An operator shall file a form C-141 instead of a form C-129 for a release that, includes liquid during venting and/or flaring that is or may be a major or minor release under 19.15.29.7 NMAC.</i>	
Was there at least 50 MCF of natural gas vented and/or flared during this event	Yes
Did this vent or flare result in the release of ANY liquids (not fully and/or completely flared) that reached (or has a chance of reaching) the ground, a surface, a watercourse, or otherwise, with reasonable probability, endanger public health, the environment or fresh water	No
Was the vent or flare within an incorporated municipal boundary or within 300 feet from an occupied permanent residence, school, hospital, institution or church in existence	No

Equipment Involved	
Primary Equipment Involved	Other (Specify)
Additional details for Equipment Involved. Please specify	Emergency Flare > Downstream Activity > Enterprise > Continuing Compression Equipment Issues

Representative Compositional Analysis of Vented or Flared Natural Gas	
<i>Please provide the mole percent for the percentage questions in this group.</i>	
Methane (CH4) percentage	75
Nitrogen (N2) percentage, if greater than one percent	2
Hydrogen Sulfide (H2S) PPM, rounded up	0
Carbon Dioxide (CO2) percentage, if greater than one percent	3
Oxygen (O2) percentage, if greater than one percent	0
<i>If you are venting and/or flaring because of Pipeline Specification, please provide the required specifications for each gas.</i>	
Methane (CH4) percentage quality requirement	Not answered.
Nitrogen (N2) percentage quality requirement	Not answered.
Hydrogen Sulfide (H2S) PPM quality requirement	Not answered.
Carbon Dioxide (CO2) percentage quality requirement	Not answered.
Oxygen (O2) percentage quality requirement	Not answered.

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720
District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720
District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

QUESTIONS, Page 2

Action 377726

QUESTIONS (continued)

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 377726
	Action Type: [C-129] Venting and/or Flaring (C-129)

QUESTIONS

Date(s) and Time(s)	
Date vent or flare was discovered or commenced	08/13/2024
Time vent or flare was discovered or commenced	12:20 PM
Time vent or flare was terminated	06:20 PM
Cumulative hours during this event	6

Measured or Estimated Volume of Vented or Flared Natural Gas	
Natural Gas Vented (Mcf) Details	Not answered.
Natural Gas Flared (Mcf) Details	Cause: Other Other (Specify) Natural Gas Flared Released: 240 Mcf Recovered: 0 Mcf Lost: 240 Mcf.
Other Released Details	Not answered.
Additional details for Measured or Estimated Volume(s). Please specify	Gas Flare Meter
Is this a gas only submission (i.e. only significant Mcf values reported)	Yes, according to supplied volumes this appears to be a "gas only" report.

Venting or Flaring Resulting from Downstream Activity	
Was this vent or flare a result of downstream activity	Yes
Was notification of downstream activity received by this operator	No
Downstream OGRID that should have notified this operator	[713731] Enterprise Crude Pipeline LLC
Date notified of downstream activity requiring this vent or flare	Not answered.
Time notified of downstream activity requiring this vent or flare	Not answered.

Steps and Actions to Prevent Waste	
For this event, this operator could not have reasonably anticipated the current event and it was beyond this operator's control.	True
Please explain reason for why this event was beyond this operator's control	This emissions event was caused by the unforeseen, unexpected, sudden, and unavoidable breakdown of equipment or process that was beyond the owner/operator's control and did not stem from activity that could have been foreseen and avoided, and could not have been avoided by good design, operation, and preventative maintenance practices. Oxy engages in respectable and good facility operation practices while also maintaining its continuous facility equipment preventative maintenance program. In this case, there were continuing third party issues which were affecting Oxy's ability to push forward its gas, which resulted in a flaring event to occur. Due to compression issues experienced by a third-party downstream operator, Enterprise, from Oxy's Salt Flat CTB facility, Oxy was compelled to flare its excess sales gas. Enterprise's ongoing compression equipment malfunctions has resulted in a persistent bottleneck, preventing the safe and efficient transportation of Oxy's sales gas through their sales pipeline network. To ensure the safety and integrity of Oxy's facility operations, and to prevent potential overpressure situations within our facility, flaring has been initiated as a controlled and safety measure. This action is necessary as it allows Oxy to safely burn its excess gas, thereby preventing potential hazards such as equipment damage, leaks, or even explosions. While flaring is not Oxy's chosen method of handling excess gas, it is a vital and necessary step under these exceptional circumstances to maintain the integrity and safety of its operations. Oxy attempts to actively work with the affected third-party downstream operators to resolve these types of issues as quickly as possible and to minimize the environmental impact of flaring. This flaring situation was

	<p>beyond OXY's control, but Oxy took all possible measures to reduce emissions effectively. The duration and volume of this flaring event is a combination of multiple intermittent flaring instances withi</p>
<p>Steps taken to limit the duration and magnitude of vent or flare</p>	<p>This facility is unmanned, except when Oxy production techs are gathering data daily or conducting daily walkthroughs to ensure that there are no problems, circumstances and/or assist other personnel on-site for maintenance purposes. It is OXY's policy to route its stranded gas to a flare during an unforeseen and unavoidable emergency or malfunction, as the part of the overall process or steps to take to limit duration and magnitude of flaring. Oxy personnel are in the field 24/7 and can physically see when we are flaring which in turn are communicated to additional Oxy field personnel. Internal OXY procedures ensure that upon notice of flaring, malfunction gas compressor unit and/or multiple unit shutdown alarms, increased sensor line pressure alarms, etc., field production technician personnel are promptly notified, and are instructed to assess the issue as soon as possible to take prompt corrective action and minimize emissions. Oxy production technicians must assess whether the issue or circumstance is due to damage and repair is needed, or whether there are other reasons for its cause. In this case, there were continuing third party issues which were affecting Oxy's ability to push forward its gas, which resulted in a flaring event to occur. Due to compression issues experienced by a third-party downstream operator, Enterprise, from Oxy's Salt Flat CTB facility, Oxy was compelled to flare its excess sales gas. Enterprise's ongoing compression equipment malfunctions has resulted in a persistent bottleneck, preventing the safe and efficient transportation of Oxy's sales gas through their sales pipeline network. To ensure the safety and integrity of Oxy's facility operations, and to prevent potential overpressure situations within our facility, flaring has been initiated as a controlled and safety measure. This action is necessary as it allows Oxy to safely burn its excess gas, thereby preventing potential hazards such as equipment damage, leaks, or ev</p>
<p>Corrective actions taken to eliminate the cause and reoccurrence of vent or flare</p>	<p>Oxy cannot take any corrective actions to eliminate the cause and potential reoccurrence of an Enterprise gas flow pipeline restriction or shut-in, as this control issue is downstream of Oxy's custody transfer point and out of Oxy's control to avoid, prevent from happening or reoccurring. Enterprise downstream facilities and associated facilities and/or secondary pipeline operators, such as ETC., may have operational issues which will reoccur from time to time and may trigger a spike in their gas line pressure, which in turn, directly impacts Oxy's ability to send gas to them. When Enterprise or ETC has downstream activity issues or greatly struggles to handle the volume of gas being sent to them by Oxy, Enterprise and/or ETC then restricts Oxy's ability to send gas, which then prompts Oxy to route all of its stranded gas not pushed into their gas pipelines, to flare. OXY makes every effort to control and minimize emissions as much as possible. The only actions that Oxy can take and handle that is within its control, is to keep continually communicate with Enterprise and/or ETC personnel during these types of situations.</p>

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720
District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720
District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

ACKNOWLEDGMENTS

Action 377726

ACKNOWLEDGMENTS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 377726
	Action Type: [C-129] Venting and/or Flaring (C-129)

ACKNOWLEDGMENTS

<input checked="" type="checkbox"/>	I acknowledge that I am authorized to submit a <i>Venting and/or Flaring</i> (C-129) report on behalf of this operator and understand that this report can be a complete C-129 submission per 19.15.27.8 and 19.15.28.8 NMAC.
<input checked="" type="checkbox"/>	I acknowledge that upon submitting this application, I will be creating a new incident file (assigned to this operator) to track any C-129 forms, pursuant to 19.15.27.7 and 19.15.28.8 NMAC and understand that this submission meets the notification requirements of Paragraph (1) of Subsection G and F respectively.
<input checked="" type="checkbox"/>	I hereby certify the statements in this report are true and correct to the best of my knowledge and acknowledge that any false statement may be subject to civil and criminal penalties under the Oil and Gas Act.
<input checked="" type="checkbox"/>	I acknowledge that the acceptance of any C-129 forms by the OCD does not relieve this operator of liability should their operations have failed to adequately investigate, report, and remediate contamination that poses a threat to groundwater, surface water, human health, or the environment.
<input checked="" type="checkbox"/>	I acknowledge that OCD acceptance of any C-129 forms does not relieve this operator of responsibility for compliance with any other applicable federal, state, or local laws and/or regulations.

District I
 1625 N. French Dr., Hobbs, NM 88240
 Phone:(575) 393-6161 Fax:(575) 393-0720
District II
 811 S. First St., Artesia, NM 88210
 Phone:(575) 748-1283 Fax:(575) 748-9720
District III
 1000 Rio Brazos Rd., Aztec, NM 87410
 Phone:(505) 334-6178 Fax:(505) 334-6170
District IV
 1220 S. St Francis Dr., Santa Fe, NM 87505
 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 377726

CONDITIONS

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 377726
	Action Type: [C-129] Venting and/or Flaring (C-129)

CONDITIONS

Created By	Condition	Condition Date
shelbyschoepf	If the information provided in this report requires an amendment, submit a [C-129] Amend Venting and/or Flaring Incident (C-129A), utilizing your incident number from this event.	8/26/2024