

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT Sundry Print Report

Well Name: RED TANK 26 FED Well Location: T22S / R32E / SEC 26 / County or Parish/State: LEA /

SWNW /

Well Number: 03 Type of Well: OIL WELL Allottee or Tribe Name:

Unit or CA Number: Lease Number: NMNM86149 **Unit or CA Name:**

Operator: OXY USA **US Well Number: 3002532463** Well Status: Producing Oil Well

INCORPORATED

Notice of Intent

Sundry ID: 2652462

Type of Submission: Notice of Intent Type of Action: Plug and Abandonment

Date Sundry Submitted: 01/13/2022 **Time Sundry Submitted: 11:13**

Date proposed operation will begin: 03/18/2022

Procedure Description: Please see attached planned procedure and WBD's.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Red_Tank_26_Fed_003___WBD.Procedure_20220113111228.pdf

Accepted for Record Only

SUBJECT TO LIKE APPROVAL BY BLM

NMOCD 3/15/22

County or Parish/State: LEA/ Well Location: T22S / R32E / SEC 26 /

SWNW /

Well Number: 03 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMNM86149 **Unit or CA Name: Unit or CA Number:**

US Well Number: 3002532463 Well Status: Producing Oil Well Operator: OXY USA

INCORPORATED

Conditions of Approval

Specialist Review

Red_Tank_26_Federal_3_Sundry_ID_2652462_P_A_20220129143751.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: RONI MATHEW Signed on: JAN 13, 2022 11:12 AM

Name: OXY USA INCORPORATED Title: REGULATORY SPECIALIST

Street Address: 5 Greenway Plaza, Suite 110

City: Houston State: TX

Phone: (713) 215-7827

Email address: RONI_MATHEW@OXY.COM

Field Representative

Representative Name:

Street Address:

State: City: Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: LONG VO BLM POC Title: Petroleum Engineer

BLM POC Email Address: LVO@BLM.GOV **BLM POC Phone:** 5752345972

Disposition: Approved **Disposition Date:** 01/29/2022

Signature: Long Vo

Page 2 of 2

76-772-37E

Prairie Chicken, Low Come

Red Tank 26 Federal#003: 30-025-32463

- 1. RIH & POOH tubing and prod equipment
- 2. RIH & set CIBP @ 7143' & spot 205sx Class C cmt 7143'-5599', WOC. Tag
- 3. M&P 65 sx Class C cmt 4866'-4404', WOC. Tag
- 4. Perf & Sqz 180sx Class C cmt 2080' 1500', WOC. Tag (2030' to 1248') 185 5x
- 5. Perf & Sqz 265sx Class C cmt 871'-Surf, WOC. Verify @ Surf

10# MLF between plugs, above ground steel tanks will be utilized

APPROVAL SUBJECT TO GENERAL REQUIREMENTS AND SPECIAL STIPULATIONS ATTACHED

Sundry ID: 2652462

Sundry ID 2652462.00

Perforations Plug (If No CIBP) 8332.00 8463.00 131.00 Tag/Verify Not Necessary	Sundry ID	2652462.00	T				
Surface Plug	Plug Type	-					
Shoe Plug	Surface Plus		-			Sacks	Notes
Shoe Plug	ouriace Flug	0.00	871.00	871.00	Tag/Verify		
Top of Salt @ 1312							
Top of Sait @ 1312	Shoe Plug	774.00					(In/Out) From 871'
Top of Salt @ 1312	Olive Flug	771.00	871.00	100.00	Tag/Verify	265.00	
Base of Salt @ 4454							Perf and Squeeze
Base of Salt @ 4454	Top of Salt @ 1212	4040.00		9			(In/Out) From 2030'
Shoe Plug	Rase of Salt @ 4454					185.00	to 1248' (Tag)
Section Sect	Shoe Plug	NAME OF TAXABLE PARTY O					
Delaware @ 4751	- Ciloc i lug	4505.00	4605.00	100.00	Tag/Verify		
Delaware @ 4751							
Delaware @ 4751					If solid		
Delaware @ 4751					1		
Tag (CIBP present), If Perf & Sqz then Tag, Leak Test all Delaware @ 4751 4653.49 4801.00 147.51 CIBP 65.00 4359' (Tag)							
Cibp Delaware @ 4751							
Delaware @ 4751	The state of the s						
If Perf & Sqz then Tag, Leak Test all Spot from 4866' to 655.00 100.00 Tag/Verify					1 .		
Sqz then Tag, Leak Test all Spot from 4866' to 65.00 100.00 Tag/Verify							
Delaware @ 4751							
Delaware @ 4751							
Delaware @ 4751							Snot from 4866' to
CIBP Plug		4653.49	4801.00	147.51			
If solid base no need to Tag (CIBP present), If Perf & Sqz then Tag, Leak Test all 205.00 5599' (Tag)	DV tool plug	6465.00	6565.00	The same of the sa		55.55	4000 (Tag)
Dase no need to Tag (CIBP present), If Perf & Sqz then Tag, Leak Test all 205.00 5599' (Tag)					- J		
CIBP Plug					1		
Tag (CIBP present), If Perf & Sqz then Tag, Leak Test all 205.00 S599' (Tag)					1		
CIBP Plug							
CIBP Plug						- Control of the Cont	
CIBP Plug 7108.00 7143.00 7143.00 35.00 CIBP Perforations Plug (If No CIBP) Perforations Plug (If No CIBP) Responsible to Example 1							
CIBP Plug							
Tag, Leak Test all CIBP CIBP Spot from CIBP to 5599' (Tag)							
Test all CIBP Test all CIBP				1			
Perforations Plug (If No CIBP)							
Perforations Plug (If No CIBP)	CIBP Plug	7100 00	7442.00				Spot from CIBP to
Tag/Verify Not Necessary Not Necessary	Perforations Plug (If No	7100.00	7 143.00	35.00	CIBP	205.00	5599' (Tag)
Perforations Plug (If No CIBP) 8332.00 8463.00 131.00 Tag/Verify Not Necessary	CIBP)	7143.00	7320.00	100.00	Tooklovis		
If solid base no need to Tag (CIBP present), If Perf & Sqz then Tag, Leak Test all Shoe Plug	Perforations Plug (If No	7140.00	1323.00	100.00	ragiverny	- 1	Not Necessary
If solid base no need to Tag (CIBP present), If Perf & Sqz then Tag, Leak Test all Shoe Plug	CIBP)	8332.00	8463 00	131 00	Tag//arify		Not Noncesses
base no need to Tag (CIBP present), If Perf & Sqz then Tag, Leak Test all Other Plug				101.00	rag/verily		NOT Necessary
need to Tag (CIBP present), If Perf & Sqz then Tag, Leak Test all CIBP Not Necessary							
Tag (CIBP present), If Perf & Sqz then Tag, Leak Test all CIBP Not Necessary					1		
(CIBP present), If Perf & Sqz then Tag, Leak Test all Not Necessary				1	TOTAL COST AND ADDRESS.		
present), If Perf & Sqz then Tag, Leak Test all Not Necessary				1			
If Perf & Sqz then Tag, Leak Test all Not Necessary				1			
Sqz then Tag, Leak Test all CIBP Not Necessary				1.7			
Tag, Leak Test all Not Necessary							
Bonesprings @ 8643 8506.57 8693.00 Test all CIBP Not Necessary							
Sonesprings @ 8643 8506.57 8693.00 186.43 CIBP Not Necessary							
Shoe Plug	Bonesprings @ 2642	9F06 F7	0000 00	1	The second secon		
100 001 ad//erify Net Necessary		WHAT THE PARTY OF		The state of the s			
Not Necessary		0/01.00	00.1.00	100.00	ag/Verify	N	lot Necessary

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Critical, High, Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water. R111P: 50' from bottom of salt to surface

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected

Cave Karst/Potash Cement	low		
Shoe @ Shoe @	821.00 4555.00		
Shoe @	8801.00	TOC @	2030.00
Perforatons Top @ Perforatons Top @	7193.00 8382.00	Perforations Bottom @ Perforations	7279.00
· onerations Top @	0302.00	Bottom @	8413.00
DV Tool @	6515.00	CIBP @	7143.00

Roni Mathew 11/2/2021

Proposed Wellbore

RED TANK 26 FEDERAL #003

30-025-32463-0000 Lea

17-1/2" hole @ 821' 13-3/8"54.5# csg @ 821' w/ 800sx-TOC-Surf-Circ.

11" hole @ 4555' 8-5/8" 32# csg @ 4555' w/ 1000sx - TOC-Surf-Circ.


7-7/8" hole @ 8801' 5-1/2" 17# csg @ 8801' w/ 1200sx - TOC~2030'

Tubing Assembly 2-7/8" tubing 0-7855'

DV Tool @ 6515'

Prod Zone 7279' - 7193'

Prod Zone 8413' - 8382'

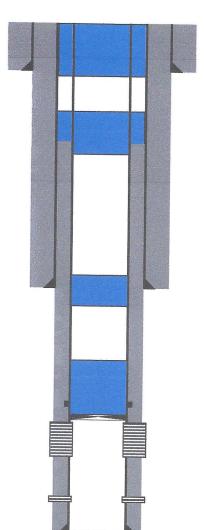

TD - 8801'

PBTD - 8755'

Perf & Sqz 265sx Class C cmt 871'-Surf, WOC. Verify @ Surf

Perf & Sqz 186sx Class C cmt 2980'-1560', WOC. TAG

M&P 65 sx Class C cmt 4866'-4404', WOC. TAG

SET CIBP @ 7143'. TAG & LEAK TEST.

M&P 205sx Class C cmt 7143'-5599', WOC. TAG

Roni Mathew 11/2/2021

Current Wellbore

RED TANK 26 FEDERAL #003

30-025-32463-0000 Lea

17-1/2" hole @ 821' 13-3/8"54.5# csg @ 821' w/ 800sx-TOC-Surf-Circ.

11" hole @ 4555' 8-5/8" 32# csg @ 4555' w/ 1000sx - TOC-Surf-Circ.


7-7/8" hole @ 8801' 5-1/2" 17# csg @ 8801' w/ 1200sx - TOC~2030'

Tubing Assembly 2-7/8" tubing 0-7855'

DV Tool @ 6515'

Prod Zone 7279' - 7193'

Prod Zone 8413' - 8382'

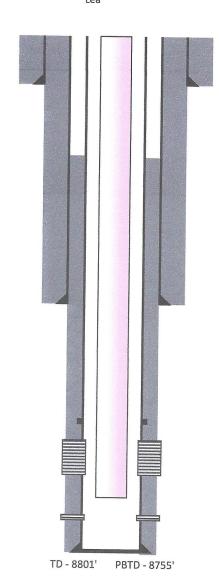

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Melissa Horn Environmental Protection Specialist 575-234-5951

Kelsey Wade Environmental Protection Specialist 575-234-2220

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 76730

COMMENTS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	76730
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Create	ed By	Comment	Comment Date
plma	artinez	DATA ENTRY PM	3/16/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 76730

CONDITIONS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	76730
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
kfortner	Like approval from BLM	3/15/2022