Received by NCD: 3/8/2022 3:45:18 PM U.S. Department of the Interior BUREAU OF LAND MANAGEMENT		Sundry Print Report 08/08/2022
Well Name: STERLING SILVER	Well Location: T24S / R31E / SEC 3 / SWNW /	County or Parish/State: EDDY / NM
Well Number: 1	Type of Well: OTHER	Allottee or Tribe Name:
Lease Number: NMNM55142	Unit or CA Name:	Unit or CA Number:
US Well Number: 300152583100S2	Well Status: Gas Well Shut In	Operator: OXY USA INCORPORATED

Accepted for record – NMOCD gc 8/9/2022

Notice of Intent

Sundry ID: 2685068

Type of Submission: Notice of Intent

Date Sundry Submitted: 08/02/2022

Date proposed operation will begin: 09/02/2022

Type of Action: Plug and Abandonment Time Sundry Submitted: 07:11 15

Procedure Description: PLEASE SEE THE CURRENT WELLBORE, PROPOSED WELLBORE, AND PLUGGING PROCEDURE ATTACHED.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Sterling_Silver_3_FED_1_P_A_Intent_SUBMISSION_PACKET_8.2.22_20220802070329.pdf

vived by OCD: 8/8/2022 3:45:18 PM Well Name: STERLING SILVER	Well Location: T24S / R31E / SEC 3 / SWNW /	County or Parish/State: EDBY 7	
Well Number: 1	Type of Well: OTHER	Allottee or Tribe Name:	
Lease Number: NMNM55142	Unit or CA Name:	Unit or CA Number:	
US Well Number: 300152583100S2	Well Status: Gas Well Shut In	Operator: OXY USA INCORPORATED	
Conditions of Approv	al		
Conditions of Approv ecialist Review	al		
ecialist Review	al _COA_AND_PROCEDURE_2022080710		
ecialist Review			

Ο	perator	Electronic	Signature:	STEPHEN	JANACEK
-	perater	LICOU 01110	orginataro.	01211214	0/ 11 1/ 10

State: TX

State:

Name: OXY USA INCORPORATED

Title: Regulatory Engineer

Street Address: 5 Greenway Plaza, Suite 110

City: Houston

Phone: (713) 497-2417

Email address: stephen_janacek@oxy.com

Field

Representative Name: Street Address: City: Phone:

Email address:

BLM Point of Contact


BLM POC Name: KEITH P IMMATTY BLM POC Phone: 5759884722 Disposition: Approved Signature: Keith Immatty **BLM POC Title:** ENGINEER


Zip:

BLM POC Email Address: KIMMATTY@BLM.GOV

Signed on: AUG 02, 2022 07:02 AM

Disposition Date: 08/07/2022

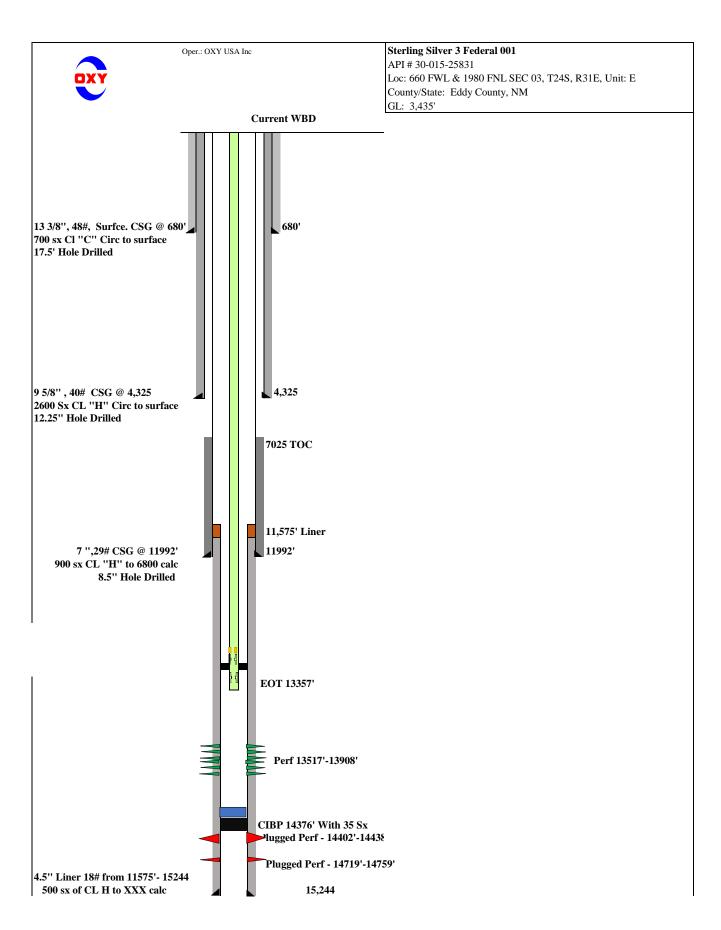

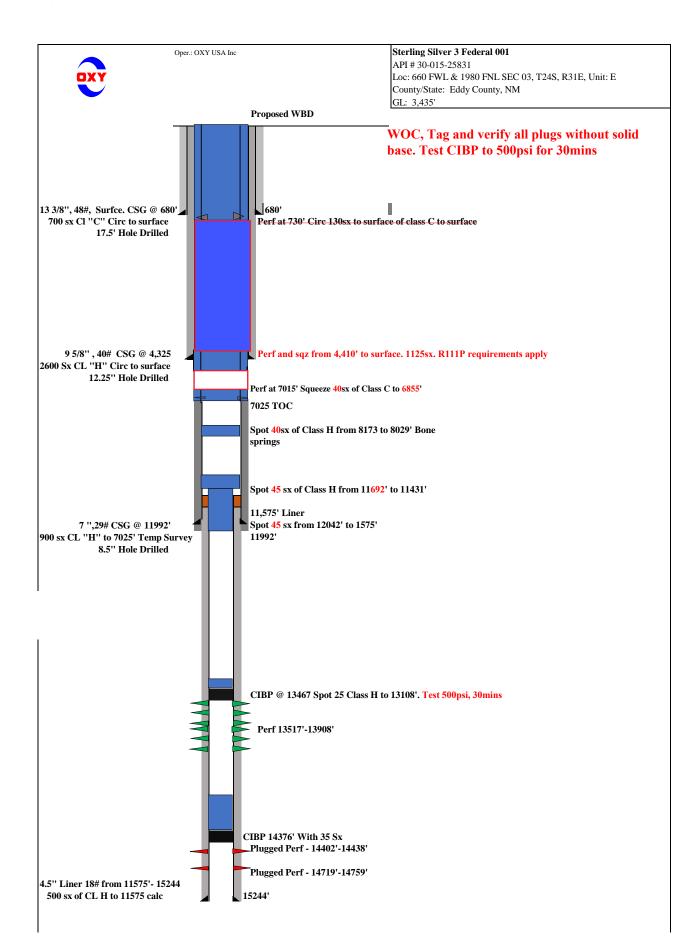

Notice of Intent to PA Sterling Silver 3 Federal 001 30-015-25831

 POOH with production equipment
Set CIBP@ 13467 and spot 25 sx of class H to 13108'. Pressure test base to 500psi, 30mins
Spot 45sx of class H from 12042' to 11575'. WOC & Tag
Spot 45sx of class H from 11692' to 11431'. WOC & Tag
Spot 40sx of Class H from 8173' to 8029'. WOC & Tag

6. Perf at 7015 and squeeze. 40sx of class C from 7015' to 6855'. WOC & Tag

7. Perf and circulates 1125sx from 4410' to surface , Comfirm cement at surface. R111P requirements apply

FORMATION TOP BOTTOM DESCRIPTION, CONTENTS, ETC.					TOP		
Atoka	13,534'	13,600'	Cushion used - fresh wtr (9061 ft)	NAME	MEAS, DEPTH	TRUE VERT. DEPTI	
			80 min, IF 4129-4256 psi;(ISI 180 min, Rec mud & 362 MCFGPD rate 9190 psi)	Delaware Sd Bone Spring	4,360 8,173		
Atoka	13,718'	13,777'	Cushion used - fresh wtr (9100 ft) IF 5 min, 4402 psi; 1 hr ISI 9184 psi; FF 4486-4542 psi; 4 hr FSI. BHP 9285 psi, rec 0.2 cu.ft. gas.	Wolfcamp Strawn Atoka Atoka Clastics Lower Atoka	11,642 13,326 13,375 13,538 13,813		
Lower Atoka	13,848'	13,970'	Cushion - fresh wtr (9100') IF 4079-4196 psi; ISI 9300 psi; 2nd flow 4218-4414 psi; 2nd SI 9046 psi; 3rd flow 4442-4526 psi; 3rd SI 8714 psi - rate 225 MCFPD	Morrow Marker Morrow Clastics Lower Morrow	14,136 14,488 15,077		
lorrow	14,396'	14,450'	Cushion - fresh wtr (11,200') IF 9 min 5599-5952 psi; ISI 60 min 9399 psi; FF 180 min 5946-7644 psi, 0.4 cu.ft. gas, trace of oil.				

•

Sundry ID	2685068					
Plug Type	Тор	Bottom	Length	Tag	Sacks	Notes
Surface Plug	0.00	4375.00	4375.00	Tag/Verify	1125.00	Delaware perf and sqz and plug to surface. R111P Delaware perf and sqz and plug to
Shoe Plug	623.20	730.00	106.80	Tag/Verify	1125.00	surface. R111P
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open		Delaware perf and
Fresh Water @ 700	643.00	750.00	107.00	Perforatio ns	1125.00	sqz and plug to surface. R111P
Top of Salt @ 956	896.44			Tag/Verify		Delaware perf and sqz and plug to surface. R111P
Shoe Plug	4231.75			Tag/Verify		Delaware perf and sqz and plug to surface. R111P
				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio		
Delaware @ 4360 Spacer Plug	4266.40 6855.00		143.60 160.00			Perf and sqz Perf and sqz

•

Bonesprings @ 8173	8041.27	8223.00		If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio ns	40.00	
Wolfcamp @ 11642	11475.58	11692.00		If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio ns	45.00	
Shoe Plug	11822.08	12042.00	219.92	Tag/Verify	45.00	

				If solid		
				base no		
				need to		
				Tag		
				(CIBP		
				present		
				and/or		
				Mechanic		
				al Integrity		
				Test), If		
				Perf &		
				Sqz then		
				Tag, Leak		
				Test all		
				CIBP if no		
				Open		
				Perforatio		Pressure test
CIBP Plug	13432.00	13467.00	35.00	ns	25.00	500psi, 30mins

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs
in cased hole.
Class H >7500'
Class C<7500'
Fluid used to mix the cement in R111P shall be saturated with the salts common to the section
penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will
be considered the desired mixture whenever possible.
Critical, High Cave Karst: Cave Karst depth to surface
R111P: Solid plug in all annuli - 50' from bottom of salt to surface.

Class C: 1.32 ft^3/sx	
Class H: 1.06 ft^3/sx	

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	Low	
Shoe @	680.00	
Shoe @	4325.00	
Shoe @	11992.00	
Shoe @	15244.00	
Perforatons Top @	13517.00	Perforations 13908.00

CIBP @ 13467.00

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.** Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¹/₄ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>**Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u></u> From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted</u>**



United States Department of the Interior

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612 Received by OCD: 8/8/2022 3:45:18 PM

District I 1625 N. French Dr., Hobbs, NM 88240 Ph Di

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	132233
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
gcordero	None	8/9/2022

CONDITIONS

Page 15 of 15

Action 132233

525 N. French Dr., Hobbs, NM 88240
hone:(575) 393-6161 Fax:(575) 393-0720
istrict II
14.0 Einst On Astasia NIM 00040

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720