	State of New Mexico	Form C-103
<u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	Energy, Minerals and Natural Resources	Revised July 18, 2013 WELL API NO. 30-025-35328
811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	5. Indicate Type of Lease
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr. Santa Fe, NM 87505	STATE X FEE
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, INM 67303	6. State Oil & Gas Lease No.
SUNDRY NOTICE	ES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name
(LS TO DRILL OR TO DEEPEN OR PLUG BACK TO A TION FOR PERMIT" (FORM C-101) FOR SUCH	JACKSON UNIT
1. Type of Well: Oil Well 🗵 G	as Well Other	8. Well Number ₀₀₈
2. Name of Operator TAP ROCK OPERATING, LLC		9. OGRID Number 372043
3. Address of Operator 523 PARK POINT DR, SUITE 20	00, GOLDEN, CO 80401	10. Pool name or Wildcat [79335] JOHNOSN RANCH; WOLFCAMP (GAS)
4. Well Location		1
Unit Letter F : 196	feet from the NORTH line and 198	feet from the WEST line
Section 22	Township 24S Range 33E	NMPM County LEA
	11. Elevation (Show whether DR, RKB, RT, GR, etc. 3591 GR)
TEMPORARILY ABANDON PULL OR ALTER CASING DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM OTHER: 13. Describe proposed or complet of starting any proposed work proposed completion or recon	enced well due to uneconomic conditions. See	ILLING OPNS. P AND A T JOB d give pertinent dates, including estimated date mpletions: Attach wellbore diagram of
CIBP 13,200	Condition of Appro OCD Hobbs office prior of running MIT	24 hours
CIBP 13,200 Thereby certify that the information ab	Condition of Appro OCD Hobbs office prior of running MIT ove is true and complete to the best of my knowledge	te and belief.
CIBP 13,200	Condition of Appro OCD Hobbs office prior of running MIT	e 24 hours Test & Chart

Jackson Unit #8

API: 30-025-35328 Sec 22-T24S-R33E Lea County, NM

Temporary Abandonment Procedure August 20, 2022

Basic Wellbore Construction Data:

Casing Data				
Size O.D.	Weight	Depth	TOC	
13-3/8"	48 ppf	797'	Surface	
9-5/8"	47 ppf	5,260'	Surface'	
7''	32 ppf	12,600'	3,210'	
3-1/2"		13,924'	12,360'	
Tubing Dat	Tubing Data			
2-7/8"	6.5 ppf	13,044'		
Open Perforations				
13,276'-				
13,754'				

Objective: Temporary and abandonment of wellbore.

Safety:

Comply with all NMOCD, BLM, and Operator safety regulations.

All Personnel MUST wear hard hats, steel toed boots, and safety glasses.

No smoking inside rig anchors.

Hold a job safety meeting each morning, and as needed before specific job tasks.

Downhole Work Procedure:

- 1. Release pkr and POOH lay down pkr and standback tubing. ND WH, NU 5K manual BOP.
- 2. MIRU WL lubricators. RIH w/ 6-1/8" GR & JB. Contact engineer if ran into tight spots. POOH w/6-1/8" GR & JB check for any debris.
- 3. RIH WL w/7" BP. Set plug at 15,000 and dump ~100 sxs cmt over the plug. WOC and tag. POOH and RDMO WL. 13,200
- 4. RIH 2-7/8" tbg, load csg w/2% KCL and biocide. Pressure test csg to 500 psi for 30 minutes. Notify NMOCD of the results.
- 5. POOH w/2-7/8" tbg. NU WH and RDMO
- 6. Release all associated equipment and clean up location of any trash.

Jackson Unit #8

API: 30-025-35328 Sec 22-T24S-R33E Lea County, NM

Temporary Abandonment Procedure August 20, 2022

Basic Wellbore Construction Data:

Casing Data				
Size O.D.	Weight	Depth	TOC	
13-3/8"	48 ppf	797'	Surface	
9-5/8"	47 ppf	5,260'	Surface'	
7"	32 ppf	12,600'	3,210'	
3-1/2"		13,924'	12,360'	
Tubing Dat	Tubing Data			
2-7/8"	6.5 ppf	13,044'		
Open Perforations				
13,276'-				
13,754'				

Objective: Temporary and abandonment of wellbore.

Safety:

Comply with all NMOCD, BLM, and Operator safety regulations.

All Personnel MUST wear hard hats, steel toed boots, and safety glasses.

No smoking inside rig anchors.

Hold a job safety meeting each morning, and as needed before specific job tasks.

Downhole Work Procedure:

- 1. Release pkr and POOH lay down pkr and standback tubing. ND WH, NU 5K manual BOP.
- 2. MIRU WL lubricators. RIH w/ 6-1/8" GR & JB. Contact engineer if ran into tight spots. POOH w/6-1/8" GR & JB check for any debris.
- 3. RIH WL w/7" BP. Set plug at 13,000' and dump ~100 sxs cmt over the plug. WOC and tag. POOH and RDMO WL.
- 4. RIH 2-7/8" tbg, load csg w/2% KCL and biocide. Pressure test csg to 500 psi for 30 minutes. Notify NMOCD of the results.
- 5. POOH w/2-7/8" tbg. NU WH and RDMO
- 6. Release all associated equipment and clean up location of any trash.

Jackson Unit #8

API: 30-025-35328 Sec 22-T24S-R33E Lea County, NM

Temporary Abandonment Procedure August 20, 2022

Basic Wellbore Construction Data:

Casing Data				
Size O.D.	Weight	Depth	TOC	
13-3/8"	48 ppf	797'	Surface	
9-5/8"	47 ppf	5,260'	Surface'	
7''	32 ppf	12,600'	3,210'	
3-1/2"		13,924'	12,360'	
Tubing Dat	Tubing Data			
2-7/8"	6.5 ppf	13,044'		
Open Perforations				
13,276'-				
13,754'				

Objective: Temporary and abandonment of wellbore.

Safety:

Comply with all NMOCD, BLM, and Operator safety regulations.

All Personnel MUST wear hard hats, steel toed boots, and safety glasses.

No smoking inside rig anchors.

Hold a job safety meeting each morning, and as needed before specific job tasks.

Downhole Work Procedure:

- 1. Release pkr and POOH lay down pkr and standback tubing. ND WH, NU 5K manual BOP.
- 2. MIRU WL lubricators. RIH w/ 6-1/8" GR & JB. Contact engineer if ran into tight spots. POOH w/6-1/8" GR & JB check for any debris.
- 3. RIH WL w/7" BP. Set plug at 13,000' and dump ~100 sxs cmt over the plug. WOC and tag. POOH and RDMO WL.
- 4. RIH 2-7/8" tbg, load csg w/2% KCL and biocide. Pressure test csg to 500 psi for 30 minutes. Notify NMOCD of the results.
- 5. POOH w/2-7/8" tbg. NU WH and RDMO
- 6. Release all associated equipment and clean up location of any trash.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 139592

COMMENTS

Operator:	OGRID:
TAP ROCK OPERATING, LLC	372043
523 Park Point Drive	Action Number:
Golden, CO 80401	139592
	Action Type:
	[C-103] NOI Temporary Abandonment (C-103I)

COMMENTS

Create	ed By	Comment	Comment Date
plma	artinez	PM	9/14/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 139592

CONDITIONS

Operator:	OGRID:
TAP ROCK OPERATING, LLC	372043
523 Park Point Drive	Action Number:
Golden, CO 80401	139592
	Action Type:
	[C-103] NOI Temporary Abandonment (C-103I)

CONDITIONS

Created By	Condition	Condition Date
kfortner	Run TA status MIT/BHT test Note changes to procedure	9/14/2022