U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Well Number: 1

Sundry Print Report

Well Name: CIRRUS FEDERAL COM Well Location: T19S / R32E / SEC 8 / County or Parish/State: LEA /

NWSE /

Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMNM92771 Unit or CA Name: CIRRUS FED COM Unit or CA Number:

NMNM119215

US Well Number: 3002538420 Well Status: Producing Oil Well Operator: COG OPERATING

LLC

Accepted for record – NMOCD gc 10/6/2022

Notice of Intent

Sundry ID: 2653345

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date proposed operation will begin: 01/12/2022

Procedure Description: 1. Set 5 1/2" CIBP @ 11,548'. Circ hole w/ MLF. Pressure test csg. Spot 25 sx class H cmt @ 11,548-11,448'. Lea County, NM OPERATOR NAME: LEASE NO.: WELL NAME & NO.: US WELL NUMBER: LOCATION: COUNTY: COG Operating, LLC NMNM92771 Cirrus Fed Com #1 30-025-38420 T19S/R23E/Sec 8 2. Spot 25 sx cmt @ 10,494-10,394'. WOC & Tag (Wolfcamp) 3. Spot 25 sx cmt @ 7140-6940'. (Bone Springs) 4. Spot 25 sx cmt @ 3960-3760'. WOC & Tag (9 5/8" Shoe & Queen) 5. Perf & Sqz 50 sx cmt @ 2918-2718'. WOC & Tag (Yates) 6. Perf & Sqz 50 Sx cmt @ 1030-828'. WOC & Tag (T/Salt & 13 3/8" Shoe) 7. Perf & Sqz 50 sx cmt @ 200' to surface. 8. Cut off well head, verify cmt @ surface, weld on Dry Hole Marker.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Cirrus_Fed_Com_1_Proposed_WBD_20220119181505.pdf

Cirrus_Fed_Com_1_Current_WBD_20220119181442.pdf

weived by OCD: 10/6/2022 1:28:58 PM Well Location: T19S / R32E / SEC 8 / County or Parish/State: LEA /

NWSE /

Well Number: 1 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMNM92771 Unit or CA Name: CIRRUS FED COM Unit or CA Number:

NMNM119215

US Well Number: 3002538420 Well Status: Producing Oil Well Operator: COG OPERATING

LLC

Conditions of Approval

Specialist Review

Cirrus_Federal_Com_1_Sundry_ID_2653345_P_A_20220129143011.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: RUTH SHOCKENCY Signed on: JAN 19, 2022 06:15 PM

Name: COG OPERATING LLC

Title: Regulatory Analyst

Street Address: 600 W. ILLINOIS AVE.

City: MIDLAND State: TX

Phone: (575) 703-8321

Email address: RUTH.SHOCKENCY@CONOCOPHILLIPS.COM

Field Representative

Representative Name:

Street Address:

City: State: Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: LONG VO BLM POC Title: Petroleum Engineer

BLM POC Phone: 5752345972 **BLM POC Email Address:** LVO@BLM.GOV

Disposition: Approved **Disposition Date:** 01/29/2022


Signature: Long Vo

Page 2 of 2

ConocoPhillips CURRENT

<u>Lease & Well #</u> Cirrus Federal Com #1 **30-025-38420**

Spud: 6/30/2007

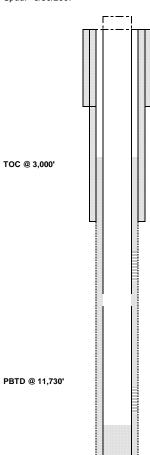

Spud 17 1/2" hole @4:00 PM 06/30/07. Ran 20 jts (877.01') 13 3/8" 48# J-55 STC csg to 878.21'. Cmtd w/510 sx HLP, tailed in w/250 sx HLP, PD @12:15 PM 07/02/07, circ 50 sx to pit.

TD 12 1/4" hole @10:45 PM 07/08/07. Ran 88 jts (3887.65') 9 5/8" 36# J-55 csg to 3910'. Cmtd 1st stg w/350 sx H/L, tailed in w/100 sx P+, PD @3:00 PM 07/09/07, circ 165 sx off DV tool. Cmtd 2nd stg w/350 sx H/L, tailed in w/200 sx P+, PD @11:09 PM 07/10/07, circ 40 sx to pit.

Name	Тор
1 vanic	Meas. Depth
Rustler	950'
Yates	2868'
Seven Rivers	3168'
Bowers	3528'
Queen	3772'
Delaware	5518'
Bone Spring	7090'
Wolfcamp	10444'
Strawn	11482'

11,598'-11,617', 20 shots - Strawn

TD 7 7/8" hole @8:00 AM 07/30/07. Ran 263 jts (11800.35') 5 1/2" 17# N-80 csg to 11805.65'. Cmtd 1st stg w/550 sx PB Super H, PD @7:41 AM on 08/01/07, circ 117 sx to pit. Cmtd 2nd stg w/700 sx HLPP, PD @3:23 PM on 08/01/07, dnc. Ran temp survey - TOC @3000'.

TD @ 11,810'


ConocoPhillips PROPOSED

Lease & Well # Cirrus Federal Com #1

30-025-38420

TOC @ 3,000'

Spud: 6/30/2007

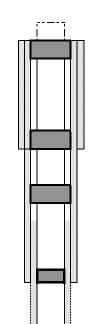

7. Perf & Sqz 50 sx cmt @ 200' to surface.

Spud 17 1/2" hole @4:00 PM 06/30/07. Ran 20 jts (877.01') 13 3/8" 48# J-55 STC csg to 878.21'. Cmtd w/510 sx HLP, tailed in w/250 sx HLP, PD @12:15 PM 07/02/07, circ 50 sx to pit.

6. Perf & Sqz 50 Sx cmt @ 1030-828'. WOC & Tag (T/Salt & 13 3/8" Shoe)

5. Perf & Sqz 50 sx cmt @ 2918-2718'. WOC & Tag (Yates)

TD 12 1/4" hole @10:45 PM 07/08/07. Ran 88 jts (3887.65') 9 5/8" 36# J-55 csg to 3910'. Cmtd 1st stg w/350 sx H/L, tailed in w/100 sx P+, PD @3:00 PM 07/09/07, circ 165 sx off DV tool. Cmtd 2nd stg w/350 sx H/L, tailed in w/200 sx P+, PD @11:09 PM 07/10/07, circ 40 sx to pit.

4. Spot 25 sx cmt @ 3960-3760'. WOC & Tag (9 5/8" Shoe & Queen)

3. Spot 25 sx cmt @ 7140-6940'. (Bone Springs)

2. Spot 25 sx cmt @ 10,494-10,394'. WOC & Tag (Wolfcamp)

1. Set 5 1/2" CIBP @ 11,548'. Circ hole w/ MLF. Pressure test csg. Spot 25 sx class H cmt @ 11,548-11,448'.

11,598'-11,617', 20 shots - Strawn

PBTD @ 11,730'

TD 7 7/8" hole @8:00 AM 07/30/07. Ran 263 jts (11800.35') 5 1/2" 17# N-80 csg to 11805.65'. Cmtd 1st stg w/550 sx PB Super H, PD @7:41 AM on 08/01/07, circ 117 sx to pit. Cmtd 2nd stg w/700 sx HLPP, PD @3:23 PM on 08/01/07, dnc. Ran temp survey - TOC @3000'.

TD @ 11,810'

PLUG AND ABANDONMENT **CONDITIONS OF APPROVAL**

Prairie Chicken, Capitan Reet

OPERATOR'S NAME:

COG Operating LLC

LEASE NO.: | NMNM92771

WELL NAME & NO.: | Cirrus Federal Com 1

US Well Number: | 3002538420

LOCATION: | Section 8, T.19 S., R.32 E., NMPM

COUNTY: Lea County, New Mexico

1. Set 5 1/2" CIBP @ 11,548'. Circ hole w/ MLF. Pressure test csg.

Spot 25 sx class H cmt @ 11,548-11,448'.

2. Spot 25 sx cmt @ 10,494-10,394'. WOC & Tag (Wolfcamp) 7290' to 6969'

3. Spot 25 sx cmt @ 7140-6940'. (Bone Springs)

3.5 4. Spot 25 sx cmt @ 3960-3760'. WOC & Tag (9 5/8" Shoe & Queen)

5. Perf & Sqz 50 sx cmt @ 2918-2718. WOC & Tag (Yates)

6. Perf & Sqz 50 Sx cmt @ 1030-828'. WOC & Tag (T/Salt & 13 3/8" Shoe)

7. Perf & Sqz 50 sx cmt @ 200' to surface.

8. Cut off well head, verify cmt @ surface, weld on Dry Hole Marker.

Approval Subject to General Requirements and Special Stipulations Attached

- No more than 3000 feet between cement plugs in cased hole.
- **Wait on Cement and Tag Top of Cement Requirement:**
 - 1. Shoe, Top of Salt, Base of Salt, DV tool, Perforate and Squeeze, Open Perforation.
 - 2. Formation plug is optional if a solid base is established and confirmed.

Spot from 5568' to 5412' (Delaware) 25 sx

Sunday ID: 2653346

	2653345					
Plug Type	Тор	Bottom	Length	Tag	Sacks	Notes
Surface Plug Shoe Plug	0.00	200.00 928.00	200.00	Tag/Verify	60.00	Perf and Squeeze from 200' to Surface. Verify at
Top of Salt @ 1149	1087.51	1199.00		Tag/Verify		Perf and Squeeze from 1199' to 828'. WOC and Tag.
Base of Salt @ 2539	2463.61	2589.00		Tag/Verify		(In/Out)
Yates @ 2868	2789.32	2918.00		If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio		Perf and Squeeze from 2918' to 2463'. WOC and Tag
Capitan Reef @ 3709	3621.91	3759.00	137.09		140	In/Out)
Shoe Plug	3860.00	3960.00	100.00	Tag/Verify		Spot from 3960' to 3621'. WOC and Tag
			k r (k a M a F S T T	f solid base no need to lag CIBP bresent and/or Mechanic al Integrity lest), If lerf & logz then lag, Leak lest all CIBP if no		
Delaware @ 5518	5412.82	5568.00		pen Perforatio	25.00 5	Spot from 5568' to

If solid base no need to Tag (CIBP present and/or Mechanic all integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 7290' to Tag (CIBP present and/or Mechanic all integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 7290' to Tag (CIBP present and/or Mechanic all Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP present and/or Mechanic all integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP present and/or Mechanic all integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP present and/or Mechanic all integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP Plug Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP Plug Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP Plug Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP Plug Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP Plug Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP Plug Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP Plug Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP Plug Test), If Perf & Sqz then Tag, Leak Test all CIBP If no Open Spot from 10494' to Tag (CIBP Plug Test), If Not Necessary Not Ne							
Tag (CIBP present and/or Mechanic al integrity Test), if Perf & Sqz then Tag, Leak Test all CIBP if no Open 320.90 Perforatio 35.00 Spot from 7290' to Tag (CIBP from Open 320.90 Perforatio 35.00 Spot from 7290' to Tag (CIBP from Open 320.90 Perforatio 35.00 Spot from 7290' to Tag (CIBP from Open 320.90 Perforatio 35.00 Spot from 7290' to Tag (CIBP from Open 35.00 Spot from 7290' to Tag (CIBP from Open 35.00 Spot from 7290' to Tag (CIBP from Open 35.00 Spot from 7290' to Tag (CIBP from Open 35.00 Spot from 7290' to Tag (CIBP from Open 35.00 Tag (CIBP from O					Carlotter the strategy		
CiBP present and/or Mechanic al Integrity Tests, if Perf & Sqz then Tag, Leak Test all CiBP in the CiBP present and/or Mechanic al Integrity Test, if Perf & Sqz then Tag, Leak Test all CiBP in the					1		
Description							
and/or Mechanic al Integrity Test), if Perf & Sqz then Tag, Leak Test all CIBP if no Open Op					(CIBP		
Mechanic al integrity Test), if Perf & Sqz then Tag, Leak Test all CIBP if no Open 320.90 Perforatio Spot from 7290' to 35.00							
al Integrity Test), if Perf & Sign then Tag, Leak Test all CiBP if no Open Spot from 7290' to 35.00 8969'.					and/or		
Test), if Perf & Sqz then Tag, Leak Test all CIBP if no Open (CIBP Plug 11513.00 11548.00 11507.00 1					Mechanic	es escaladores es estadores es estadores es estadores es estadores es estadores estado	
Bonesprings @ 7090 6969.10 7290.00 320.90 Perforatio Spot from 7290' to 35.00 6969'.					al Integrity		
Sqz then Tag, Leak Test all CIBP if no Open 320.90 Perforatio 35.00 6969'.					Test), If		
Ronesprings @ 7090 6969.10 7290.00 320.90 Perforatio Spot from 7290' to Open 35.00 8969'.					Perf &		
Test all CIBP if no Open 320.90 Perforatio 35.00 6969'. Spot from 7290' to 35.00 6969'. Spot from 72					Sqz then		
Test all CIBP if no Open 320.90 Perforatio 35.00 6969'. Spot from 7290' to 35.00 6969'. Spot from 72					Tag, Leak		
Bonesprings @ 7090 6969.10 7290.00 320.90 Perforatio 35.00 6969.							
Bonesprings @ 7090 6969.10 7290.00 320.90 Perforatio 35.00 6969.					CIBP if no		
Bonesprings @ 7090 6989.10 7290.00 320.90 Perforatio 35.00 8969'.						CO CONTRACTOR CONTRACT	Spot from 7290' to
If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open (CIBP Plug	Bonesprings @ 7090	6969.10	7290.00	320.90	Perforatio	35.00	
Base no need to Tag (CIBP present and/or Mechanic al Integrity Test), if Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforation al Integrity Test), if Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforation al Integrity Test), if Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforation al Integrity Test), if Perf & Sqz then Tag (CIBP present and/or Mechanic al Integrity Test), if Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforation Plug (if No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary							
Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP present and/or Mechanic al Integrity Test), If Solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Tag, Leak Test all CIBP if no Open Tag, Leak Test CIBP Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary							
Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP present and/or Mechanic al Integrity Test), If Solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Tag, Leak Test all CIBP if no Open Tag, Leak Test CIBP Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary					need to		
CIBP present and/or Mechanic at Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP present and/or Mechanic at Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP present and/or Mechanic at Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP present and/or Mechanic at Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to 35.00 to 10289'.							
## Present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no One on the decision of the present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no One on the decision of the present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test, If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to 35.00 10289'. CiBP Plug							
## Wolfcamp @ 10444 10289.56 10494.00 204.44 Ferse tall CIBP if no Open Spot from 10494' to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Spot from 10494' to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Tag, Leak Test all CIBP if no Open Tag, Leak Test all CIBP if no Open Tag, Leak Test CIBP Perforations Plug (If No CIBP)							
Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Open Open Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP into Open Open Open Open Open Open Open Open					1.		
Spot from 10494' to					1	de de la constante de la const	
Wolfcamp @ 10444 10289.56 10494.00 204.44 Perforatio Spot from 10494' to Spot from 104					1		
Wolfcamp @ 10444 10289.56 10494.00 204.44 Test all CIBP if no Open Perforatio 35.00 10289'. Spot from 10494' to 35.00 10289'.							
Wolfcamp @ 10444 10289.56 10494.00 204.44 Perforatio 35.00 Spot from 10494' to 35.00 Inches in the second s							
Wolfcamp @ 10444 10289.56 10494.00 204.44 Perforatio Open Spot from 10494' to 204.44 Perforatio dase no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Tag, Leak Test all CIBP if no Open Tag, Leak Test all CIBP if no Open Store and Tag, Leak Test all CIBP if no Open Store and Tag, Leak Test all CIBP if no Open Store and Tag, Leak Test all CIBP if no Open Store and Tag, Leak Test all CIBP if no Open Store and Tag, Leak Test CIBP Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary							
Wolfcamp @ 10444 10289.56 10494.00 204.44 Perforatio Open 204.44 Perforatio Open 35.00 10289'. If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Test all CIBP if no Open Perforations Plug (If No CIBP) CIBP Plug	Permananta						
Wolfcamp @ 10444 10289.56 10494.00 204.44 Perforatio							
Wolfcamp @ 10444							
Molfcamp @ 10444					and the second second		Spot from 10494' to
If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open 11513.00 11548.00 35.00 Perforations Plug (If No CIBP) 11548.00 119.00 Tag/Verify Not Necessary Necessary Not Necessary	Wolfcamp @ 10444	10289.56	10494.00	204,44		35.00	10289'
need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open							
Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open CIBP Plug Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary					base no		
CIBP present and/or Mechanic al Integrity Test), If Perf & Specified Square					need to		
Present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open					Tag		
CIBP Plug 11513.00 11548.00 35.00 Perforatio Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify And/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio 25.00 Leak Test CIBP					(CIBP		
CIBP Plug 11513.00 11548.00 35.00 Perforatio Perforations Plug (If No CIBP) Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio 25.00 Leak Test CIBP Not Necessary					1		
Al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Open					and/or		
Test), if Perf & Sqz then Tag, Leak Test all CIBP if no Open Open Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary					Mechanic		
Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary Necessar					al Integrity		
Sqz then Tag, Leak Test all CIBP if no Open Open					Test), If		
CIBP Plug 11513.00 11548.00 35.00 Perforatio 25.00 Leak Test CIBP Plug 11548.00 11667.00 119.00 Tag/Verify Not Necessary					Perf &		
CIBP Plug 11513.00 11548.00 35.00 Perforatio 25.00 Leak Test CIBP Plug 11548.00 11667.00 119.00 Tag/Verify Not Necessary					Sqz then		
CIBP Plug 11513.00 11548.00 35.00 Perforatio 25.00 Leak Test CIBP Plug 11548.00 11667.00 119.00 Tag/Verify Not Necessary							
CIBP Plug 11513.00 11548.00 35.00 Perforation 25.00 Leak Test CIBP Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary					Test all		
CIBP Plug 11513.00 11548.00 35.00 Perforatio 25.00 Leak Test CIBP Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary							
CIBP Plug 11513.00 11548.00 35.00 Perforatio 25.00 Leak Test CIBP Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary	OIDD DI						
Perforations Plug (If No CIBP) 11548.00 11667.00 119.00 Tag/Verify Not Necessary	CIBP Plug			35.00		25.00	Leak Test CIBP
	Shoo Plus			119.00	Tag/Verify		
y and the same of	Shoe Flug	11756.00	11856.00	100.00	Tag/Verify		Not Necessary

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Critical, High, Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water.

R111P: 50' from bottom of salt to surface

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement	Low		
Shoe @ Shoe @	878.00 3910.00		
Shoe @	11806.00	тос @	3000.00
Perforatons Top @	11598.00	Perforations	11617.00

CIBP @ 11548.00


ConocoPhillips PROPOSED

Lease & Well # Cirrus Federal Com #1

30-025-38420

TOC @ 3,000

Spud: 6/30/2007

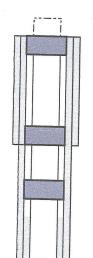

III

60 7. Perf & Sqz 50 sx cmt @ 200' to surface.

Spud 17 1/2" hole @4:00 PM 06/30/07. Ran 20 jts (877.01') 13 3/8" 48# J-55 STC csg to 878.21'. Cmtd w/510 sx HLP, tailed in w/250 sx HLP, PD @12:15 PM 07/02/07, circ 50 sx to pit.

6. Perf & Sqz 50 Sx cmt @ 1030-828'. WOC & Tag (T/Salt & 13 3/8" Shoe)

140 2463

5. Perf & Sqz.50 sx cmt @ 2918-2718'. WOC & Tag (Yates)

TD 12 1/4" hole @10:45 PM 07/08/07. Ran 88 jts (3887.65') 9 5/8" 36# J-55 csg to 3910'. Cmtd 1st stg w/350 sx H/L, tailed in w/100 sx P+, PD @3:00 PM 07/09/07, circ 165 sx off DV tool. Cmtd 2nd stg w/350 sx H/L, tailed in w/200 sx P+, PD @11:09 PM 07/10/07, circ 40 sx to pit.

4. Spot 25 sx cmt @ 3960-3760'. WOC & Tag (9 5/8" Shoe & Queen)

Spot from 5568' to 5412' (Velaure) 25 5x

7290 to 69691

3. Spot 25 sx cmt @ 7140-6940'. (Bone Springs)

2. Spot 25 sx cmt @ 10,494-10,394. WOC & Tag (Wolfcamp)

1. Set 5 1/2" CIBP @ 11,548'. Circ hole w/ MLF. Pressure test csg. Spot 25 sx class H cmt @ 11,548-11,448'.

11,598'-11,617', 20 shots - Strawn

PBTD @ 11,730

TD 7 7/8" hole @8:00 AM 07/30/07. Ran 263 jts (11800.35') 5 1/2" 17# N-80 csg to 11805.65'. Cmtd 1st stg w/550 sx PB Super H, PD @7:41 AM on 08/01/07, circ 117 sx to pit. Cmtd 2nd stg w/700 sx HLPP, PD @3:23 PM on 08/01/07, dnc. Ran temp survey - TOC @3000'.

TD @ 11,810'


Formation Tops Rustler 950 T/Salt 980 +/-**Yates** 2868 7 Rivers 3168 Bowers 3528 Queen 3772 Del 5518 **Bone Spring** 7090 Wolfcamp 10444 Strawn 11482

ConocoPhillips CURRENT

Lease & Well # Cirrus Federal Com #1 30-025-38420

Spud: 6/30/2007

TOC @ 3,000°

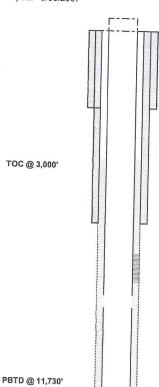

Spud 17 1/2" hole @4:00 PM 06/30/07. Ran 20 jts (877.01') 13 3/8" 48# J-55 STC csg to 878.21'. Cmtd w/510 sx HLP, tailed in w/250 sx HLP, PD @12:15 PM 07/02/07, circ 50 sx to pit.

TD 12 1/4" hole @10:45 PM 07/08/07. Ran 88 jts (3887.65') 9 5/8" 36# J-55 csg to 3910'. Cmtd 1st stg w/350 sx H/L, tailed in w/100 sx P+, PD @3:00 PM 07/09/07, circ 165 sx off DV tool. Cmtd 2nd stg w/350 sx H/L, tailed in w/200 sx P+, PD @11:09 PM 07/10/07, circ 40 sx to pit.

	Name	Тор
		Meas. Depth
rawn	Rustler Yates Seven Rivers Bowers Queen Delaware Bone Spring Wolfcamp Strawn	950° 2868° 3168° 3528° 3772° 5518° 7090° 10444° 11482°
		1

11,598'-11,617', 20 shots - Stra

TD 7 7/8" hole @8:00 AM 07/30/07. Ran 263 jts (11800.35') 5 1/2" 17# N-80 csg to 11805.65'. Cmtd 1st stg w/550 sx PB Super H, PD @7:41 AM on 08/01/07, circ 117 sx to pit. Cmtd 2nd stg w/700 sx HLPP, PD @3:23 PM on 08/01/07, dnc. Ran temp survey - TOC @3000'.

TD @ 11,810'

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, redistribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of
 Operations must include adequate measures for stabilization and reclamation of disturbed lands.
 Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD
 process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation

equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Melissa Horn Environmental Protection Specialist 575-234-5951

Kelsey Wade Environmental Protection Specialist 575-234-2220

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 149391

COMMENTS

Operator:	OGRID:
COG OPERATING LLC	229137
600 W Illinois Ave	Action Number:
Midland, TX 79701	149391
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Cr	eated By	Comment	Comment Date
þ	lmartinez	PM	10/6/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 149391

CONDITIONS

Operator:	OGRID:
COG OPERATING LLC	229137
600 W Illinois Ave	Action Number:
Midland, TX 79701	149391
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
gcordero	None	10/6/2022