
Submit 1 Copy To Appropriate District Office	State of New Mex	xico	Form C-103	
District I – (575) 393-6161	Energy, Minerals and Natur	ral Resources	Revised July 18, 2013	
1625 N. French Dr., Hobbs, NM 88240 <u>District II</u> – (575) 748-1283	OIL CONGERNATION	WELL API 1 30-005-2033		
811 S. First St., Artesia, NM 88210 District III – (505) 334-6178	OIL CONSERVATION	DIVISION 5 Indicate T	Type of Lease	
1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr. Santa Fe, NM 87505		FEE (Fed. Surface)	
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Sana 1 0, 14141 07.		& Gas Lease No.	
	ICES AND REPORTS ON WELLS	7. Lease Na	me or Unit Agreement Name	
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH		D OTTOTT	Queen Unit	
PROPOSALS.)  1. Type of Well: Oil Well  Gas Well  Other		8. Well Num		
2. Name of Operator	das wen _ other	9. OGRID N	lumber	
State of New Mexico formerly	Canyon E&P Company	269864	****** * ·	
3. Address of Operator 1625 N. French Drive, Hobbs, N 8	8240	10. Pool nan Double L	ne or Wildcat	
4. Well Location	02.10	Double E	Quoeii	
Unit Letter <u>E</u> : 1	1985 feet from the N	line and 956 feet	from the W line	
Section 6		ange 30E NMPN		
	11. Elevation (Show whether DR,	RKB, RT, GR, etc.)		
	3877'		ST STATE OF STATE	
12. Check	Appropriate Box to Indicate Na	ature of Notice, Report or O	ther Data	
NOTICE OF IN PERFORM REMEDIAL WORK □	PLUG AND ABANDON	SUBSEQUENT REMEDIAL WORK	REPORT OF:  ALTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING OPNS.[		
PULL OR ALTER CASING	MULTIPLE COMPL	CASING/CEMENT JOB [		
DOWNHOLE COMMINGLE				
CLOSED LOOP SYSTEM [7]				
CLOSED-LOOP SYSTEM DTHER:		OTHER:		
OTHER:  13. Describe proposed or comp	pleted operations. (Clearly state all po	ertinent details, and give pertinent	t dates, including estimated date	
OTHER:  13. Describe proposed or composed of starting any proposed we	ork). SEE RULE 19.15.7.14 NMAC.	ertinent details, and give pertinent	t dates, including estimated date ach wellbore diagram of	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed completion.	ork). SEE RULE 19.15.7.14 NMAC.	ertinent details, and give pertinent. For Multiple Completions: Atta	ach wellbore diagram of	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or reconstruction.  11/14/23: MOL. Held JSA	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU in the second	ertinent details, and give pertinent. For Multiple Completions: Atta	ach wellbore diagram of	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed with the starting and proposed completion or recomposed completion or recomposed starting any proposed completion or recomposed completion or recomposed starting any proposed starting any proposed starting any proposed or complete starting any proposed with the starting any proposed or complete starting any proposed with the starting and the starting any proposed with the starting and	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU icure well and SDFD.	ertinent details, and give pertinent. For Multiple Completions: Attacked and plugging equipment. RU in	ach wellbore diagram of rod equipment. Check well	
OTHER:  13. Describe proposed or composed we proposed completion or recomposed with proposed with proposed with proposed with proposed with proposed or composed with proposed or composed with proposed or composed with proposed or composed with proposed wi	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU is cure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and	ertinent details, and give pertinent. For Multiple Completions: Attarrig and plugging equipment. RU numbers of the completion of the complete	rod equipment. Check well  nd LD rods. Change to tbg sing valves. ND wellhead and	
OTHER:  13. Describe proposed or composed starting any proposed we proposed completion or recomposed completion or recomp	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU recure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and k floor. Pull on tbg, stuck. Spoke w/ I	ertinent details, and give pertinent. For Multiple Completions: Attarrig and plugging equipment. RU to on rods, stuck, WOO. TOOH at the replace plumbing for surface cas Deaon David w/ NMOCD, approximate the replace of the replace of the replace plumbing for surface cas Deaon David w/ NMOCD, approximate the replace of the replace plumbing for surface cas Deaon David w/ NMOCD, approximate the replace of the re	ach wellbore diagram of rod equipment. Check well and LD rods. Change to the sing valves. ND wellhead and wed to free point and cut. RU	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed with the proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompos	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU recure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and k floor. Pull on tbg, stuck. Spoke w/ I. RIH and cut @ 1730°, RD WL. LD	ertinent details, and give pertinent. For Multiple Completions: Attarrig and plugging equipment. RU and on rods, stuck, WOO. TOOH and replace plumbing for surface cast Deaon David w/ NMOCD, approved 154 jnts 2-3/8" prod tbg. Secure w	ach wellbore diagram of rod equipment. Check well and LD rods. Change to the sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed with the proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompos	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU is cure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and k floor. Pull on tbg, stuck. Spoke w/ Is. RIH and cut @ 1730°, RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300°, MOCD, approved to set CIBP if well.	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is and plugging equipment. RU is and replace plumbing for surface cast Deaon David w/ NMOCD, approved the properties of the provided with the pro	ach wellbore diagram of rod equipment. Check well and LD rods. Change to tbg sing valves. ND wellhead and wed to free point and cut. RU well and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed with the proposed completion or recomposed completion of the proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recomposed completion or recomposed completion or recomposed completion or recomposed completi	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU in cure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and it floor. Pull on tbg, stuck. Spoke w/ In RIH and cut @ 1730°, RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300°, MOCD, approved to set CIBP if well in 1700°, RD WL. Load well. RU RT.	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is and plugging equipment. RU is and replace plumbing for surface cast Deaon David w/ NMOCD, approved the properties of the provided with the pro	ach wellbore diagram of rod equipment. Check well and LD rods. Change to tbg sing valves. ND wellhead and wed to free point and cut. RU well and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or reconstruction of starting any proposed we proposed completion or reconstruction.  11/14/23: MOL. Held JSA pressures; no pressures. See 11/15/23: Unseat Rod pume equipment. PU on tbg, studies and test BOP. RU word JSI WL, RIH w/ free point.  11/16/23: Held JSA. RU A Spoke w/ Deon David w/ No 1700'. RIH and set CIBP (and RU pump to tbg, circuit	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU in cure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and it floor. Pull on tbg, stuck. Spoke w/l. RIH and cut @ 1730', RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300' MMOCD, approved to set CIBP if well w/ 1700', RD WL. Load well. RU RT. late well w/ 50 bbls.	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is a replace plumbing for surface cast Deaon David w/ NMOCD, approved in the place plumbing for surface cast Deaon David w/ NMOCD, approved in the place plumbing for surface cast Deaon David w/ NMOCD, approved in the place plumbing for surface cast Deaon David w/ NMOCD, approved in the place plumbing for surface cast Deaon David w/ NMOCD, approved in the place plumbing for surface plumbin	ach wellbore diagram of rod equipment. Check well and LD rods. Change to tbg sing valves. ND wellhead and wed to free point and cut. RU well and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed completion of the proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recomposed completion or recompletion or	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU is cure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and is floor. Pull on tbg, stuck. Spoke w/ I. RIH and cut @ 1730', RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300', MOCD, approved to set CIBP if well and the well w/ 50 bbls.  G capt from 1700' to 1600'. TOOH. and RU pump to tbg.	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is a replace plumbing for surface cast Deaon David w/ NMOCD, approving the surface of	ach wellbore diagram of rod equipment. Check well and LD rods. Change to tbg sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed with proposed completion or recomposed with the proposed completion of the proposed with the proposed completion of the proposed with the proposed completion of the proposed c	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU is cure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and is floor. Pull on tbg, stuck. Spoke w/ I. RIH and cut @ 1730°, RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300°, MMOCD, approved to set CIBP if well 1700°, RD WL. Load well. RU RT late well w/ 50 bbls.  G cmat from 1700° to 1600°. TOOH. and RU pump to tbg.  G cmt from 1413° to 990°. TOOH. R	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is a replace plumbing for surface cast Deaon David w/ NMOCD, approved in the surface of the surface	ach wellbore diagram of rod equipment. Check well and LD rods. Change to tbg sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed completion of the proposed completion or recompletion of the proposed completion or recompletion or rec	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU recure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and foor. Pull on tbg, stuck. Spoke w/ I. RIH and cut @ 1730°, RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300°, MOCD, approved to set CIBP if well 1700°, RD WL. Load well. RU RT late well w/ 50 bbls.  G cmat from 1700° to 1600°. TOOH. and RU pump to tbg.  G cmt from 1413° to 990°. TOOH. Recirculation through surface casings	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is a replace plumbing for surface cast Deaon David w/ NMOCD, approved in the surface of the surface	ach wellbore diagram of rod equipment. Check well and LD rods. Change to the sing valves. ND wellhead and wed to free point and cut. RU rell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed completion or recompletion or recomposed completion or recompletion or recompletion or recompletion or recomposed completion or recompletion or	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU recure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and k floor. Pull on tbg, stuck. Spoke w/ I. RIH and cut @ 1730°, RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300°, MOCD, approved to set CIBP if well 1700°, RD WL. Load well. RU RT. late well w/ 50 bbls.  G cmt from 1700° to 1600°. TOOH. and RU pump to tbg.  G cmt from 1413° to 990°. TOOH. Recirculation through surface casings as G cmt from 497° to surface. TOOH re well and MOL. SDFN.	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is and replace plumbing for surface cast Deaon David w/ NMOCD, approving 54 jnts 2-3/8" prod tbg. Secure with Joads. Load well and RU A Plus X WL, RIH and run CBL from 17 Secure well and SDFD.	ach wellbore diagram of rod equipment. Check well and LD rods. Change to the sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed completion of the surface of the starting and pressures; no pressures. Set 11/15/23: Unseat Rod pumpe equipment. PU on tbg, structure of the surface of the s	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU is cure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and is floor. Pull on tbg, stuck. Spoke w/I. RIH and cut @ 1730', RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300', MOCD, approved to set CIBP if well and the well w/50 bbls.  G cout from 1700' to 1600'. TOOH. and RU pump to tbg.  G cmt from 1413' to 990'. TOOH. Recirculation through surface casings as G cmt from 497' to surface. TOOH are well and MOL. SDFN.  Dig out, cut off and remove wellhead.	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is and replace plumbing for surface cast Deaon David w/ NMOCD, approving 54 jnts 2-3/8" prod tbg. Secure with Joads. Load well and RU A Plus X WL, RIH and run CBL from 17 Secure well and SDFD.	ach wellbore diagram of rod equipment. Check well and LD rods. Change to the sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed complete in the completion of the composed complete in the completion of the complet	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU incure well and SDFD.  IP, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and it floor. Pull on tbg, stuck. Spoke w/ I. RIH and cut @ 1730', RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300', MOCD, approved to set CIBP if well w/ 50 bbls.  IR cant from 1700' to 1600'. TOOH. In the control of the contr	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is and plugging equipment. RU is and replace plumbing for surface cast Deaon David w/ NMOCD, approved the second of the secon	ach wellbore diagram of rod equipment. Check well and LD rods. Change to the sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomproposed completion of the proposed completion of the	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU recure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and k floor. Pull on tbg, stuck. Spoke w/ I. RIH and cut @ 1730°, RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300°, MOCD, approved to set CIBP if well 1700°, RD WL. Load well. RU RT. late well w/ 50 bbls.  G cmt from 1700° to 1600°. TOOH. and RU pump to tbg.  G cmt from 1413° to 990°. TOOH. Recirculation through surface casings as G cmt from 497° to surface. TOOH re well and MOL. SDFN.  Dig out, cut off and remove wellhead 11.9° W. MOL.	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is and plugging equipment. RU is and replace plumbing for surface cast Deaon David w/ NMOCD, approx 54 jnts 2-3/8" prod tbg. Secure w is 7, RD WL. TIH w/ bit, break true is loads. Load well and RU A Plus X WL, RIH and run CBL from 17. Secure well and SDFD.  RU A Plus WL, RIH and perf @ 4.  I. RD tbg equipment and work flowd. TOC @ surface in annulus. West of my knowledge and belief.	ach wellbore diagram of rod equipment. Check well and LD rods. Change to tbg sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH  97', RD WL. RIH w/ 4.5" or. ND BOP and RD rig and eld on and install P&A Marker	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed completion of recomposed completion of the proposed completion of the propose	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU recure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and k floor. Pull on tbg, stuck. Spoke w/ I. RIH and cut @ 1730°, RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300°, MOCD, approved to set CIBP if well 1700°, RD WL. Load well. RU RT. late well w/ 50 bbls.  G cmt from 1700° to 1600°. TOOH. and RU pump to tbg.  G cmt from 1413° to 990°. TOOH. Recirculation through surface casings as G cmt from 497° to surface. TOOH re well and MOL. SDFN.  Dig out, cut off and remove wellhead 11.9° W. MOL.	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is and plugging equipment. RU is and replace plumbing for surface cast Deaon David w/ NMOCD, approx 54 jnts 2-3/8" prod tbg. Secure w is 7, RD WL. TIH w/ bit, break true is loads. Load well and RU A Plus X WL, RIH and run CBL from 17. Secure well and SDFD.  RU A Plus WL, RIH and perf @ 4.  I. RD tbg equipment and work flowd. TOC @ surface in annulus. West of my knowledge and belief.	ach wellbore diagram of rod equipment. Check well and LD rods. Change to tbg sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH  97', RD WL. RIH w/ 4.5" or. ND BOP and RD rig and eld on and install P&A Marker	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed complete in the proposed complete in the propos	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU recure well and SDFD.  p, RU rod stripper and work floor. Plack, WOO. Dig out wellhead cellar and k floor. Pull on tbg, stuck. Spoke w/ I. RIH and cut @ 1730°, RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300°, MOCD, approved to set CIBP if well 1700°, RD WL. Load well. RU RT. late well w/ 50 bbls.  G cmt from 1700° to 1600°. TOOH. and RU pump to tbg.  G cmt from 1413° to 990°. TOOH. Recirculation through surface casings as G cmt from 497° to surface. TOOH re well and MOL. SDFN.  Dig out, cut off and remove wellhead 11.9° W. MOL.	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is and plugging equipment. RU is and replace plumbing for surface cast Deaon David w/ NMOCD, approved the second of the secon	ach wellbore diagram of rod equipment. Check well and LD rods. Change to tbg sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH  97', RD WL. RIH w/ 4.5" or. ND BOP and RD rig and eld on and install P&A Marker	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed completion or recompletion or recomposed completion or recomposed completion or recomposed completion or recompletion o	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU recure well and SDFD.  p, RU rod stripper and work floor. Plek, WOO. Dig out wellhead cellar and k floor. Pull on tbg, stuck. Spoke w/I. RIH and cut @ 1730', RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300', MOCD, approved to set CIBP if well 1700', RD WL. Load well. RU RT. late well w/ 50 bbls.  G cout from 1700' to 1600'. TOOH. and RU pump to tbg.  G cmt from 1413' to 990'. TOOH. Recirculation through surface casings as G cmt from 497' to surface. TOOH are well and MOL. SDFN.  Dig out, cut off and remove wellhead 11.9'' W. MOL.  above is true and complete to the best surface.  E-mail address:	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is and plugging equipment. RU is deplace plumbing for surface cast Deaon David w/ NMOCD, approved the second of	ach wellbore diagram of rod equipment. Check well and LD rods. Change to the sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH  97', RD WL. RIH w/ 4.5"  or. ND BOP and RD rig and eld on and install P&A Marker  DATE 12/2/38  PHONE: 505 4866 958	
OTHER:  13. Describe proposed or compof starting any proposed we proposed completion or recomposed complete in the proposed complete in the propos	ork). SEE RULE 19.15.7.14 NMAC. completion.  Prep location. Spot equipment. RU recure well and SDFD.  p, RU rod stripper and work floor. Plek, WOO. Dig out wellhead cellar and k floor. Pull on tbg, stuck. Spoke w/I. RIH and cut @ 1730', RD WL. LD. Plus WL, RIH w/ GRJB, tag @ 300', MOCD, approved to set CIBP if well 1700', RD WL. Load well. RU RT. late well w/ 50 bbls.  G cout from 1700' to 1600'. TOOH. and RU pump to tbg.  G cmt from 1413' to 990'. TOOH. Recirculation through surface casings as G cmt from 497' to surface. TOOH are well and MOL. SDFN.  Dig out, cut off and remove wellhead 11.9'' W. MOL.  above is true and complete to the best surface.  E-mail address:	ertinent details, and give pertinent. For Multiple Completions: Attaining and plugging equipment. RU is and plugging equipment. RU is and replace plumbing for surface cast Deaon David w/ NMOCD, approx 54 jnts 2-3/8" prod tbg. Secure w is 7, RD WL. TIH w/ bit, break true is loads. Load well and RU A Plus X WL, RIH and run CBL from 17. Secure well and SDFD.  RU A Plus WL, RIH and perf @ 4.  I. RD tbg equipment and work flowd. TOC @ surface in annulus. West of my knowledge and belief.	ach wellbore diagram of rod equipment. Check well and LD rods. Change to tbg sing valves. ND wellhead and wed to free point and cut. RU ell and SDFD.  300', RIH to 1750'. TOOH. SWL. RIH w/ GRJB, tag @ 700' to surface, RD WL. TIH  97', RD WL. RIH w/ 4.5" or. ND BOP and RD rig and eld on and install P&A Marker	

## Double L Queen Unit 002Q

## As Plugged on 12/6/2023

Double L Queen

Unit E, 1985' FNL & 956' FWL, Section 6, T15S, R30E Chaves County, NM, API #30-005-20334

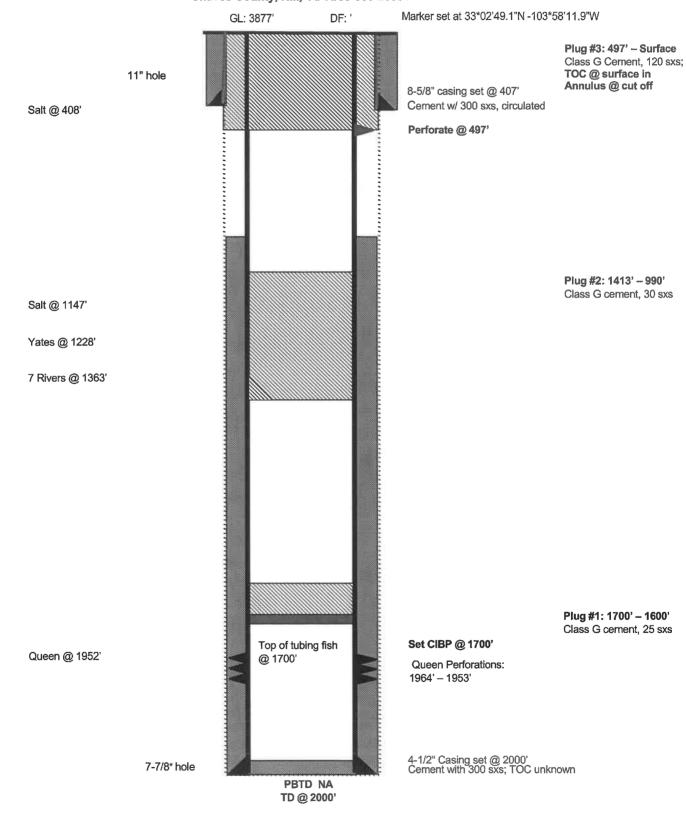



District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 293537

## **CONDITIONS**

Operator:	OGRID:
A-PLUS WELL SERVICE, INC.	370317
P.O. Box 1979	Action Number:
Farmington, NM 87499	293537
	Action Type:
	[C-103] Sub. Plugging (C-103P)

## CONDITIONS

Created By	Condition	Condition Date
jagarcia	None	12/26/2023