
Energy, Minerals and Natural Resources So. F. Freade, Dr. 180h, N. MS20 Santal El - (1575) 7861 287 I. Froi SA, Andreas, NM S210 Santal El - (1575) 7861 287 I. Froi SA, Andreas, NM S210 Santal Froi SA, Andreas OIL CONSERVATION DIVISION I. 220 South St. Francis Dr. Santa Fro. NM 220 S. Francis Dr. Santa Fro. NM Santa Fro. NM 87505 Santa Fro. NM 87505 Santa Fro. NM 87505 Son NOT USE HIS NOWL PRODUCEALS TO DEBLE OR TO DEBLES NOW FULL SING MACK TO A OFFERENT RESIDENCIAL USE "APPLICATION FOR FREMIT" (FORM C-101) FOR SUCH PREMED RULL 31 STATE Section 31 Township 23S Range 35E NMFM Lear Owner of Notice Report or Other Data NOTICE OF INTENTION TO: REFORM REMEDIAL WORK DIVISION DIVISION II. Elevation (Show whether DR, RKB, RT, GR, etc.) 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: REFORM REMEDIAL WORK DIVISION DIVISION DIVISION DIVISION II. Section 31 Township 23S Range 35E NMFM Lear Country, NM II. Section DIVISION DI	ceived by COCP: 19/28/2025 1:49:	State of Ne	w Mexico	For	rm Eage 1 6	
South Company South So	Office <u>District I</u> – (575) 393-6161	Energy, Minerals and	d Natural Resources	Revised J		
11.5. First St. Arestia, NM 88210						
12.0 South St. Peracis Dr. Santa Fe, NM 87505	811 S. First St., Artesia, NM 88210					
Saftat Fe, NM 87505 Saftat Fe, NM 87505 SINDRY NOTICES AND REPORTS ON WELLS SUNDRY NOTICES THE WORK PORT MOREON STO DEBASEN ON HIGH BACK TO A REPRENT RESERVOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH RED BULL 31 STATE 8. Well Number 1. OGRID Number 1. Name of Operator 2. OGRID Number 1. OGRID Number 1. OF PROMING AND APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH 8. Well Number 1. OGRID Number 1. OR FRENCH PROMISE SONE SPRING 31 SW. Sherdan Avenue, Oklahoma City, OK 73102 10. Pool name or Wildcat ANTELOPE RIODE; BONE SPRING 11. Elevation (Show whether DR, RKB, RT, GR, etc.) 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: REPORABLY ABANDON 11. Elevation (Show whether DR, RKB, RT, GR, etc.) 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: REPORABLY ABANDON 12. CHECK APPROPRIATE AND AND ADDITION SUBSEQUENT REPORT OF: REMEDIAL WORK 13. SUBSEQUENT REPORT OF: REMEDIAL WORK 14. CHECK APPORT OF: REMEDIAL WORK 15. CHECK APPORT OF: REMEDIAL WORK 16. State Oil & Gas Lease No. 17. Lease Name or Unit Agreement Name 18. Well Number 19. OGRID Number 19. OGRID Number 10. FOR TOWN WHILE AND AND ADDITION SUBSEQUENT REPORT OF TOWN SUBSEQUENT REPORT OF: REMEDIAL WORK 19. ALTERING CASING COMMENCE ERILLING OPNS SUBSEQUENT REPORT OF: REMEDIAL WORK 10. CHECK APPORT OF: REMEDIAL WORK 11. SUBSEQUENT REPORT OF: REMEDIAL WORK 12. CHECK APPORT OF: REMEDIAL WORK 13. SUBSEQUENT REPORT OF: REMEDIAL WORK 14. CHECK APPORT OF: REMEDIAL WORK 15. CHECK APPORT OF: REMEDIAL WORK 16. SUBSEQUENT REPORT OF: REMEDIAL WORK 16. SUBSEQUENT REPORT OF: REMEDIAL WORK 16. SUBSEQUENT REPORT OF: REMEDIAL WORK 18. CHECK TOWN SUBSEQUENT REPORT OF: REMEDIAL WORK 19. CHECK TOWN SUBSEQUENT REPORT OF: REMEDIAL WORK 10. ALTERING CASING 10. ALTERING CASING 10. ALTERING CASING 10.				STATE FEE		
SUNDRY NOTICES AND REPORTS ON WELLS ON NOT USE THIS PORM FOR REPORDS AS TO DEELY OR PLUG BACK TO A REPERENT RESERVOIR. LESF APPLICATION FOR PERMIT "(FORM C-101) FOR SUCH REPORT RESERVOIR. LESF APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH REPORT RESERVOIR. LESF APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH REPORT RESERVOIR. LESF APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH REPORT WITH SUMMER AND THE REPORT OF THE REPO	<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM 87505	Santa Fe, N	NM 87505	6. State Oil & Gas Lease No.	6. State Oil & Gas Lease No.	
Normage Section Sect	SUNDRY NOT (DO NOT USE THIS FORM FOR PROPO	OSALS TO DRILL OR TO DEEPEN	OR PLUG BACK TO A		ent Name	
Name of Operator Superator	PROPOSALS.)	CATION FOR PERMIT" (FORM C-	-101) FOR SUCH			
Address of Operator Address of Operator Address of Operator 10. Pool name or Wildcat 33 W. Sheridan Avenue, Oklahoma City, OK 73102 10. Pool name or Wildcat ANTELOPE RIDGE; BONE SPRING 33 W. Sheridan Avenue, Oklahoma City, OK 73102 10. Pool name or Wildcat ANTELOPE RIDGE; BONE SPRING 11. Elevation (Show whether DR, RRB, RT, GR, etc.) 3435 'GL 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF: REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PAND A CASING/CEMENT JOB ALTERING CASING MULTIPLE COMPL CASING/CEMENT JOB ALTERING CASING COMMENCE ORILLING OPNS. PAND A CASING/CEMENT JOB CASING/CEMENT JOB ONWHOLE COMMINGLE CHANGE PLANS CASING/CEMENT JOB CASING/CEMENT JOB ONWHOLE COMMINGLE CHANGE PLANS CASING/CEMENT JOB ONWHOLE CASING/CEMENT JOB ONWHOLE CASING/CEMENT JOB ONWHOLE COMMINGLE CASING/CEMENT JOB ONWHOLE CASING/CE		Gas Well Other		1		
Address of Operator 31 W. Sheridan Avenue, Oklahoma City, OK 73102 Well Location						
Well Location Unit Letter_N_ : 1300_ feet from the _south_ line and _ 2610_ feet from the _West_ line Section 31						
Unit Letter_N_:1300 feet from the _South line and2610 feet from the _West line Section 31		ma City, OK 73102				
Section 31 Township 23S Range 35E NMPM Lea County, NM 11. Elevation (Show whether DR, RKB, RT, GR, etc.)	4. Well Location					
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3435' GL 12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: ERFORM REMEDIAL WORK □ PLUG AND ABANDON □ CHANGE PLANS □ COMMENCE DRILLING OPNS. ALTERING CASING □ COMMENCE DRILLING OPNS. □ Notify COD 24 hrs. prior to any work done, gilbert.cordero@emnrd.nm.gov so a CO may be pastingned. □ OTHER: □ OTHER: □	Unit Letter N:	1300 feet from the _	_South line and	2610feet from theWest	line	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO:	Section 31	1			NM	
12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data NOTICE OF INTENTION TO: ERFORM REMEDIAL WORK □ PLUG AND ABANDON □ CHANGE PLANS □ COMMENCE DRILLING ORS□ P AND A □ PLUC OR ALTER CASING □ MULTIPLE COMPL □ CASING/CEMENT JOB □ NOWNHOLE COMMINGLE □ CASING/CEMENT JOB □ NOWNHOLE COMMINGLE □ CASING/CEMENT JOB □ NOWNHOLE COMMINGLE □ CASING/CEMENT JOB □ NOTHER: □ THER: □ THE		,	er DR, RKB, RT, GR,	etc.)		
NOTICE OF INTENTION TO: CERFORM REMEDIAL WORK PLUG AND ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PAND A CASING/CEMENT JOB Notify OCD 24 hrs. prior to any work done, gibret. cordero@menrd.nm.gov or String any proposed or completed operations. (Clearly state all pertinent details, alto give perturent dates, micromy be assigned. Describe proposed or completed operations. (Clearly state all pertinent details, alto give perturent dates, micromy estimated order ot starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 1. MIRU P&A Unit. POOH 2 7/8" Tubing and Rods @ 10643". 2. RIH Tag CIBP @ 12420". 3. Spot 25 sx CI H from 11666"-11560". (Wolfcamp @ 11616") 5. Set CIBP at 10492. Circ 10# salt gel. Pressure test 500ps/30min. Bun CBL to surface. Send to NMOCD for review. Bubble Test 6. Spot 25 sx CI H from 10492". 10390". WOC & Tag. (Perfs @ 10542") 7. Spot 25 sx CI H from 9076"-8970". (Bone Spring @ 9026") WOC & Tag. 88. Set CIBP at 3822". (Fire 10# salt gel. Pressure test 500ps/30min. Bubble Test 9. Spot 25 sx CI C from 8090"-6770". 11. Spot 35 sx CI C from 8090"-6770". 12. Spot 25 sx CI C from 80-680. WOC & Tag. (Delaware @ 5268", Shoe @ 5226") 12. Spot 25 sx CI C from 150" to surface. WOC & Bubble Test 15. Cut wellhead off 3" BGL, set dry hole marker. und Date: ***SEE ATTACHED COA's**** MUST BE PLUGGED BY 11/1/26		3133 GE				
RERFORM REMEDIAL WORK PLUG AND ABANDON REMPORARILLY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. P AND A COMMENCE DRILLING OPNS. P AND A COMMENCE DRILLING OPNS. P AND A CASING/CEMENT JOB CASING/CEMENT JOB Notify OCD 24 hrs. prior to any work done, gilbert.cordero@emort.nm.gov so a COMPLET of the proposed or completed operations. (Clearly state all pertinent details, arm give permient dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. I. MIRU P&A Unit. POOH 2 7/8" Tubing and Rods @ 10643'.	12. Check	Appropriate Box to Indic	eate Nature of Noti	ce, Report or Other Data		
EMPORARILY ABANDON	NOTICE OF II	NTENTION TO:	S	UBSEQUENT REPORT OF:		
DULL OR ALTER CASING MULTIPLE COMPL CASING/CEMENT JOB DOWNHOLE COMMINGLE LOSED-LOOP SYSTEM OTHER:	PERFORM REMEDIAL WORK				ASING 🗌	
Notify OCD 24 hrs. prior to any work done, gilbert.cordero@emnrd.nm.gov strillers: Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 1. MIRU P&A Unit, POOH 2 7/8" Tubing and Rods @ 10643". 2. RIH Tag CIBP @ 12420". 3. Spot 25 sx cnt 12375' - 1275' - T Strawn. 4. Spot 25 sx CI H from 1666'-11560', (Wolfcamp @ 11616') 5. Set CIBP at 10492. Circ 10# salt gel. Pressure test 500psi/30min. Run CBL to surface. Send to NMOCD for review. Bubble Test 6. Spot 25 sx CI H from 10492'-10390'. WOC & Tag. (Perfs @ 10542') 7. Spot 25 sx CI H from 109076'-8970'. (Bone Spring @ 9026') WOC & Tag 8. Set CIBP at 8322'. Circ 10# salt gel. Pressure test 500psi/30min. Bubble Test 9. Spot 25 sx CI H from 6900'-6770'. 11. Spot 35 sx CI C 5318-5140. WOC & Tag. (Perfs @ 372') 12. Spot 25 sx CI C from 6900'-6770'. 13. Spot 25 sx CI C from 810-680. WOC & Tag. (Boleware @ 5268', Shoe @ 5226') 12. Spot 25 sx CI C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx CI C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. WOLT BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE	_	_			Ш	
done, gilbert.cordero@emnrd.nm.gov DTHER: OTHER: OTH						
DTHER: Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. I. MIRU P&A Unit. POOH 2 7/8" Tubing and Rods @ 10643'. 2. RIH Tag CIBP @ 12420'. 3. Spot 25 sx cmt 12375' - 12275' - T Strawn 4. Spot 25 sx CI H from 1066'-11560'. (Wolfcamp @ 11616') 5. Set CIBP at 10492. Circ 10# salt gel. Pressure test 500psi/30min. Run CBL to surface. Send to NMOCD for review. Bubble Test 6. Spot 25 sx CI H from 10492'-10390'. WOC & Tag. (Perfs @ 10542') 7. Spot 25 sx CI H from 976'-8970'. (Bone Spring @ 9026') WOC & Tag 8. Set CIBP at 8322'. Circ 10# salt gel. Pressure test 500psi/30min. Bubble Test 9. Spot 25 sx CI C from 8322'-8220'. WOC & Tag (Perfs @ 8372') 10. Spot 25 sx CI C from 822'-8220'. WOC & Tag (Perfs @ 8372') 11. Spot 35 sx CI C 5318-5140. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 12. Spot 25 sx CI C 2900-2770. 13. Spot 25 sx CI C from 810-680. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 14. Spot 30 sx CI C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. ud Date: Rig Release Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE Jeff Young E-mail address: Jeff. Young@dvn.com PHONE: _405-228-2480 r State Use Only PROVED BY: TITLE State Wanager DATE _11/13/25					,	
Describe proposed or completed operations. (Clearly state all pertinent details, after give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion. 1. MIRU P&A Unit. POOH 2 7/8" Tubing and Rods @ 10643". 2. RIH Tag CIBP @ 12420". 3. Spot 25 sx cmt 12375' - 12275' - T Strawn 4. Spot 25 sx Cl H from 11666'-11560'. (Wolfcamp @ 11616') 5. Set CIBP at 10492. Circ 10# salt gel. Pressure test 500psi/30min. Run CBL to surface. Send to NMOCD for review. Bubble Test 6. Spot 25 sx Cl H from 10492'-10390'. WOC & Tag. (Perfs @ 10542') 7. Spot 25 sx Cl H from 10492'-10390'. WOC & Tag. (Perfs @ 10542') 10. Spot 25 sx Cl H from 8322'-8220'. WOC & Tag (Perfs @ 8372') 10. Spot 25 sx Cl C from 6900'-6770'. 11. Spot 35 sx Cl C 5318-5140. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 12. Spot 25 sx Cl C 2900-2770. 13. Spot 25 sx Cl C from 810-680. WOC & Tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. which is a surface. Work and the set of my knowledge and belief. GNATURE Affording E-mail address: Jeff. Young @dvn.com PHONE: _405-228-2480 r State Use Only PROVED BY:	OTHER:		OTHER:	so a CO may be assigned		
1. MIRU P&A Unit. POOH 2 7/8" Tubing and Rods @ 10643'. 2. RIH Tag CIBP @ 12420'. 3. Spot 25 sx cmt 12375' - 12275' - T Strawn 4. Spot 25 sx Cl H from 11666' 11560'. (Wolfcamp @ 11616') 5. Set CIBP at 10492. Circ 10# salt gel. Pressure test 500psi/30min. Run CBL to surface. Send to NMOCD for review. Bubble Test 6. Spot 25 sx Cl H from 10492'-10390'. WOC & Tag. (Perfs @ 10542') 7. Spot 25 sx Cl H from 9076'-8970'. (Bone Spring @ 9026') WOC & Tag 8. Set CIBP at 8322'. Circ 10# salt gel. Pressure test 500psi/30min. Bubble Test 9. Spot 25 sx Cl C from 8322'-8220'. WOC & Tag (Perfs @ 8372') 10. Spot 25 sx Cl C from 6900'-6770'. 11. Spot 35 sx Cl C 5318-5140. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 12. Spot 25 sx Cl C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. Rig Release Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE #**SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE #**SEE ATTACHED COA's*** TITLE Production DATE 10/28/2025 pe or print name Jeff Young E-mail address: Jeff. Young@dvn.com PHONE: _405-228-2480 pr State Use Only PPROVED BY: TITLE State Manager. DATE 11/13/25	13. Describe proposed or complete	ed operations. (Clearly state al	ll pertinent details, a <mark>n</mark> t	a give pertinent dates, including estima	tea date of	
2. RIH Tag CIBP @ 12420'. 3. Spot 25 sx cmt 12375' - 12275' - T Strawn 4. Spot 25 sx cmt 12375' - 1275' - T Strawn 4. Spot 25 sx cl H from 11666'-11560'. (Wolfcamp @ 11616') 5. Set CIBP at 10492. Circ 10# salt gel. Pressure test 500psi/30min. Run CBL to surface. Send to NMOCD for review. Bubble Test 6. Spot 25 sx Cl H from 10492'-10390'. WOC & Tag. (Perfs @ 10542') 7. Spot 25 sx Cl H from 9076'-8970'. (Bone Spring @ 9026') WOC & Tag 8. Set CIBP at 8322'. Circ 10# salt gel. Pressure test 500psi/30min. Bubble Test 9. Spot 25 sx Cl C from 8302'-8220'. WOC & Tag (Perfs @ 8372') 10. Spot 25 sx Cl C from 6900'-6770'. 11. Spot 25 sx Cl C from 6900'-6770'. 12. Spot 25 sx Cl C from 6900'-6770'. 13. Spot 25 sx Cl C 2900-2770. 13. Spot 25 sx Cl C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. Rig Release Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. ***SEE ATTACHED COA's*** **TITLE Production DATE 10/28/2025 Preserved Title Use Only **PROVED BY: Attached Title Staff Managar. DATE 11/13/25		SEE RULE 19.15.7.14 NMAC	. For Multiple Comp	letions: Attach wellbore diagram of pr	oposea	
3. Spot 25 sx cmt 12375' - 12275' - T Strawn 4. Spot 25 sx Cl H from 11666'-11560'. (Wolfcamp @ 11616') 5. Set CIBP at 10492 Circ 10# salt gel. Pressure test 500psi/30min. Run CBL to surface. Send to NMOCD for review. Bubble Test 6. Spot 25 sx Cl H from 10492'-10390'. WOC & Tag. (Perfs @ 10542') 7. Spot 25 sx Cl H from 9076'-8970'. (Bone Spring @ 9026') WOC & Tag 8. Set CIBP at 8322'. Circ 10# salt gel. Pressure test 500psi/30min. Bubble Test 9. Spot 25 sx Cl H from 8322'-8220'. WOC & Tag (Perfs @ 8372') 10. Spot 25 sx Cl C from 6900'-6770'. 11. Spot 35 sx Cl C 5318-5140. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 12. Spot 25 sx Cl C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. ud Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 pe or print nameJeff YoungE-mail address:Jeff.Young@dvn.com PHONE:405-228-2480 ***State Use Only PPROVED BY:	1. MIRU P&A Unit.	POOH 2 7/8" Tubing and Rods @	0 10643'.			
4. Spot 25 sx Cl H from 11666'-11560'. (Wolfcamp @ 11616') 5. Set ClBP at 10492. Circ 10# salt gel. Pressure test 500psi/30min. Run CBL to surface. Send to NMOCD for review. Bubble Test 6. Spot 25 sx Cl H from 10492'-10390'. WOC & Tag. (Perfs @ 10542') 7. Spot 25 sx Cl H from 9076'-8970'. (Bone Spring @ 9026') WOC & Tag 8. Set ClBP at 8322'. Circ 10# salt gel. Pressure test 500psi/30min. Bubble Test 9. Spot 25 sx Cl C from 6900'-6770'. 10. Spot 25 sx Cl C from 6900'-6770'. 11. Spot 35 sx Cl C 5318-5140. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 12. Spot 25 sx Cl C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. Rig Release Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE Jeff Young E-mail address: Jeff. Young @dvn.com PHONE: _405-228-2480 pe or print name _Jeff Young E-mail address: _Jeff. Young @dvn.com _PHONE: _405-228-2480 TITLEStaff Manager _DATE11/13/25						
5. Set CIBP at 10492. Circ 10# salt gel. Pressure test 500psi/30min. Run CBL to surface. Send to NMOCD for review. Bubble Test 6. Spot 25 sx Cl H from 10492*-10390'. WOC & Tag. (Perfs @ 10542*) 7. Spot 25 sx Cl H from 9076'-8970'. (Bone Spring @ 9026') WOC & Tag 8. Set CIBP at 8322'. Circ 10# salt gel. Pressure test 500psi/30min. Bubble Test 9. Spot 25 sx Cl H from 8322'-8220'. WOC & Tag (Perfs @ 8372') 10. Spot 25 sx Cl C from 6900'-6770'. 11. Spot 35 sx Cl C 5318-5140. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 12. Spot 25 sx Cl C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. Rig Release Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE Jeff Young E-mail address: Jeff. Young@dvn.com PHONE: _405-228-2480 **TITLE			11616')			
7. Spot 25 sx Cl H from 9076'-8970'. (Bone Spring @ 9026') WOC & Tag 8. Set ClBP at 8322'. Circ 10# salt gel. Pressure test 500psi/30min. Bubble Test 9. Spot 25 sx Cl H from 8322'-8220'. WOC & Tag (Perfs @ 8372') 10. Spot 25 sx Cl C from 6900'-6770'. 11. Spot 35 sx Cl C 5318-5140. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 12. Spot 25 sx Cl C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. WUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE Jeff Young TITLE Production DATE 10/28/2025 pe or print name Jeff Young E-mail address: Jeff. Young@dvn.com PHONE: _405-228-2480 TITLE State Use Only PPROVED BY: TITLE Staff Managen DATE 11/13/25	5. Set CIBP at 10492	. Circ 10# salt gel. Pressure test 5	00psi/30min. Run CBL	to surface. Send to NMOCD for review. B	ubble Test	
8. Set CIBP at 8322'. Circ 10# salt gel. Pressure test 500psi/30min. Bubble Test 9. Spot 25 sx Cl H from 8322'-8220'. WOC & Tag (Perfs @ 8372') 10. Spot 25 sx Cl C from 6900'-6770'. 11. Spot 35 sx Cl C 5318-5140. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 12. Spot 25 sx Cl C 2900-2770. 13. Spot 25 sx Cl C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. 15. Cut wellhead off 3' BGL, set dry hole marker. Rig Release Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE Jeff Young TITLE Production DATE 10/28/2025 Per or print name Jeff Young E-mail address: Jeff. Young@dvn.com PHONE: 405-228-2480 TITLE Staff Managar DATE 11/13/25						
9. Spot 25 sx Cl H from 8322'-8220'. WOC & Tag (Perfs @ 8372') 10. Spot 25 sx Cl C from 6900'-6770'. 11. Spot 35 sx Cl C 5318-5140. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 12. Spot 25 sx Cl C 2900-2770. 13. Spot 25 sx Cl C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. Rig Release Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE Jeff Young TITLE Production DATE 10/28/2025 pe or print name Jeff Young E-mail address: Jeff. Young@dvn.com PHONE: 405-228-2480 TITLE Staff Manager. DATE 11/13/25				est		
11. Spot 35 sx Cl C 5318-5140. WOC & Tag. (Delaware @ 5268', Shoe @ 5226') 12. Spot 25 sx Cl C 2900-2770. 13. Spot 25 sx Cl C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. Rig Release Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE			erfs @ 8372')			
12. Spot 25 sx Cl C 2900-2770. 13. Spot 25 sx Cl C from 810-680. WOC & tag. (Shoe @ 760', Rustler @ 752') 14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. ud Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE Jeff Young TITLE Production DATE 10/28/2025 pe or print name Jeff Young E-mail address: Jeff. Young @dvn.com PHONE: 405-228-2480 TITLE Staff Managan DATE 11/13/25			re @ 5268'. Shoe @ 522	6')		
14. Spot 30 sx Cl C from 150' to surface. WOC & Bubble Test 15. Cut wellhead off 3' BGL, set dry hole marker. Rig Release Date: ***SEE ATTACHED COA's*** MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE	12. Spot 25 sx Cl C 29	000-2770.				
15. Cut wellhead off 3' BGL, set dry hole marker. With the information above is true and complete to the best of my knowledge and belief. GNATURE						
SEE ATTACHED COA's MUST BE PLUGGED BY 11/1/26 ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE			ile Test		\neg	
ereby certify that the information above is true and complete to the best of my knowledge and belief. GNATURE	pud Date:	•	Rig Release Da	te:		
GNATURE	***SEE	ATTACHED COA's***	MUST BE PLUGO	GED BY 11/1/26	<u> </u>	
pe or print nameJeff Young_ E-mail address:Jeff.Young@dvn.com PHONE: _405-228-2480 PPROVED BY: DATE DATE11/13/25	hereby certify that the information	above is true and complete to				
pe or print nameJeff Young_ E-mail address:Jeff.Young@dvn.com PHONE: _405-228-2480 PPROVED BY: DATE DATE11/13/25		-	•	•		
pe or print nameJeff Young_ E-mail address:Jeff.Young@dvn.com PHONE: _405-228-2480 PPROVED BY: DATE DATE11/13/25	SIGNATURE J <i>eff Go</i>	ungTITLE_	Production	DATE10/28/2025		
PPROVED BY:			@dvn.com PHON	NE: _405-228-2480		
			♡ , ,,,	744 DATE 4414914	25	
11 **** \ ** ** */*	Conditions of Approval (if any):	IIILE_	Staff	Williager_DATETITIST		

WELLBORE DIAGRAM - CURRENT

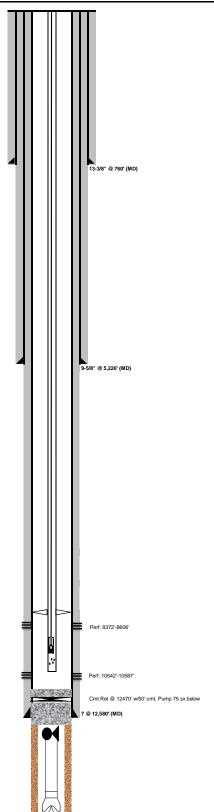



WELL:	RED BULL 31 STATE 1	OPERATOR: DEVON ENERGY PRODUCTION CO LP	SPUD DATE:	10/22/2004
COUNTY:	LEA	DUWI:	TD:	14,818' MD (KB)
STATE:	NM		TVD:	14,120' TVD (KB)
API:	30-025-36798		PBTD:	12,420' MD (KB)
LOCATION:	N-31-23S-35E 1300 FSL 2610 FWL		KB ELEVATION:	3,452.0' (17' KB)
FIELD:	GAUCHO/RED BULL		GL ELEVATION:	3,435.0'
FORMATION:	ANTELOPE RIDGE; BONE SPRING		SURFACE LAT/LONG:	32.257446 / -103.406761

.D.	WT./FT.	GRADE	THD	TOP	BTM	NO. JTS.	BIT SZ.	SX CMT.	TOP CMT.	COMMENT
	1								ļ	
-3/8"	48.00#	H-40	STC	0'	760'	17	17-1/2"	980	0'	Circ 444 sx to surf
O.D.	WT./FT.	GRADE	THD	TOP	BTM	NO. JTS.	BIT SZ.	SX CMT.	TOP CMT	COMMENT
O.D.	WT./FT.	GRADE	THD	TOP	BTM	NO. JTS.	BIT SZ.	SX CMT.	TOP CMT	COMMENT
O.D. 9-5/8"	WT./FT. 40.00#	GRADE P-110	THD	TOP 0'	BTM 5,226'	NO. JTS. 119	BIT SZ. 12-1/4"	SX CMT. 1775	TOP CMT	COMMENT Circ 244 sx to surf
			THD							
			THD							
	40.00#		THD							
9-5/8"	40.00#		THD							

8372-8410 8580-8606 Perf: 8372'-8606'

Perf: 10542'-10587' 10542-10544 10546-10551 10583-10587


Formation	Тор
Rustler	752
Delaware	5268
Bone Spring	9026
Wolfcamp	11616
Strawn	12324
Atoka	12603
Morrow	13619

Tubing and Packer detail		Length (ft)	Top Depth (ft)	Bottom Depth (ft)
KB Adjustment		17.20'	0'	17'
2-7/8" 6.5# L-80 8rd EUE tubing	(252)	8,333.00'	17.2'	8,350.2'
5-1/2" x 2-7/8" TAC	(1)	3.54'	8,350.2'	8,353.7'
2-7/8" 6.5# L-80 8rd EUE tubing	(64)	2,117.4'	8,353.7"	10,471.2'
Tubing drain	(1)	0.7'	10,471.2'	10,471.9'
2-7/8" 6.5# L-80 8rd EUE tubing	(3)	99.21'	10,471.9'	10,571.1'
SN - Mech HD	(1)	0.9'	10,571.1'	10,572.0'
2 7/8" Perforated joint	(1)	4.00'	10,572.0'	10,576.0'
2-7/8" 6.5# L-80 8rd EUE tubing	(2)	66.15'	10,576.0	10,642.1'
2-7/8" Bull Plug	(1)	0.89'	10,642.1'	10,643.0'
-		•	EOT @	10,643'

Туре	Rods	OD	Length	Top Dept
1-1/2" Polish Rod - Liner	1	1.500"	26'	1'
1" Pony Rod	1	1.000"	6'	27'
1" Pony Rod	1	1.000"	8'	33'
1" Sucker Rod	135	1.000"	3,375'	41'
7/8" Norris 97 Sucker rods	144	0.875"	3,600'	3,416'
3/4" Norris 97 Sucker rods	106	0.750"	2,650'	7,016'
7/8" Norris 97 Sucker rods	36	0.875"	900'	9,666'
1 1/4" Rod Centralizer	1	1.250"	1'	10,566'
25 x 125 RHBM Pump	1	1.250"	24'	10,567'
			EOP	10 591'

TD @ 14,818' (MD) PBTD @ 12,420' (MD) (14,120' TVD)

WELLBORE DIAGRAM - PROPOSED

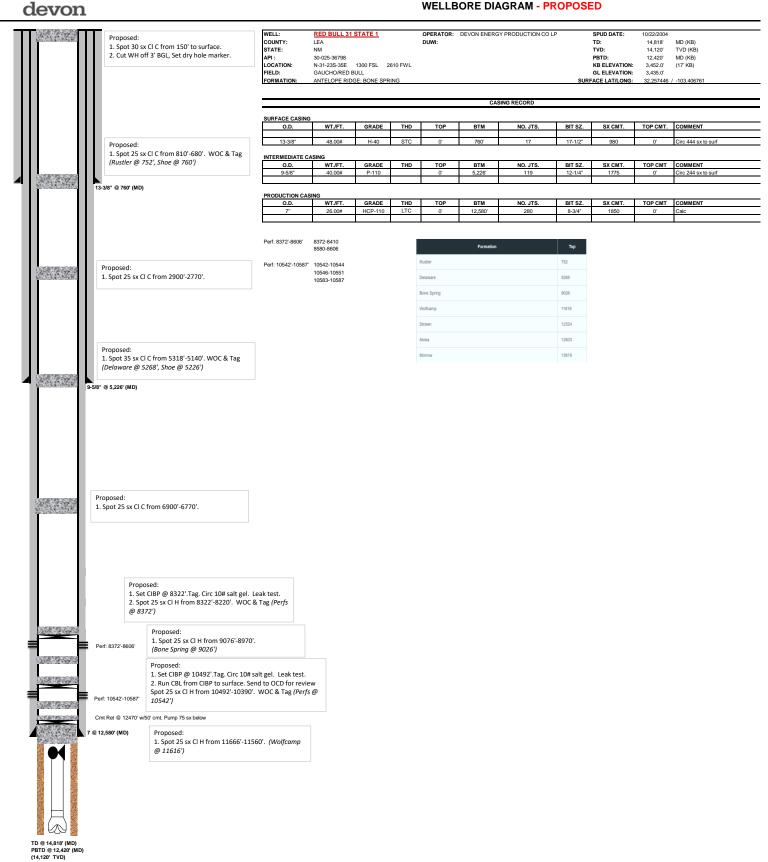

State of New Mexico Energy, Minerals and Natural Resources Department Oil Conservation Division Standard Plugging Conditions



This document provides OCD's general plugging conditions of approval. It should be noted that the list below may not cover special plugging programs in unique and unusual cases, and OCD expressly reserves the right to impose additional requirements to the extent dictated by project conditions. The OCD also reserves the right to approve deviations from the below conditions if field conditions warrant a change. A C-103F NOI to P&A must be approved prior to plugging operations. Failure to comply with the conditions attached to a plugging approval may result in a violation of 19.15.5.11 NMAC, which may result in enforcement actions, including but not limited to penalties and a requirement that the well be re-plugged as necessary.

- 1. Notify OCD office at least 24 hours before beginning work and seek prior approval to implementing any changes to the C-103 NOI to PA.
 - North Contact,
 - South Contact, Gilbert Cordero, 575-626-0830, gilbert.cordero@emnrd.nm.gov
- A Cement Bond Log is required to ensure strata isolation of producing formations, protection of
 water and correlative rights. A CBL must be run or be on file that can be used to properly
 evaluate the cement behind the casing.

Note: Logs must be submitted to OCD via OCD permitting. A copy of the log may be emailed to OCD inspector for faster review times, but emailing does not relieve the operators obligation to submit through OCD permitting.

- 3. Once Plugging operations have commenced, the rig must not rig down until the well is fully plugged without OCD approval. If gap in plugging operations exceeds 30 days, the Operator must file a subsequent sundry of work performed and revised NOI for approval on work remaining. At no time shall the rig be removed from location if it will result in waste or contamination of fresh water.
- 4. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 5. Fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
 - North, water or mud laden fluids
 - South, mud laden fluids
- 6. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to an OCD permitted disposal facility.
- 7. Class of cement shall be used in accordance with the below table for depth allowed.

Class	TVD Lower Limit (feet)	
Class A/B	6,000	
Class I/II	6,000	
Class C or III	6,000	
Class G and H	8,000	
Class D	10,000	

Class E	14,000
Class F	16,000

- 8. After cutting the well head any "top off cement jobs" must remain static for 30 minutes. Any gas bubbles or flow during this 30 minutes shall be reported to the OCD for approval of next steps.
- 9. Trucking companies being used to haul oilfield waste fluids (Commercial or Private) to a disposal facility shall have an approved OCD C-133 permit.
 - A copy of this permit shall be available in each truck used to haul waste products.
 - It is the responsibility of the Operator and Contractor to verify that this permit is in place prior to performing work.
 - Drivers shall be able to produce a copy upon request of an OCD Compliance Officer.
- 10. Filing a [C-103] Sub. Plugging (C-103P) will serve as notification that the well has been plugged.
- 11. A [C-103] Sub. Release After P&A (C-103Q) shall be filed no later than a year after plugging and a site inspection by OCD Compliance officer to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to meet OCD standards before bonding can be released.
- 12. Produced water or brine-based fluids may not be used during any part of plugging operations without prior OCD approval.

13. Cementing;

- All cement plugs will be neat cement and a minimum of 100' in length. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- If cement does not exist between or behind the casing strings at recommended formation depths, the casing perforations will be shot at 50' below the formation top and the cement retainer shall be set no more than 50' from the perforations.
- WOC (Wait on Cement) time will be:
 - 4 hours for accelerated (calcium chloride) cement.
 - o 6 hours on regular cement.
- Operator must tag all cement plugs unless it meets the below condition.
 - The operator has a passing pressure test for the casing annulus and the plug is only an inside plug.
- If perforations are made operator must tag all plugs using the work string to tag unless given approval to tag with wireline by the correct contact from COA #1 of this document.
 - This includes plugs pumped underneath a cement retainer to ensure retainer seats properly after cement is pumped.
- Cement can only be bull-headed with specific prior approval.
- Squeeze pressures are not to exceed the exposed formations frac gradient or the burst pressure of the casing.
- 14. A cement plug is required to be set from 50' below to 50' above (straddling) formation tops, casing shoes, casing stubs, any attempted casing cut offs, anywhere the casing is perforated, DV tools.
 - Perforation/Formation top plug. (When there is less than 100ft between the top perforation to the formation top.) These plugs are required to be started no greater than

50ft from the top perforation. However, the plug should be set below the formation top or as close to the formation top as possible for the maximum isolation between the formations. The plug is required to be a 100ft cement plug plus excess.

- Perforation Plug when a formation top is not included. These plugs are required to be started within 50ft of the top perforation. The plug is required to be a 100ft cement plug plus excess.
- Cement caps on top of bridge plugs or cement retainers for perforation plugs, that are
 not straddling a formation top, may be set using a bailer with a minimum of 35' of
 cement in lieu of the 100' plug. The bridge plug or retainer must be set within 50ft of the
 perforations.
- Perforations are required below the surface casing shoe if cement does not exist behind
 the casing, a 30-minute minimum wait time will be required immediately after
 perforating to determine if gas and/or water flows are present. If flow is present, the
 well will be shut-in for a minimum of one hour and the pressure recorded. If gas is
 detected contact the OCD office for directions.
- 15. No more than 3000 feet is allowed between cement plugs in cased hole and no more than 2000 feet is allowed in open hole.
- 16. Formation Tops to be isolated with cement plugs, but not limited to are:
 - Northwest See Figure A
 - South (Artesia) See Figure B
 - Potash See Figure C
 - o In the R-111-P (Or as subsequently revised) Area a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, woe 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
 - South (Hobbs) See Figure D1 and D2
 - Areas not provided above will need to be reviewed with the OCD on a case by case basis.

17. Markers

• Dry hole marker requirements 19.15.25.10.

The operator shall mark the exact location of plugged and abandoned wells with a steel marker not less than four inches in diameter set in cement and extending at least four feet above mean ground level. The marker must include the below information:

- 1. Operator name
- 2. Lease name and well number
- 3. API number
- 4. Unit letter
- 5. Section, Township and Range
- AGRICULTURE (Below grade markers)

In Agricultural areas a request can be made for a below ground marker. For a below ground marker the operator must file their request on a C-103 notice of intent, and it must include the following;

- A) Aerial photo showing the agricultural area
- B) Request from the landowner for the below ground marker.

C) Subsequent plugging report for a well using a below ground marker must have an updated C-102 signed by a certified surveyor for SHL.

Note: A below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to OCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to OCD. OCD requires a current survey to verify the location of the below ground marker, however OCD will accept a GPS coordinate that were taken with a GPS that has an accuracy of within 15 feet.

18. If work has not commenced within 1 year of the approval of this procedure, the approval is automatically expired. After 1 year a new [C-103] NOI Plugging (C-103F) must be submitted and approved prior to work.

Figure A

North Formations to be isolated with cement plugs are:

- San Jose
- Nacimiento
- Ojo Alamo
- Kirtland
- Fruitland
- Picture Cliffs
- Chacra (if below the Chacra Line)
- Mesa Verde Group
- Mancos
- Gallup
- Basin Dakota (plugged at the top of the Graneros)
- Deeper formations will be reviewed on a case-by-case basis

Figure B

South (Artesia) Formations to be isolated with cement plugs are:

- Fusselman
- Montoya
- Devonian
- Morrow
- Strawn
- Atoka
- Permo-Penn
- Wolfcamp
- Bone Springs
- Delaware, in certain areas where the Delaware is subdivided into;
 - 1. Bell Canyon
 - 2. Cherry Canyon
 - 3. Brushy Canyon
- Any salt sections
- Abo
- Yeso
- Glorieta
- San Andres
- Greyburg
- Queen
- Yates

Figure D1 and D2

South (Hobbs) Formations to be isolated with cement plugs are:

The plugging requirements in the Hobbs Area are based on the well location within specific areas of the Area (See Figure D1). The Formations in the Hobbs Area to be isolated with cement plugs are (see Figure D2)

Figure D1 Map

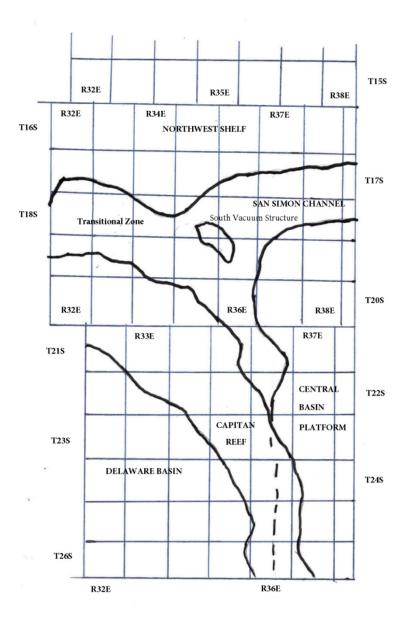


Figure D2 Formation Table

	100'	Plug to isolate upper ar	nd lower fresh water	zones (typically 250' to	350')	
Northwest Shelf	Captan Reef Area	Transition Zone	San Simon Channel	South Vacuum Structure	Delaware Basin	Central Basin Platform
Granit Wash (Detrital basement material and fractured pre-Cambrian basement rock)	Siluro-Devonian	Morrow	Siluro-Devonian	Ellenburger	Siluro-Devonian	Granit Wash (Detrital basement material, fractured pre-Cambrian basement rock and fractur Mafic Volcanic intrusives)
Montoya	Mississippian	Atoka	Morrow	Mckee	Morrow	Ellenburger
Fusselman	Morrow	Strawn	Wolfcamp	Siluro-Devonian	Atoka	Connell
Woodford	Atoka	Cisco	Abo Reef	Woodford	Strawn	Waddell
Siluro-Devonian	Strawn	Pennsylvanian	Bone Spring	Mississippian	Pennsylvanian	Mckee
Chester	Pennsylvanian	Wolfcamp	Delaware	Barnett Shale	Lower Wolfcamp	Simpson Group
Austin	Wolfcamp	Bone Spring	San Andres	Morrow	Upper Wolfcamp	Montoya
Mississippian	Abo Reef, if present	Delaware	Queen	Atoka	Wolfcamp	Fusselman
Morrow	Abo, if present	San Andres	Yates	Strawn	Third Bone Spring Sand (Top of Wolfbone)	Silurian
Atoka	Queen, if present	Grayburg-San Andres	Base of Salt	Canyon	First Bone Spring Sand (Top of Lower Bone Spring)	Devonian
Lower Pennsylvanian	Bone Spring	Queen	Rustler	Pennsylvanian	Bone Spring	Strawn
Cisco-Canyon	Delaware	Seven Rivers		Blinebry	Brushy Canyon	Pennsylvanian
Pennsylvanian	Base Capitan Reef	Yates		Bone Spring	Delaware (Base of Salt)	Wolfcamp
Bough	Seven Rivers	Base of Salt		San Andres	Rustler	Abo
Wolfcamp	Yates	Rustler		Queen		Abo Reef
Abo	Top Capitan Reef			Base of Salt		Drinkard
Abo Reef, if present	Base of Salt			Rustler		ТиЬЬ
Yeso (Township 15 South to Township 17 South)	Rustler					Blinebry
Drinkard or Lower Yeso (Township 15 South to Township 17 South)						Paddock
Tubb (Township 15 South to Township 17 South)						Glorieta
Blinebry (Township 15 South to Township 17 South)						San Andres
Paddock (Township 15 South to Township 17 South)						Grayburg
Glorieta						Grayburg-San Andres
San Andres						Queen
Queen (Township 15 South to Township 17 South)						Seven Rivers
Seven Rivers (Township 15 South to Township 17 South)						Yates
'ates (Township 15 South to Township 17 South)						Base of Salt
Base of Salt						Rustler
Rustler					1	

EXHIBIT "A" CASE 9316 ORDER **R-111-P**

CONSOLIDATED LAND **DESCRIPTION** OF THE KNOWN POTASH **LEASING AREA**, AS OF FEBRUARY **3**, **1988**

EDDY COUNTY, NEW MEXICO

TOWNSHIP 18 SOUTH, RANGE 30 EAST, NMPM

Section 10: SE/4 SE/4

Section 11: S/2 SW/4

Section 13: W/2 SW/4 and SE/4 SW/4
Section 14: W/2 NE/4, NW/4 and S/2

Section 15: E/2 NE/4, SE/4 SW/4 and SE/4 Section 22: N/2, N/2 SW/4, SE/4 SW/4 and SE/4

Section 23: Al

Section 24: N/2 NW/4, SW/4 NW/4 and NW/4 SW/4

Section 26: NE/4, N/2 NW/4 and SE/4 NW/4

Section 27: N/2 NE/4 and NE/4 NW/4

TOWNSHIP 19 SOUTH, RANGE 29 EAST, NMPM

Section 11: SE/4 SE/4

Section 12: SE/4 NE/4 and S/2

Section 13: All

Section 14: NE/4, SE/4 NW/4 and S/2

Section 15: SE/4 SE/4

Section 22: NE/4, E/2 W/2 and SE/4

Section 23: All Section 24: All

Section 25: NW/4 NW/4

Section 26: N/2 NE/4 AND NW/4 Section 27: NE/4 AND E/2 NW/4

TOWNSHIP 19 SOUTH, RANGE 30 EAST, NMPM

Section 2:SW/4

Section 3: W/2 SW/4, SE/4 SW/4, S/2 SE/4 and

NE/4 SE/4

Section 4: Lots 3 and 4. SW/4 NE/4, S/2 NW/4

and S/2

Section 5: Lots 1, 2, and 3, S/2 NE/4,

S/2 NW/4 and S/2

Section 6: S/2 SE/4 and NE/4 SE/4

Sections 7 to 10 inclusive

Section 11: S/2 NE/4, NW/4 NW/4 and S/2

Section 12: NE/4, S/2 NW/4 and S/2

Section 13: NE/4, W/2, N/2 SE/4 and SW/4 SE/4

Sections 14 to 18 inclusive

Section 19: Lots 1, 2, and 3, NE/4, E/2 NW/4,

NE/4 SW/4, E/2 SE/4 and

NW/4 SE/4

Sections 20 to 23 inclusive

-2-EXHIBIT "A" con'd

Section 25: NW/4 NW/4

Section 26: NE/4 NE/4, W/2 NE/4, W/2, W/2 SE/4

and SE/4 SE/4

Section 27: Al1 Section 28: Al1

Section 29: E/2, E/2 NW/4 and NW/4 NW/4

Sect ion 32: E/2 and SE/4 SW/4

Section 33 to 35 inclusive

Section 36: NW/4 NW/4, S/2 NW/4 and S/2

TOWNSHIP 19 SOUTH, RANGE 31 EAST, NMPM

Section 7: Lots 1, 2, and 3 and E/2 NW/4

Section 18: Lots 1, 2, and 3 and SW/4 NE/4,

E/2 NW/4 and NE/4 SW/4

Section 31: Lot 4 Section 34: SE/4 SE/4

Section 35: S/2 SW/4 and SW/4 SE/4

Section 36: S/2 SE/4

LEA COUNTY, NEW MEXICO

TOWNSHIP 19 SOUTH, RANGE 32 EAST, NMPM

Section 31: Lot 4

Section 33: Lots 1 to 4 inclusive and N/2 S/2 Section 34: Lots 1 to 4 inclusive and N/2 S/2 Section 35: Lots 1 to 4 inclusive and N/2 S/2 Lots 1 to 4 inclusive, SE/4 NE/4, NW/4 SW/4 and NE/4 SE/4

TOWNSHIP 19 SOUTH, RANGE 33 EAST, NMPM

Section 22: SE/4 NE/4, E/2 SW/4 and SE/4 Section 23: S/2 NW/4, SW/4. W/2 SE/4 and

SE/4 SE/4

Section 25: SW/4 NW/4, W/2 SW/4 and SE/4 SW/4

Section 26: All Section 27: All

Section 28: S/2 SE/4 and NE/4 SE/4

Section 30: Lots 2 to 4 inclusive, S/2 NE/4,

SE/4 NW/4. E/2 SW/4 and SE/4

Section 31: All

Section 32: NE/4, S/2 NW/4 and S/2

Sections 33 to 35 inclusive

Section 36: W/2 NE/4, SE/4 NE/4, NW/4 and S/2

TOWNSHIP 19 SOUTH, RANGE 34 EAST, NMPM

Section 31 Lots 3 and 4

EXHIBIT "A" con'd

EDDY COUNTY, NEW MEXICO

TOWNSHIP 20 SOUTH, RANGE 29 EAST, NMPM

Section 1: SE/4 NE/4 and E/2 SE/4

Section 13:

SW/4 NW/4, W/2 SW/4 AND SE/4 SW/4 Section 14:

Section15:

NW/4 NE/4, S/2 NE/4, NW/4 and S/2 E/2 E/2, SE/4 SW/4 and W/2 SE/4

Section 22:

E/2 and E/2 NW/4

Section 23:

Section 24:

SW/4 NE/4, W/2, W/2 SE/4

and SE/4 SE/4

Section 25:

N/2, SW/4, W/2 SE/4 and NE/4 SE/4

Section 26:

ΑII

Section 27: Section 34: E/2

Section 35:

NE/4 N/2

Section 36:

W/2 NE/4 AND NW/4

TOWNSHIP 20 SOUTH, RANGE 30 EAST, NMPM

Sections 1 to 4 inclusive

Section 5: Lots 1 to 3 inclusive, S/2 N/2

and S/2

Section 6 Lots 5, 6, and 7, S/2 NE/4, E/2 SW/4

and SE/4

Section 7 Lots 1 and 2. E/2 and E/2 NW/4

Sections 8 to 17 inclusive

Section 18

E/2

Section 19

E/2 and SE/4 SW/4

Sections 20 to 29 inclusive

Section 30:

Lots 1 to 3 inclusive, E/2 and

E/2 W/2

Section 31

E/4 and E/2 SE/4

Sections 32 to 35 inclusive

TOWNSHIP 20 SOUTH, RANGE 31 EAST, NMPM

Section 1 Lots 1 to 3 inclusive, S/2 N/2

and S/2

Section 2: All

Section 3:

Lots 1 and 2, S/2 NE/4 and SE/4

Section 6: Lots 4 to 7 inclusive, SE/4 NW/4,

E/2 SW/4, W/2 SE/4 and

SE/4 SE/4

Section 7: All

Section 8:

S/2 N/2 and S/2

Section 9: S/2 NW/4, SW/4, W/2 SE/4 and SE/4 SE/4

Section 10:

E/2 and SW/4

Section 11 to 36 inclusive

-4-EXHIBIT "A" con'd

LEA COUNTY, NEW MEXICO

TOWNSHIP 20 SOUTH, RANGE 32 EAST, NMPM

Sections 1 to 4 inclusive Section 5: S/2 SE/4

Section 6: Lots 4 to 7 inclusive, SE/4 NW/4,

E/2 SW/4 and SW/4 SE/4

Sections 7 to 36 inclusive

TOWNSHIP 20 **SOUTH**, RANGE 33 EAST, NMPM Sections 1 to 36 inclusive

TOWNSHIP 20 SOUTH, RANGE 34 EAST, NMPM

Section 6: Lots 3 to 7 inclusive, SE/4 NEW/4,

E/2SW/4, W/2 SE/4 AND

SE/4 SE/4

Section 7: All

Section 8: SW/4, S/2 NW/4, W/2 SE/4 and

SE/4 SE/4

Section 16:

W/2 NW/4, SE/4 NW/4, SW/4 and

S/2 SE/4

Sections 17 to 21 inclusive

Section 22:

N/2 NW/4, SW/4 NW/4, W/2 SE/4,

and SE/4 SE/4

Section 26:

SW/4, W/2 SE/4 and SE/4 SE/4

Sections 27 to 35 inclusive

Section 36:

SW/4 NW/4 and W/2 SW/4

EDDY COUNTY, NEW MEXICO

TOWNSHIP 21 SOUTH, RANGE 29 EAST, NMPM

Sections 1 to 3 inclusive

Section 4: Lots 1 through 16, NE/4 SW/4 and

SE/4

Section 5: Lot 1

Section 10:

N/2 NE/4, SE/4 NE/4 and SE/4 SE/4

Sections 11 to 14 inclusive

Section 15:

E/2 NE/4 and NE/4 SE/4

Section 23:

N/2 NE/4

Section 24:

E/2, N/2NW/4 and SE/4NW/4

Section 25:

NE/4 NE/4 and S/2 SE/4

Section 35:

Lots 2 to 4 inclusive, S/2 NE/4.

NE/4 SW/4 and N/2 SE/4

Section 36:

Lots 1 to 4 inclusive, NE/4.

E/2 NW/4 AND N/2 S/2

TOWNSHIP 21 SOUTH, RANGE 30 EAST, NMPM

Sections 1 to 36 inclusive

-5-**EXHIBIT** "A" CON'D

TOWNSHIP 21 SOUTH, RANGE 31 EAST, NMPM

Sections 1 to 36 inclusive

LEA COUNTY, NEW MEXICO

TOWNSHIP 21 SOUTH, RANGE 32 EAST, NMPM

Sections 1 to 27 inclusive

Section 28: N

N/2 and N/2 S/2

Sections 29 to 31 inclusive

Section 32:

NW/4 NE/4, NW/4 and NW/4 SW/4

Section 34:

N/2 NE/4

Section 35:

N/2 N/2

Section 36:

E/2, N/2 NW/4, SE/4 NW/4 and

NE/4 SW/4

TOWNSHIP 21 SOUTH, RANGE 33 EAST, NMPM

Section 1:

Lots 2 to 7 inclusive, Lots 10

to 14 inclusive, N/2 SW/4 and

SW/4 SW/4

Sections 2 to 11 inclusive

Section 12:

NW/4 NW/4 and SW/4 SW/4

Section 13:

N/2 NW/4, S/2 N/2 and S/2

Sections 14 to 24 inclusive

Section 25:

N/2. SW/4 and W/2 SE/4

Sections 26 to 30 inclusive

Section 31:

Lots 1 to 4 inclusive, NE/4,

E/2 W/2, N/2 SE/4 and

SW/4 SE/4

Section 32:

N/2 and NW/4 SW/4

Section 33:

N/2

Section 34:

NE/4, N/2 NW/4 and E/2 SE/4

Section 35:

ΔΙΙ

Section 36:

W/2 NE/4, NW/4 and S/2

TOWNSHIP 21 SOUTH, RANGE 34 EAST, NMPM

Section 17: W/2 Section 18: All

Section 19:

Lots 1 to 4 inclusive, NE/4,

E/2 W/2, N/2 SE/4 and

SW/4 SE/4

Section 20:

NW/4 NW/4

Section 30:

Lots 1 and 2 and NE/4 NW/4

Section 31:

Lots 3 and 4

EDDY COUNTY, NEW MEXICO

TOWNSHIP 22 SOUTH, RANGE 28 EAST, NMPM

Section 36: E/2 E/2

-6-EXHIBIT "A" con'd

TOWNSHIP 22 SOUTH, RANGE 29 EAST, NMPM

Sections 1 and 2 inclusive

Section 3 SE/4 SW/4 and SE/4

Section 9 S/2 NE/4 and S/2 Sections 40 to 16 inclusive

Sections **10** to 16 inclusive Section 17 S/2 SE/4

Section 19 SE/4 NE/4 and E/2 SE/4

Sections 20 to 28 inclusive

Section 29 N/2 N/2, S/2 NE/4 and SE/4

Section 30 NE/4 NE/4

Section 31 Lots 1 to 4 inclusive, S/2 NE/4,

E/2 W/2 and SE/4

Sections 32 to 36 inclusive

TOWNSHIP 22 SOUTH, RANGE 30 EAST, NMPM

Sections 1 to 36 inclusive

TOWNSHIP 22 SOUTH, RANGE 31 EAST, NMPM

Sections 1 to 11 inclusive

Section 12: NW/4 NE/4, NW/4 and NW/4 SW/4

Section 13: S/2 NW/4 and SW/4

Sections 14 through 23 inclusive

Section 24:

W/2 NW/4

Section 25: NW Section 26: NE

NE/4 AND N/2 NW/4

Sections 27 to 34 inclusive

LEA COUNTY, NEW MEXICO

TOWNSHIP 22 SOUTH, RANGE 32 EAST, NMPM

Section 1: Lot 1

Section 6: Lots 2 to 7 inclusive and SE/4 NW/4

TOWNSHIP 22 SOUTH, RANGE 33 EAST NMPM

Section 1: Lots 1 to 4 inclusive, S/2 N/2 and

N/2 S/2

Section 2:All

Section 3:Lot 1, SE/4 NE/4 and SE/4

Section 6: Lot 4

Section 10:

NE/4

Section 11:

NW/4 NE/4 AND NW/4

TOWNSHIP 22 SOUTH, RANGE 34 EAST NMPM

Section 6: Lots 4 to 6 inclusive

Received by OCD: 10/28/2025 1:49:35 PM

-7-EXHIBIT "A" **con'd**

EDDY COUNTY, NEW MEXICO

TOWNSHIP 23 SOUTH, RANGE 28 EAST, NMPM

Section 1: Lot 1

TOWNSHIP 23 SOUTH, RANGE 29 EAST, NMPM

Sections 1 to 5 inclusive

Section 6:

Lots 1 to 6 inclusive, S/2 NE/4,

SE/4 NW/4. E/2 SW/4 and SE/4

Section 7: NE/4 and NE/4 NW/4

Section 8: N/2, N/2 SW/4, SE/4 SW/4 and SE/4

Sections 9 to 16 inclusive

Section 17:

NE/4 and E/2 SE/4

Sections 21 to 23 inclusive

Section 24:

N/2, SW/4 and N/2 SE/4

Section 25:

W/2 NW/4 and NW/4 SW/4

Section 26:

All

Section 27: Section 28: All N/2, N/2 SW/4, SE/4 SW/4 and SE/4

Section 33:

N/2 NE/4 and NE/4 NW/4

Section 34:

NE/4, E/2 NW/4, NW/4 NW/4,

NE/4 SW/4 and SE/4

Section 35:

Section 36:

W/2 NE/4, NW/4 and N/2 SW/4

TOWNSHIP 23 SOUTH, RANGE 30 EAST, NMPM

Sections 1 to 18 inclusive

Section 19

N/2, N/2 SW/4, SE/4 SW/4 and SE/4

Section 20

All

ΑII

Section 21

All

Section 22

N/2, S/2 SW/4, N/2 S/2 and SE/4 SE/4

Sections 23 to 25 inclusive

Section 26

E/2, SE/4 NW/4 and SW/4

Section 27

N/2 NW/4, SW/4 NW/4, SE/4 SW/4,

S/2 SE/4 and NE/4 SE/4

Section 28

N/2 and SW/4 Sect ion 29 N/2 and SE/4

Section 30

N/2 NE/4

Section 32

N/2 NE/4

Section 33

SE/4 NE/4, N/2 NW/4, NE/4 SE/4

and S/2 SE/4

Sections 34 to 36 inclusive

TOWNSHIP 23 SOUTH, RANGE 31 EAST, NMPM

Section 2:

Lot 4, SW/4 NW/4 and W/2 SE/4

Sections 3 to 7 inclusive

Section 8:

NE/4 NE/4, W/2 NE/4 and W/2

Section 9:

N/2 N/2

Section 10:

NW/4 NW/4 and SE/4 SE/4

Section 11: S/2 NE/4, S/2 SW/4 and SE/4

-8-EXHIBIT "A" CON'D

Section 12: SW/4 NW/4 and SW/4

Section 13: SW/4 **NE/4**, W/2 and W/2 SE/4

Section 14: All

Section 15: E/2, SE/4 NW/4 and **SW/4**

Section 16: SW/4 and S/2 SE/4

Section 17: NW/4 and S/2

Sections 18 to 23 inclusive

Section 24: W/2 NE/4 and W/2

Section 25: W/2 NE/4, NW/4, N/2 SW/4 and

NW/4 SE/4

Section 26 to 34 inclusive

Section 35: N/2 NW/4 and SW/4 NW/4

TOWNSHIP 24 SOUTH, RANGE 29 EAST, NMPM

Section 2: Lots 2 to 4 inclusive

Section 3:Lot 1

TOWNSHIP 24 SOUTH, RANGE 30 EAST, NMPM

Section 1: Lots 1 to 4 inclusive, S/2 N/2, SW/4 and NW/4 SE/4

Section 2: All

Section 3: All

Section 4:Lots 1 and 2, S/2 NE/4, SE/4 NW/4,

SW/4 SW/4. E/2 SW/4 and SE/4

Section 9: N/2, N/2 SW/4, SE/4 SW/4 and SE/4

Section 10: All Section 11: All

Section 12: W/2 NW/4 and NW/4 SW/4

Section 14: W/2 NE/4 and NW/4
Section 15: NE/4 and N/2 NW/4

TOWNSHIP 24 SOUTH, RANGE 31 EAST, NMPM

Section 3: Lots 2 to 4 inclusive, SW/4 NE/4,

S/2 NW/4, SW/4 and W/2 SE/4

Section 4:

All Lots 1 to 4 inclusive, S/2 N/2,

Section 5: Lots N/2 S/2 and SE/4 SE/4

Section 6:

SE/4 Lots 1 to 6 inclusive, S/2 NE/4,

SE/4 NW/4, NE/4 SW/4 and

N/2 SE/4

Section 9: E/2 and NW/4

Section 10: W/2 NE/4 and W/2

Section 35: Lots 1 to 4 inclusive, S/2 N/2 and

N/2 S/2

Section 36: Lots 1 and 2, SW/4 NW/4 and N/2 SW/4

TOWNSHIP 25 SOUTH, RANGE 31 EAST, NMPM

Section 1: Lots 3 and 4 and S/2 NW/4

Section 2: Lots 1 to 4 inclusive and S/2 N/2

Sante Fe Main Office Phone: (505) 476-3441

General Information Phone: (505) 629-6116

Online Phone Directory https://www.emnrd.nm.gov/ocd/contact-us

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Action 520741

CONDITIONS

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	520741
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting.	11/13/2025
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	11/13/2025