

U.S. Department of the Interior  
BUREAU OF LAND MANAGEMENT

<b>Well Name:</b> SUNDANCE FEDERAL	<b>Well Location:</b> T24S / R31E / SEC 5 / SWSE / 32.2408784 / -103.7975664	<b>County or Parish/State:</b> EDDY / NM
<b>Well Number:</b> 32	<b>Type of Well:</b> OIL WELL	<b>Allottee or Tribe Name:</b>
<b>Lease Number:</b> NMNM104730	<b>Unit or CA Name:</b>	<b>Unit or CA Number:</b>
<b>US Well Number:</b> 300153367500S1	<b>Operator:</b> OXY USA INCORPORATED	

**Notice of Intent**

**Sundry ID:** 2859894

**Type of Submission:** Notice of Intent

**Type of Action:** Plug and Abandonment

**Date Sundry Submitted:** 06/25/2025

**Time Sundry Submitted:** 07:43

**Date proposed operation will begin:** 07/25/2025

**Procedure Description:** THE CURRENT WELLBORE, PROPOSED WELLBORE, AND PA PROCEDURE ARE ATTACHED. A PA PREP RIG MIGHT BE USED TO PULL EQUIPMENT BEFORE SETTING PLUGS. SEE ATTACHED PA PREP RIG PROCEDURE. ALSO, A LATE SUBSEQUENT REPORT FILING WAS MADE TO SHOW THE PERFS ADDED IN THE SAME ZONE IN 2013 AND 2015. SEE SUNDRY 2859891.

**A WORKOVER SR WAS SUBMITTED WITH AID# 552114 TO NOTE THE ADDED PERFORATIONS.**

**Surface Disturbance**

**Is any additional surface disturbance proposed?:** No

**NOI Attachments**

**Procedure Description**

SUNDANCE\_FEDERAL\_032\_PA\_NOI\_SUB\_6.25.2025\_20250625074316.pdf

Well Name: SUNDANCE FEDERAL

Well Location: T24S / R31E / SEC 5 / SWSE / 32.2408784 / -103.7975664

County or Parish/State: EDDY / NM

Well Number: 32

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMNM104730

Unit or CA Name:

Unit or CA Number:

US Well Number: 300153367500S1

Operator: OXY USA INCORPORATED

Conditions of Approval

Specialist Review

Sundance\_Federal\_32\_\_2859894\_\_COA\_AND\_PROCEDURE\_20250722105053.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: STEPHEN JANACEK

Signed on: JUN 25, 2025 07:43 AM

Name: OXY USA INCORPORATED

Title: Regulatory Engineer

Street Address: 5 Greenway Plaza, Suite 110

City: Houston

State: TX

Phone: (713) 497-2417

Email address: stephen\_janacek@oxy.com

Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: KEITH P IMMATTY

BLM POC Title: ENGINEER

BLM POC Phone: 5759884722

BLM POC Email Address: KIMMATTY@BLM.GOV

Disposition: Approved

Disposition Date: 07/22/2025

Signature: KEITH IMMATTY

Form 3160-5  
(June 2019)

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

FORM APPROVED  
OMB No. 1004-0137  
Expires: October 31, 2021

**SUNDRY NOTICES AND REPORTS ON WELLS**  
**Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.**

<b>SUBMIT IN TRIPLICATE - Other instructions on page 2</b>		5. Lease Serial No.
1. Type of Well <input type="checkbox"/> Oil Well <input type="checkbox"/> Gas Well <input type="checkbox"/> Other		6. If Indian, Allottee or Tribe Name
2. Name of Operator		7. If Unit of CA/Agreement, Name and/or No.
3a. Address	3b. Phone No. (include area code)	8. Well Name and No.
4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description)		9. API Well No.
		10. Field and Pool or Exploratory Area
		11. Country or Parish, State

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Hydraulic Fracturing	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)	
	Title
Signature	Date

**THE SPACE FOR FEDERAL OR STATE OFFICE USE**

Approved by		
	Title	Date
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.		Office

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

## GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

## SPECIFIC INSTRUCTIONS

*Item 4* - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

*Item 13*: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

## NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c) and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

**BURDEN HOURS STATEMENT:** Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

## Additional Information

### Location of Well

0. SHL: SWSE / 660 FSL / 1980 FEL / TWSP: 24S / RANGE: 31E / SECTION: 5 / LAT: 32.2408784 / LONG: -103.7975664 ( TVD: 0 feet, MD: 0 feet )

BHL: SWSE / 660 FSL / 1980 FEL / TWSP: 24S / SECTION: / LAT: 0.0 / LONG: 0.0 ( TVD: 0 feet, MD: 0 feet )

OXY USA INC.

SUNDANCE FEDERAL 032

30-015-33675

NOI TO PERMANENTLY ABANDON THIS WELL VIA CEMENT PLUGGING.

PROPOSED PLUGGING PROCEDURE

1. POOH WITH EXISITNG 2-3/8" TBG AND BHA
2. SPOT 8 SX CL H CMT FROM 8138' TO 8050'
3. SET CIBP AT 6890' VIA WIRELINE. LEAK TEST TO 500 PSI FOR 30 MINUTES
4. RUN CBL FROM CIBP SET AT 6890' TO SURFACE PER OCD REQUIRMENTS. REVIEW WITH BLM.
5. SPOT 141 SX CL C CMT FROM 5890' TO 5110'. WOC AND TAG
6. SPOT 341 SX CL C CMT FROM 4310' TO SURFACE
7. VERIFY CMT TO SURFACE

FORMATION TOPS

Formation	Top
Basal Anhydrite	4013
Delaware Lime	4234
Bell Canyon	4260
Cherry Canyon	5169
Manzanita	5334
Brushy Canyon	6456
Bone Spring	8096

ADDED PERFS IN 7/19/2013

7/19/2013 E&P WIRELINE SUNDANCE FEDERAL # 32 GARY D. MORRISON DAILY-8500 CUM-44,782 CREW T  
RAVEL TO LOCATION PJSM. DISCUSS DAYS OPERATIONS MIRU WIRELINE TRUCK PU LUBRICATOR AND GA  
MMA RAY WITH PERF GUN PULL AND LOG STRIP TO GET ON DEAPTH. SHOOT PERFS AT 7017-7022 7033-  
7071' TOOH WITH TOOL AND GUNS PU RIH WITH DUMP BAILER . DUMP BAIL ACID ACROSS PERFS TOOH  
WITH DUMP BAILER RIG DOWN LUBRICATOR RDMO WIRELINE. MIRU PUMP TRUCK BREAK DOWN PERFS  
@ 2000 PSI. RDMO PUMP TRUCK

ADDED PERFS IN 2/07/2015

Rig up Renegade wireline with Crane: RIH with 3 1/8" Titan EXP 3321-421T SDP.42" EHD and 44.19" penetrati  
on on 60 degree phasing @ 6 SPF and perforate Stage 1 & 2 in 5 total runs Run 1 Perforate holes 7710 - 773  
0 when shot holes no pressure just went on vacuum Run 2 Perforate holes 7690 - 7710 when shot holes no p  
ressure or vacuum Run 3 Perforate holes 7640 - 7665 when shot holes no pressure or vacuum Run 4 Perfora  
te holes 7530 - 7550 when shot holes no pressure or vacuum Run 5 Perforate holes 7515 - 7530 when shot h  
oles no pressure or vacuum Pick up & run in with 4 1/2" CIBP and set it 7015' then dump 2sxs of cement on t  
op of it RIH with 3 1/8" Titan EXP 3321-421T SDP.42" EHD and 44.19" penetration on 60 degree phasing @ 6  
SPF and perforate Stage 3 @ 6940 - 6948 Rig down Renegade wireline with Crane. Shut frac valves.

**CURRENT WELLBORE**

Sean Lehle  
5/23/2025  
30-015-33675-0000  
Eddy

Current Wellbore  
**SUNDANCE FEDERAL 032**

String 1  
OD 13.375 in, 61# H-40 ST&C  
TD 922 ft  
TOC 0 ft, CIRC 193 SX

String 2  
OD 8.625 in, 32# J-55 LT&C  
TD 4220 ft  
TOC 0 ft, CIRC 238 SX

String 3  
OD 4.5 in, 11.6# J-55 LT&C  
TD 8220 ft  
TOC 0 ft, CIRC 54 SX & CBL Verified TOC  
PBTD 8138 ft

Anhydrite 4013'  
Delaware 4234'  
Bell Canyon 4260'

Cherry Canyon 5169'  
Manaznita 5334'


Brushy Canyon 6456'

Bone Spring 8096'

DV Tool  
Top 5197 ft

Prod Zone  
6940-6948 ft  
7017-7071 ft  
Prod Zone  
7515-7730 ft  
Prod Zone  
7846-8046 ft

Tubing Assembly  
OD 2.375 in  
Top 0 ft  
Bot 7547 ft

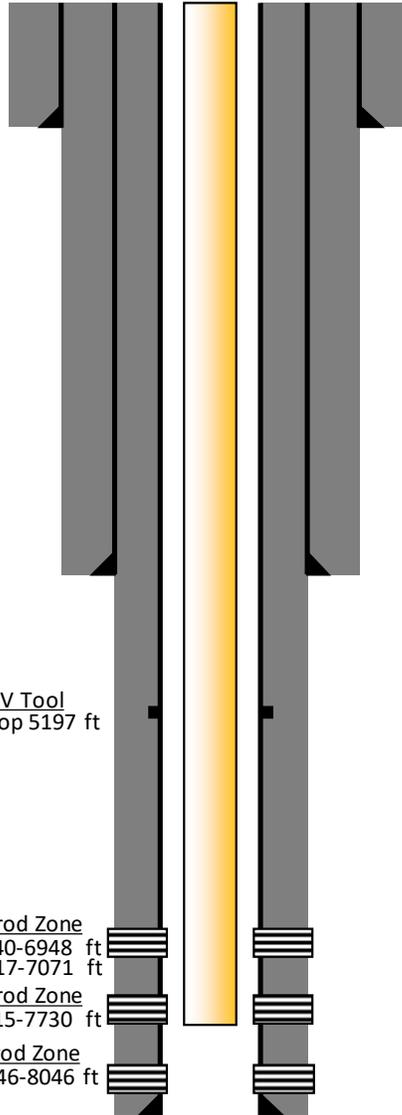

**PROPOSED WELLBORE**

Sean Lehle  
5/23/2025  
30-015-33675-0000  
Eddy

Proposed Wellbore  
**SUNDANCE FEDERAL 032**

String 1  
OD 13.375 in, 61# H-40 ST&C  
TD 922 ft  
TOC 0 ft, CIRC 193 SX

String 2  
OD 8.625 in, 32# J-55 LT&C  
TD 4220 ft  
TOC 0 ft, CIRC 238 SX

String 3  
OD 4.5 in, 11.6# J-55 LT&C  
TD 8220 ft  
TOC 0 ft, CIRC 54 SX & CBL Verified TOC  
PBSD 8138 ft

Anhydrite 4013'  
Delaware 4234'  
Bell Canyon 4260'

Cherry Canyon 5169'  
Manaznita 5334'

Brushy Canyon 6456'

Bone Spring 8096'

DV Tool  
Top 5197 ft

Prod Zone  
6940-6948 ft  
7017-7071 ft


Prod Zone  
7515-7730 ft

Prod Zone  
7846-8046 ft

SPOT 341 SX CMT FROM 4310' TO SURFACE  
VERIFY CMT TO SURFACE

SET CIBP @6890'. LEAK TEST 500 PSI 30 MIN  
SPOT 141 SX CMT FROM 6890' TO 5110'  
WOC AND TAG

SPOT 8 SX CMT FROM 8138' TO 8050'

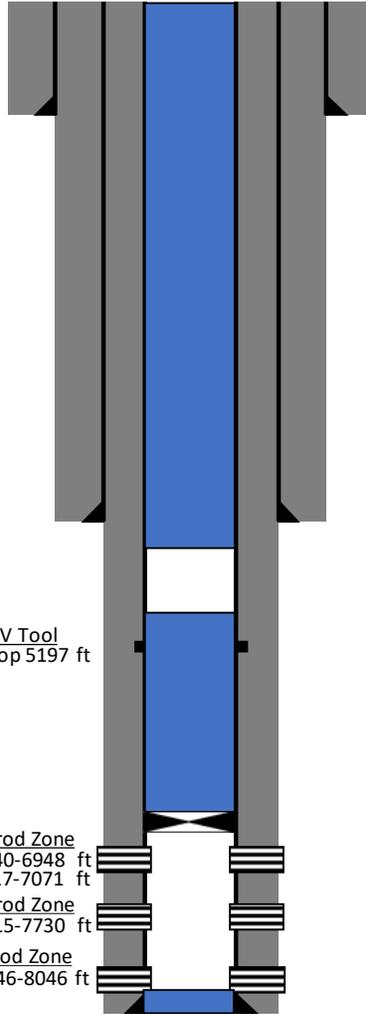

## PA PREP WORK PROCEDURE

The subject well might be pre-plugged prior to PA rig operations. The plugging rig will come in within 90 days of equipment removal to begin plugging this well.

### Prep rig steps

1. Notify BLM or OCD prior to rig up.
2. MIRU prep rig. Prep equipment to pull pump/rods in the hole (if well has rods).
3. LD rods and pump, switchover to pull tbg.
4. ND wellhead & NU BOP.
5. POOH and LD tbg & BHA.
6. RU WL unit. Run and set CIBP.
7. If required, run CBL from top of plug to surface and submit to OCD
8. RD wireline unit.
9. Dump bail cmt as needed on top of CIBP.
10. Tag TOC & ensure well control steps followed below prior to rig off.

### Well control precautions

1. Run official MIT test to ensure pressure holds after CIBP is set.
2. Ensure well control prior to rig off by tagging TOC on top of CIBP.
3. NU WH flange and ensure all valves are closed when moving prep rig off location, no WS tubing left in hole.

- R111Q AREA WELL. SALT COVERAGE OK
- LESSER PRAIRIE CHICKEN AREA RESTRICTIONS APPLY

OXY USA INC.

SUNDANCE FEDERAL 032

30-015-33675

NOI TO PERMANENTLY ABANDON THIS WELL VIA CEMENT PLUGGING.

PROPOSED PLUGGING PROCEDURE

1. POOH WITH EXISITNG 2-3/8" TBG AND BHA
2. SPOT 8 SX CL H CMT FROM 8138' TO 8050'
3. SET CIBP AT 6890' VIA WIRELINE. LEAK TEST TO 500 PSI FOR 30 MINUTES
4. RUN CBL FROM CIBP SET AT 6890' TO SURFACE PER OCD REQUIRMENTS. REVIEW WITH BLM.
5. SPOT 141 SX CL C CMT FROM 5890' TO 5110'. WOC AND TAG
6. SPOT 341 SX CL C CMT FROM 4310' TO SURFACE
7. VERIFY CMT TO SURFACE

PLEASE REVIEW VOLUMES PRIOR TO PLUGGING.  
WOC AND TAG BETWEEN STAGES IF STAGING PLUGS

**APPROVED**

*By Keith Immatty at 10:45 am, Jul 22, 2025*

FORMATION TOPS

Formation	Top
Basal Anhydrite	4013
Delaware Lime	4234
Bell Canyon	4260
Cherry Canyon	5169
Manzanita	5334
Brushy Canyon	6456
Bone Spring	8096

ADDED PERFS IN 7/19/2013

7/19/2013 E&P WIRELINE SUNDANCE FEDERAL # 32 GARY D. MORRISON DAILY-8500 CUM-44,782 CREW TRAVEL TO LOCATION PJSM. DISCUSS DAYS OPERATIONS MIRU WIRELINE TRUCK PU LUBRICATOR AND GAMMA RAY WITH PERF GUN PULL AND LOG STRIP TO GET ON DEPTH. SHOOT PERFS AT 7017-7022 7033-7071' TOOH WITH TOOL AND GUNS PU RIH WITH DUMP BAILER . DUMP BAIL ACID ACROSS PERFS TOOH WITH DUMP BAILER RIG DOWN LUBRICATOR RDMO WIRELINE. MIRU PUMP TRUCK BREAK DOWN PERFS @ 2000 PSI. RDMO PUMP TRUCK

ADDED PERFS IN 2/07/2015

Rig up Renegade wireline with Crane: RIH with 3 1/8" Titan EXP 3321-421T SDP.42" EHD and 44.19" penetration on 60 degree phasing @ 6 SPF and perforate Stage 1 & 2 in 5 total runs Run 1 Perforate holes 7710 - 7730 when shot holes no pressure just went on vacuum Run 2 Perforate holes 7690 - 7710 when shot holes no pressure or vacuum Run 3 Perforate holes 7640 - 7665 when shot holes no pressure or vacuum Run 4 Perforate holes 7530 - 7550 when shot holes no pressure or vacuum Run 5 Perforate holes 7515 - 7530 when shot holes no pressure or vacuum Pick up & run in with 4 1/2" CIBP and set it 7015' then dump 2sxs of cement on top of it RIH with 3 1/8" Titan EXP 3321-421T SDP.42" EHD and 44.19" penetration on 60 degree phasing @ 6 SPF and perforate Stage 3 @ 6940 - 6948 Rig down Renegade wireline with Crane. Shut frac valves.

**CURRENT WELLBORE**

Sean Lehle  
5/23/2025  
30-015-33675-0000  
Eddy


Current Wellbore  
**SUNDANCE FEDERAL 032**

String 1  
OD 13.375 in, 61# H-40 ST&C  
TD 922 ft  
TOC 0 ft, CIRC 193 SX

String 2  
OD 8.625 in, 32# J-55 LT&C  
TD 4220 ft  
TOC 0 ft, CIRC 238 SX

String 3  
OD 4.5 in, 11.6# J-55 LT&C  
TD 8220 ft  
TOC 0 ft, CIRC 54 SX & CBL Verified TOC  
PBTD 8138 ft

Anhydrite 4013'  
Delaware 4234'  
Bell Canyon 4260'  
  
Cherry Canyon 5169'  
Manaznita 5334'  
  
Brushy Canyon 6456'  
  
Bone Spring 8096'

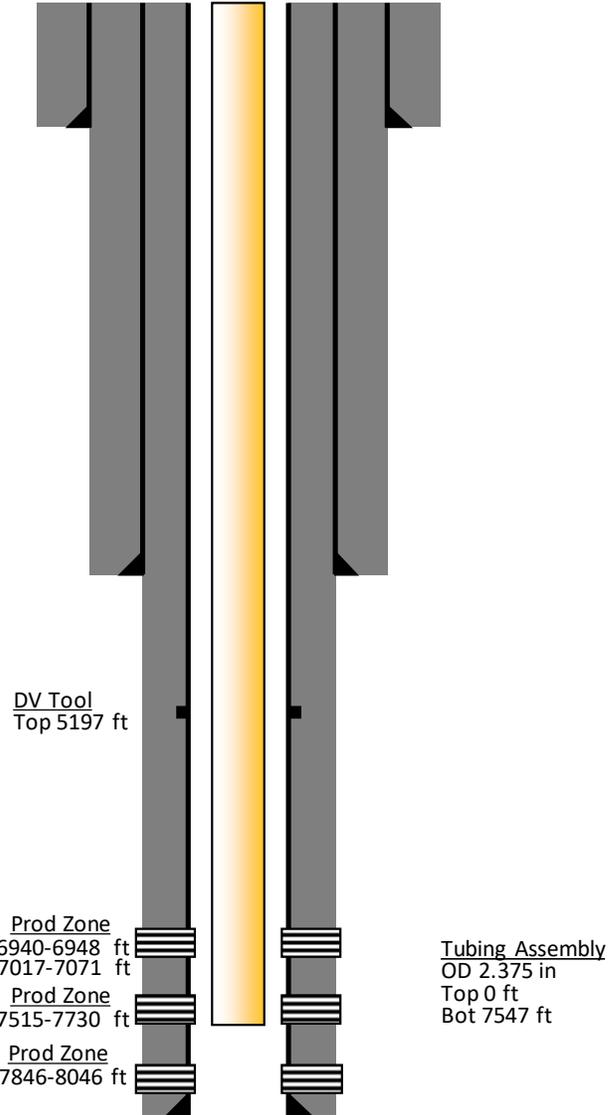

**PROPOSED WELLBORE**

Sean Lehle  
5/23/2025  
30-015-33675-0000  
Eddy

Proposed Wellbore  
**SUNDANCE FEDERAL 032**

String 1  
OD 13.375 in, 61# H-40 ST&C  
TD 922 ft  
TOC 0 ft, CIRC 193 SX

String 2  
OD 8.625 in, 32# J-55 LT&C  
TD 4220 ft  
TOC 0 ft, CIRC 238 SX

String 3  
OD 4.5 in, 11.6# J-55 LT&C  
TD 8220 ft  
TOC 0 ft, CIRC 54 SX & CBL Verified TOC  
PBSD 8138 ft

Anhydrite 4013'  
Delaware 4234'  
Bell Canyon 4260'

Cherry Canyon 5169'  
Manaznita 5334'

Brushy Canyon 6456'

Bone Spring 8096'

DV Tool  
Top 5197 ft

Prod Zone  
6940-6948 ft  
7017-7071 ft


Prod Zone  
7515-7730 ft

Prod Zone  
7846-8046 ft

SPOT 341 SX CMT FROM 4310' TO SURFACE  
VERIFY CMT TO SURFACE

SET CIBP @6890'. LEAK TEST 500 PSI 30 MIN  
SPOT 141 SX CMT FROM 6890' TO 5110'  
WOC AND TAG

SPOT 8 SX CMT FROM 8138' TO 8050'

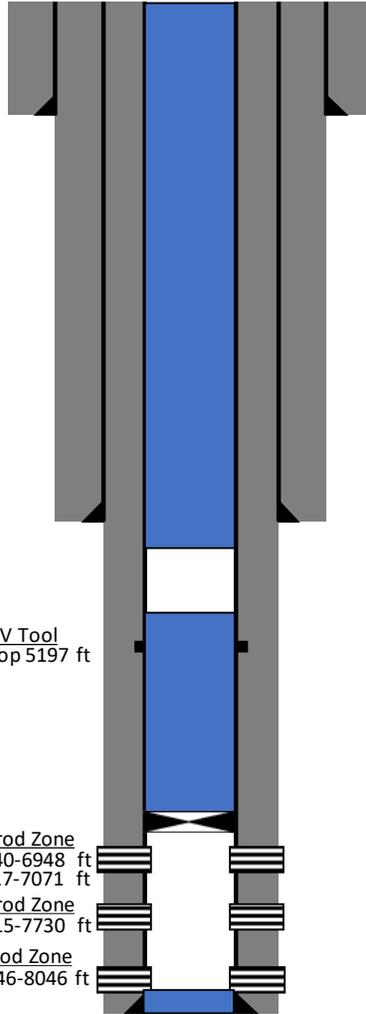

## PA PREP WORK PROCEDURE

The subject well might be pre-plugged prior to PA rig operations. The plugging rig will come in within 90 days of equipment removal to begin plugging this well.

### Prep rig steps

1. Notify BLM or OCD prior to rig up.
2. MIRU prep rig. Prep equipment to pull pump/rods in the hole (if well has rods).
3. LD rods and pump, switchover to pull tbg.
4. ND wellhead & NU BOP.
5. POOH and LD tbg & BHA.
6. RU WL unit. Run and set CIBP.
7. If required, run CBL from top of plug to surface and submit to OCD
8. RD wireline unit.
9. Dump bail cmt as needed on top of CIBP.
10. Tag TOC & ensure well control steps followed below prior to rig off.

### Well control precautions

1. Run official MIT test to ensure pressure holds after CIBP is set.
2. Ensure well control prior to rig off by tagging TOC on top of CIBP.
3. NU WH flange and ensure all valves are closed when moving prep rig off location, no WS tubing left in hole.

**BUREAU OF LAND MANAGEMENT  
Carlsbad Field Office  
620 East Greene Street  
Carlsbad, New Mexico 88220  
575-234-5972**

**Permanent Abandonment of Federal Wells  
Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

Plugging operations shall commence within **ninety (90)** days from the approval date of this Notice of Intent to Abandon.

**If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.**

**The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.**

**Notification: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Lea County, call 575-689-5981. Eddy County, please email notifications to: [BLM\\_NM\\_CFO\\_PluggingNotifications@BLM.GOV](mailto:BLM_NM_CFO_PluggingNotifications@BLM.GOV). The Eddy County inspector on call phone, 575-361-2822, will remain active as a secondary contact.**

**Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

**Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.

**Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours for Class C or accelerated cement (calcium chloride) and 6 hours for Class H. Tagging the plug means running in the hole with a string of tubing or drill pipe and placing sufficient weight on the plug to ensure its integrity. Other methods of tagging the plug may be approved by the BLM authorized officer or BLM field representative.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

Fluid used to mix the cement in R111Q shall be saturated with the salts common to the section penetrated, and in suitable proportions but not less than 1% and not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Above Ground Level Marker: If outside of Lesser Prairie-Chicken Habitat an above ground level marker shall be utilized. All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified *BY PHONE* (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within fourteen (14) calendar days of the well being plugged. If the cut off cannot be done by the 14<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.**

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

Below Ground Level Marker: If within Lesser Prairie-Chicken Habitat a below ground level marker shall be utilized. All casing shall be cutoff at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified *BY PHONE* (numbers listed in 2. Notifications) a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within fourteen (14) calendar days of the well being plugged. If the cut off cannot be done by the 14<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.**

Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing. The following information shall be permanently inscribed on the plate: well name and number, name of operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

Operator to verify the ground marker type with the BLM before setting dry hole Marker.

Subsequent Plugging Reporting: Within 30 days after plugging work is completed, Subsequent Report of Abandonment should be filed via AFMSS reporting system. Please include the following information:

- The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well.
- The final copy of CBL
- Any email correspondence regarding changes to originally approved procedure
- Show date well was plugged.

Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

**Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:**

From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted.



# United States Department of the Interior

## BUREAU OF LAND MANAGEMENT

Carlsbad Field Office  
620 E. Greene St.  
Carlsbad, New Mexico 88220-6292  
www.blm.gov/nm



In Reply Refer To: 1310

### Reclamation Objectives and Procedures

**Reclamation Objective:** Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo “interim” reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo “final” reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines **(Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure)**. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. **This will apply to well pads, facilities, and access roads.** Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.

For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.

The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.

Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon

conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.

It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.

At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos  
Supervisory Petroleum Engineering Tech/Environmental Protection Specialist  
575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias  
Environmental Protection Specialist  
575-234-6230

Crisha Morgan  
Environmental Protection Specialist  
575-234-5987

Jose Martinez-Colon  
Environmental Protection Specialist  
575-234-5951

Angela Mohle  
Environmental Protection Specialist  
575-234-9226

Robert Duenas  
Environmental Protection Specialist  
575-234-2229

Terry Gregston  
Environmental Protection/HAZMAT Specialist  
575-234-5958

Sante Fe Main Office  
Phone: (505) 476-3441

General Information  
Phone: (505) 629-6116

Online Phone Directory  
<https://www.emnrd.nm.gov/oecd/contact-us>

**State of New Mexico**  
**Energy, Minerals and Natural Resources**  
**Oil Conservation Division**  
**1220 S. St Francis Dr.**  
**Santa Fe, NM 87505**

CONDITIONS

Action 552118

**CONDITIONS**

Operator: OXY USA INC P.O. Box 4294 Houston, TX 772104294	OGRID: 16696
	Action Number: 552118
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

**CONDITIONS**

Created By	Condition	Condition Date
gcordero	Adhere to current Plug & Abandon (P&A) Conditions Of Approvals (COA).	2/11/2026
gcordero	A Cement Bond Log (CBL) is required to be submitted to electronic permitting.	2/11/2026
gcordero	Submit Cement Bond Logs (CBL) prior to submittal of C-103P.	2/11/2026