Submit 3 Copies	State of New Mexico		Form C-103	
to Appropriate	Energy, Minerals, and Natural Resources Department		Revised 1-1-89	
District Office				
<u>DISTRICT I</u>	OIL CONSERVATION DIVISION		WELL API NO.	
P.O. Box 1980, Hobbs, NM 88240	P.O. Box 2088		30-059-20318	
DISTRICT II	Santa Fe, New Mexico 87504-2088		5. Indicate Type of L	ease
P.O. Drawer DD, Artesia, NM 88210	,		STATE	X FEE
			6. State Oil & Gas Le	Octo No
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410			o. State On & Gas Le	ease No.
1000 Rio Brazos Rd., Aztec, NM 8/410				
SUNDRY NOTICES AND REPORTS ON WELLS				
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A			7. Lease Name or Unit Agreement Name	
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"  (FORM C-101) FOR SUCH PROPOSALS.)		BRAVO DOME CO2 GAS UNIT		
1. Type of Well OIL GAS	. 🗀		BRAVO DOIVIE CI	UZ GAS UNIT
WELL WE		CO2		
2. Name of Operator			8. Well No.	
Oxy USA Inc			2135-1	81
			9. Pool name or Wildcat	
3. Address of Operator P.O. Box 303. AMISTAD. NEW MEXICO 88410			BRAVO DOME CO2 GAS UNIT	
P.O. Box 303, AMISTA	D, NEW MEXICO 88410		BRAVO DOIVIE CO	OZ GAS UNIT
4. Well Location				
Unit Letter K : 201	3 Feet From The South	Line and 1986	Feet From The	West Line
Section 18	Township 21N	Range 35E N	MPM Union	County
	10. Elevation (Show wheth	her DF, RKB, RT, GR, etc.)		
	4783	GR		
Chools Ammonisto Dou to Indicate Nation Double Date				
Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data				
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:				
PERFORM REMEDIAL WORK	PLUG AND ABANDON	REMEDIAL WORK	ALTI	ERING CASING
TEMPORARIEVARANDON	CHANCE DI ANG	COMMENCE DRILLING OP		C AND ABANDONINGNIE
TEMPORARILY ABANDON	CHANGE PLANS	NS.	G AND ABANDONMENT X	
PULL OR ALTER CASING	R CASING TEST AND CEMENT JOB			
OTHER:		OTHER:	<del></del>	
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)  SEE RULE 1103.				
7/7/2005 - MIRUSU, kill well with fresh water, NUBOP, run cement retainer on workstring, set retainer at 2213 feet, pump				
15 sacks of Premium Plus cement (125% of Cimarron Anhydrite/Tubb annular volume), sting out of retainer, spot 5 sacks of				
cement on top of retainer, displace casing with corrosion inhibited fluid and test casing to 500 psi, held ok, pull workstring to				
1828 feet, spot 20 sacks of cement across Glorietta and Yeso formations, pull workstring to 30 feet and pump 5 sacks of				
cement to fill casing, NDBOP, RDMOSU				
Certifient to fill casing, NDBOF, NDBOF, NDBOF				
8/25/2005 - cut off wellhead, install PXA marker, cut off well anchors and clean location.				
1 6/25/2005 - Cut off wellhead, install PAA marker, cut off well anchors and clean location.				
18/25/2005 - cut off wellhead, install PXA marker, cut off well anchors and clean location.  Tusped 4/35  O E				
[ [ [ [ [ [ [ [ [ [ [ [ [ [ [ [ [ [ [				
U = U = U = U = U = U = U = U = U = U =				
			V	-//
<u> </u>			<del></del>	
I hereby certify that the information above is true and complete to the best of my knowledge and belief.				
SIGNATURE DATE 8/25/2005				
TYPE OR PRINT NAME Danny J. Holcomb TELEPHONE NO. (505) 374-3010				
(This space for State Use)				
APPROVED BY ) 4 OF THILE DISTRICT SUPERVISOR DATE 10/4/05				
CONDITIONS OF APPROVAL, IF ANY:				
	<del></del>			