



NEW MEXICO ENERGY, MINERALS and
 NEW MEXICO RESOURCES DEPARTMENT
 NATURAL RESOURCES DEPARTMENT

GARY E. JOHNSON
 GARY E. JOHNSON
 Betty Rivera
 Betty Rivera
 Cabinet Secretary

Lori Wrotenbery
 Lori Wrotenbery
 Oil Conservation Division
 Oil Conservation Division

OK Operating
 Arco Federal # 1
 UL E, Sec 4, T10S, R38E
 Plugging Procedure

30-025-27639

8 5/8" casing set at 396 ft, Cement circulated
 4 1/2" casing set at 5000ft, Cement circulated
 Perfs 4930-4968ft
 Well fluids circulated to steel pit or plastic lined earthen pit

1. Move in plugging rig
2. Pull production equipment
3. Run and set CIBP at 4880ft
4. Cap CIBP with 35 ft of cement by dump bailer
5. Run tubing and tag cement plug
6. Displace well with gelled brine water
7. Pull tubing to 2395ft
8. Spot 25 sx cement plug
9. Pull tubing 446 feet
10. Circulate cement to surface
11. Pull tubing
12. Cut off well head and install PA marker
13. Rig down move out service unit
14. Remove pumping unit, tank battery and equipment, cut off anchors, clean and level location

BEFORE EXAMINER STOGNER
 OIL CONSERVATION DIVISION
 OCD DEBIT NO. 7
 CASE NO. 12945

Reported prodn
 thru 8/99