Submit 1 Copy To Appropriate District (Office	Rec'd 11/10/2020 - NMOCD						
Sublint I Copy To Appropriate District C	Once	State of New Mexico					F	Form C-103
District I - (575) 393-6161	En	ergy Minera	als and Natura	al Resources				d July 18,2013
1625 N. French Dr., Hobbs, NM 88240	Lii	ergy, minere	ins and reacting	ai Resources	WELL A			
<u>District II</u> - (575) 748-1283		OIL CONSERVATION DIVISION		DIVISION	II	30.015.0		
811 S. First St., Artesia, NM 88210					5. Indicate	e Type of Leas	e	
<u>Disrtict III - (</u> 505) 334-6178 1000 Rio Brazos Rd. Aztec, NM 87410		1220 Sc	outh St. Franci	s Dr.		ATE 🗸		FEE 🗌
District IV - (505) 476-3460		Santa Fe, NM 87505			6. State Oil & Gas Lease No.			
1220 S. St. Francis Dr., Santa Fe, NM 87	7505	~		-				
SUNDRY	NOTICES AND	REPORTS ON	WELLS		7. Lease N	Name or Unit A	greeme	nt Name
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR DEEPEN OR PLUG BACK TO A DIFFERENT				DIFFERENT	Emmpire Abo Unit (309164)			
RESERVIOR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)				8. Well N	-			
1. Type of Well: Oil Well 🗸 Gas Well 🗌 Other				026E				
2. Name of Operator					9. OGRIE	O Numer		
Apache Corporation				873				
3. Address of Operator				10. Pool Name or Wildcat				
303 Veterans Airpark Lane, Ste. 3000, Midland, TX 79705					Empire;Abo (22040)			
4. Well Location								
Unit Letter	C : .	feet fro	om the N	line and	1941	feet from t	W	line
Section	5 Tow	nship 18	S Range	28E	NMPM	Co	ounty	EDDY
	11. Elevat	ion (Show whe	ther DR, RKB,I	RT, GR, etc.)				
			3678' DR					
12.	Check Appropri	ate Box To Iı	ndicate Nature	of Notice, Re	port, or O	ther Data		
		•	I.	SUB	SEQUEN	T REPORT O	F:	
PERFORM REMEDIAL WORK		D ABANDON		AL WORK		ALTERING		з 🗌
TEMPORARILY ABANDON					OPNS.			
PULL OR ALTER CASING			\equiv	CEMENT JOB	_			
DOWNHOLE COMMINGLE								

 OTHER:
 OTHER:
 Image: Close of the state date of starting any proposed work.) SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram or proposed completion or recompletion.

CLOSED-LOOP SYSTEM

Apache Corporation proposes to P&A the above mentioned well by the attached procedure. A closed loop system will be used for all fluids from this wellbore and disposed of required by OCD Rule 19.15.17.14 NMAC.

SEE CHANGES TO PROCEDURE

Spud Date:			Rig Release Date:		
****SEE ATTA	CHED COA's***		MUST BE PLUGGED I	<mark>3Y 11/18</mark>	<mark>/2021</mark>
I hereby certify that the information above is true and complete to the best of my knowledge and belief.					
SIGNATURE	Guínn Burks	TITLE	Sr. Reclamation Foreman	DATE	11/8/20
Type or print name	Guinn Burks	E-mail add.	guinn.burks@apachecorp.com	PHONE:	432-556-9143
For State Use Only APPROVED BY: Conditions of Approval (if a	<i>рр</i> ny):	> TITLE	Staff Manager	DATE	11/18/2020

		LEASE NAME WELL #	Empire Abo Unit 026E
	Apache	API #	30.01502606
		COUNTY	EDDY, NM
	WELL BORE INFO.		
0 625	11' Hole		
	8 5/8" 22.7# @ 755' w/ 450 sx to surf		
4054	TOC @ 895'		
1251			
1876			
2502			
3127			
3752			
4378			
5003			
5629	CIBP @ 5585' w/ 35' cmt 2 3/8" tbg fish @ 5590'-6027' 7 7/8" Hole		bo perfs @ 5662'-5907' bo perfs @ 5966'-6000' bo perfs @ 6016'-6096' qzd Abo perfs @ 6060'-6096' e-perf'd @ 6060'-6096'
6254	5 1/2" 14# @ 6254' w/ 850 sx, TOC @ 895'	PBTD @ 5585' TD @ 6254'	

		LEASE NAME	Empire Abo Unit
	Apache	WELL # API # COUNTY	026E 30.01502606
	WELL BORE INFO.	COUNTY	EDDY, NM PROPOSED PROCEDURE
0	WELL BORE INFO.		PROPOSED PROCEDURE
625	11' Hole 8 5/8" 22.7# @ 755' w/ 450 sx to surf		5. PUH & perf @ 805' & sqz 230 sx Class "C" cmt from 805' to surf. (Surf Shoe, Water Board, & Surf Plug)
1251	TOC @ 895'		4. PUH & spot 30 sx Class "C" cmt from 1472'-1185', (Grayburg & Queen) WOC & Tag
1876			3. PUH & spot 25 sx Class "C" cmt from 2070'-1870', WOC/TAG (San Andres)
2502			
3127			2. PUH & spot 25 sx Class "C" cmt from 3605'-3405', (Yeso) WOC & Tag
3752			
4378 5003			
5003	CIBP @ 5585' w/ 35' cmt		1. MIRU P&A rig. RIH w/ tbg & verify CIBP @ 5585', CIRC w/MLF & spot 25 sx Class "C" cmt from 5585'- 5385', (CIBP over Abo) WOC & Tag
<u> </u>	2 3/8" tbg fish @ 5590'-6027' 7 7/8" Hole 5 1/2" 14# @ 6254'		Abo perfs @ 5662'-5907' Abo perfs @ 5966'-6000' Abo perfs @ 6016'-6096' Sqzd Abo perfs @ 6060'-6096' Re-perf'd @ 6060'-6096'
6254	w/ 850 sx, TOC @ 895'	PBTD @ 5585' TD @ 6254'	

CONDITIONS FOR PLUGGING AND ABANDONMENT

OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office II at (575)-748-1283 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down. Company representative will be on location during plugging procedures.

- 1. A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- 2. Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- 3. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- 5. A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can be released.
- 6. If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- 8. Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- 10. All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- 13. A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- 14. All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.

- 16. When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- 18. A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).
- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
 - A) Fusselman
 - B) Devonian
 - C) Morrow
 - D) Wolfcamp
 - E)Bone Springs
 - F) Delaware
 - G) Any salt sections
 - H) Abo
 - I) Glorieta
 - J) Yates.
 - K) Potash--- (In the R-111-P Area (Potash Mine Area), a solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.
- 21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing

DRY HOLE MARKER REQUIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

1. Operator name2. Lease and Well Number3. API Number4. Unit Letter5. QuarterSection (feet from the North, South, East or West)6. Section, Township and Range7. Plugging Date8. County(SPECIAL CASES)------AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION