

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- P&A		7. Unit Agreement Name
2. Name of Operator Yates Petroleum Corporation		8. Farm or Lease Name T-4 Cattle Co.
3. Address of Operator 207 South 4th St., Artesia, NM 88210		9. Well No. 3
4. Location of Well UNIT LETTER <u>H</u> <u>1980</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>31</u> TOWNSHIP <u>11N</u> RANGE <u>27E</u> NMPM.		10. Field and Pool, or Wildcat Undesignated
15. Elevation (Show whether DF, RT, GR, etc.) 4367' GR		12. County Quay

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 4973'. Plugged and abandoned well as follows:

Set CIBP at 4160' w/35' cemen on top.
Cut 5 1/2" casing at 2850' and laid down.

Spotted cement plugs as follows:

Plug #1: 2800-3110' w/50 sacks Class C w/2% CaCl2. WOC 2 hrs. Tagged plug at 2810'.
Plug #2: 1900-2100' w/70 sacks Class C.
Plug #3: 325-425' w/35 sacks Class C.
Plug #4: At surface w/10 sacks Class C.
Pumped 80 sacks Class C down 13-3/8" and 9-5/8" annulus.

Install dry hole marker. Clean location. Completed 1-4-85.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Production Supervisor DATE 1-10-85

APPROVED BY [Signature] TITLE DISTRICT SUPERVISOR DATE 1-14-85

CONDITIONS OF APPROVAL, IF ANY: