NO. OF COPIES RECEIVED DISTRIBUTION SANTA FE FILE	NEW MEXICO OIL CONSERVATION COMMISSION	Form C-103 Supersedes Old C-102 and C-103 Effective 14-85
U.S.G.S.		Sa. Indicate Type of Lease
LAND OFFICE		State Fee
OPERATOR		5. State Oil & Gas Lease No.
SUNDRY NO	OTICES AND REPORTS ON WELLS IS TO DAILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. DR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)	
)7 NE@+	7. Unit Agreement Name
2. Name of Operator Puretex Oil Co.		8. Form or Lease Name
3. Address of Operator		Frank Chappell, Jr.
•	Viebite Falle 1 Fue = 76001	1
4. Location of Well	Vichita Falls, ¹ Exas 76301	10. Field and Pool, or Wildcat
UNIT LETTER 548	FEET FROM THE East LINE AND 1020	Wildcat
THE South LINE, SECTION	13 TOWNSHIP 12N RANGE 29E	
	15. Elevation (Show whether DF, RT, GR, etc.)	12. County
	4081 GR	SanMiguel
^{16.} Check Appr	opriate Box To Indicate Nature of Notice, Report	
NOTICE OF INTEN		UENT REPORT OF:
PERFORM REMEDIAL WORK	PLUG AND ABANDON	ALTERING CASING
TEMPORANILY ABANDON	COMMENCE DRILLING OPNS.	PLUG AND ABANDONMENT
OTHER	отнея <u>50 Sac</u>	k Cement Squeeze
 Describe Proposed or Completed Operation work) SEE RULE 1103. 	ons (Clearly state all pertinent details, and give pertinent dates, inc	luding estimated date of starting any propose
show oil & gas. 0 4932. Well still We plan to move fr tact. We will com	on Chappell No. 1 4844. Well made on 9/17/71 well squeezed with 50 s make water show oil & gas. oom No. 1 and drill No. 2 to try to be back to No. 1 in about 30 days logs and D&T on No. 1 well.	acks cement 4844- o locate oil water con-
	· ·	
	•	
ρ		
18. I hereby certify that the information above	e is true and complete to the best of my knowledge and belief.	
SIGNED MILLA ALCO	Owner .	Sept. 21, 1971
APPROVED BY 15 Tanteur	a mu Cill & Ga Dispicto	
CONDITIONS OF APPROVAL, 4F ANY:		

.

.

i

WELL COMPLETION REPORT CHAPPELL #1

- 9-12-71 Cut off long string and put plate on surface to long string to stop surface water flow w/2¹ 0.L. on surface (10 3/4) and 1/2¹¹ metal stops on long string to surface to hold up pipe weight. (5 hrs) Started rig up to run tub. to drill out plug.
- 9-13-71 Run tub. got 170¹ off bottom run into heavy mud. Started circulating each jt. down Hit plug at 4843! Drilled plug and started drilling on shoe shut in for night.
- 9-14-71 Finished drilling shoe and aprox. 25' of contam. cement & washed on to T.D. 4932* Circulated hole clean for I hour 10 min. Light skim oll came to surface w/open hole mud. Layed down 3 jts. tubing & flanged up tub. & head tub. set @ 4258 E.L. (74' off bottom). Tub. run as follows: 1-tub. collar w/cut rite on bot. for bit 7': 1 seat n1p 1.20' 157 jts. tubing 4352.96* 4' for D.F. Total 4858.96' 2 p.m. started lay down Drill line & spool up sand line. Finished spooling on sand line Run stinger on tub. sweb and shut in for night.
- 9-19-71 Started tub. swab, swabbed down to 2,000' and could not lower fluid leval continued to swab rest of day swabbing from 3,500' (top fluid 2,000') No gas No oll Shut in for night.
- 9-16-71 Opened well w/"slight" blow on csg & tub. Gas surfaced rich & Heavy. Run swab and recovered aprox 200° on first pull aprox 2 gal. oil and rest olley water. Run 3 more times and getting very little oil and mostly all water. @ 10:30 fluid at 2,000° swabing from 3,500°. Water kinda milkle; oil breaks out of water at all times "(very little)". Filled hole w/water and press up to see what press would pump into formation pumped in @ approx. 300# (Hole taking water at this press) Rigged up Blocks and line over sand line. Shut down & start preparing to squeeze.
- 9-17-71 Rigged up Halliburton filled well & Circulated @ \$50# @ 3 B.P.M. closed csg. in & pumped into form. w/l 1/4 BPM @ 1800# established rate @ 1 1/2 BPM @2100# Fumped aprox. 50 %x. cement & displaced w/24 bbl water. Washed pipe, out & around w/60 bbls and recovered approx. 1/2 bbl. cement. Shut in till morn.
- 9-18-71 Hole full and cement set up. Started swabbing. Swebbed 6 hrs & could not lower fluid below 1900' swabbing from 3500'. Closed in.
- 9-19-71 Opened csg w/5-10# press. Yub. w/little less press. Run sweb got under 1600¹ fluid. (Fluid level at 800¹). Small amount gas ahead of sweb prob. 1/4 cup oll on top of fluid.. Run tub. all the way to bottom to see if any cement set up on bottom. Tagged bottom 0 4927¹; 6¹ fill up w/10000# weight set down. Pulled tub. back up hole and 20¹ inside pipe (6 jts. tub. on rack) Shut well in until can work out further completion.