(May 1963) 7	DEPARTN	1ENT OF THE		(Other instructions on	TE• Form approved re- Budget Bureau	1 No. 42R
<del>ب</del> ۱		EOLOGICAL SU	_	V verse side) / / / / / / / /	5. LEASE DESIGNATION A	
					6. IF INDIAN, ALLOTTEE	
		CES AND RE its to drill or to deep TION FOR PERMIT-		to a different reservoir. sals.)		
	······································				7. UNIT AGREEMENT NAM	(E
WELL WELL	OTHER					
	l and Miner	als Corporat	ion		8. FARM OR DEASE NAME	1
3. ADDRESS OF OPERAT					9. WELL NO.	
1700 Broad	way - Suite	504, Denver	, Colorado	80290		
4. LOCATION OF WELL ( See also space 17 be At surface	(Report location cle slow.)	early and in accordan	ice with any Stat	e requirements.•	10. FIELD AND POOL, OR	WILDCAT
660' FWL a	nd 660' FSI	- Sec. 28-T	6N-R10E		Wildcat 11. Sec., T., B., M., OR BL SUBVEY OR ABEA	K. AND
						0105
14. PERMIT NO.		15. ELEVATIONS (Sho		GR, etc.)	12. COUNTY OR PARISH	13. STATE
			6092 (GL)		Torrance	N.M.
16.	Check Ap	propriate Box To	Indicate Natu	e of Notice, Report, o	r Other Data	
	NOTICE OF INTENT	10N TO:	1	SUBS	SEQUENT REPORT OF:	
TEST WATER SHUT-	OFF PI	TLE OR ALTER CASING		WATER SHUT-OFF	REPAIRING WE	
FRACTURE TREAT	М	ULTIPLE COMPLETE		FRACTURE TREATMENT	ALTERING CAS	
SHOOT OR ACIDIZE	A1	SANDON <sup>®</sup>		SHOOTING OR ACIDIZING	ABANDONMENT	•
REPAIR WELL	i 61	LANGE PLANS		(Other) Ran 9-5/8		
(Other)		· ····· -· - ·. ···		Completion or Reco	ilts of multiple completion on mpletion Report and Log form	•
nent to this work.) Due to dama	age done to	13-3/8" cas.	ing (slot	alls, and give pertinent dat and measured and true ver cut in base of s	ame by abrasive	
nent to this work.) Due to dam drill pipe	age done to ), an inte	13-3/8" cas.	ing (slot ing of 9-5	alls, and give pertinent dat and measured and true ver cut in base of s	tical depths for all markers a	
Due to dam drill pipe the presen Landed and	age done to ), an inte t hole to l cemented 9	13-3/8" cas. rmediate str. 2-1/4" (to 9.	ing (slot ing of 9-5 15'). , K-55, ST	alls, and give pertinent dat and measured and true ver Cut in base of s /8" casing was s	ame by abrasive	
Due to dam drill pipe the presen Landed and	age done to ), an inte t hole to l cemented 9	13-3/8" cas. rmediate str. 2-1/4" (to 9. -5/8", 32.3#	ing (slot ing of 9-5 15'). , K-55, ST	alls, and give pertinent daf and measured and true_ver Cut in base of s /8" casing was s &C casing at 915	ame by abrasive et after reaming ', with 90 sacks	
Due to dam drill pipe the presen Landed and	age done to ), an inte t hole to l cemented 9	13-3/8" cas. rmediate str. 2-1/4" (to 9. -5/8", 32.3#	ing (slot ing of 9-5 15'). , K-55, ST	alls, and give pertinent daf and measured and true_ver Cut in base of s /8" casing was s &C casing at 915	ame by abrasive et after reaming ', with 90 sacks	
Due to dam drill pipe the presen Landed and	age done to ), an inte t hole to l cemented 9	13-3/8" cas. rmediate str. 2-1/4" (to 9. -5/8", 32.3#	ing (slot ing of 9-5 15'). , K-55, ST	alls, and give pertinent daf and measured and true_ver Cut in base of s /8" casing was s &C casing at 915	ame by abrasive et after reaming ', with 90 sacks	
Due to dam drill pipe the presen Landed and	age done to ), an inte t hole to l cemented 9	13-3/8" cas. rmediate str. 2-1/4" (to 9. -5/8", 32.3#	ing (slot ing of 9-5 15'). , K-55, ST	alls, and give pertinent daf and measured and true_ver Cut in base of s /8" casing was s &C casing at 915	ame by abrasive et after reaming ', with 90 sacks	
Due to dam drill pipe the presen Landed and	age done to ), an inte t hole to l cemented 9 ontinued dr.	13-3/8" cas. rmediate str. 2-1/4" (to 9. -5/8", 32.3# illing ahead	ing (slot ing of 9-5 15'). , K-55, ST	alls, and give pertinent daf and measured and true_ver Cut in base of s /8" casing was s &C casing at 915	ame by abrasive et after reaming ', with 90 sacks	
nent to this work.) Due to dam drill pipe the presen Landed and cement. Co	age done to ), an inte t hole to l cemented 9 ontinued dr.	13-3/8" cas. rmediate str. 2-1/4" (to 9. -5/8", 32.3# illing ahead	ing (slot ing of 9-5 15'). , K-55, ST	alls, and give pertinent daf and measured and true_ver Cut in base of s /8" casing was s &C casing at 915	ame by abrasive et after reaming ', with 90 sacks NOV 8 1976 U.S. Conceptor Looked Economic Conceptor	of starting ind zones j
nent to this work.) Due to dam drill pipe the presen Landed and cement. Co	age done to ), an inte t hole to 1 cemented 9 ontinued dr.	13-3/8" cas. rmediate str. 2-1/4" (to 9. -5/8", 32.3# illing ahead illing ahead	ing (slot ing of 9-5 15'). , K-55, ST	alls, and give pertinent daf and measured and true_ver Cut in base of s. /8" casing was s. &C casing at 915	ame by abrasive et after reaming ', with 90 sacks NOV 8 1976 U.S. Composed could Composed could	of starting ind zones j

×.

1