

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals, and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30-059-20022

5. Indicate Type of Lease

STATE ☐

FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

BRAVO DOME CO2 GAS UNIT

8. Well No.

2433-361G

9. Pool name or Wildcat

BRAVO DOME CO2 GAS UNIT

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A

DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"

(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well

OIL
WELL ☐

GAS
WELL ☐

OTHER

CO2

2. Name of Operator

AMOCO PRODUCTION COMPANY

3. Address of Operator

P.O. Box 303, AMISTAD, NEW MEXICO 88410

4. Well Location

Unit Letter G : 1980 Feet From The North Line and 1980 Feet From The East Line
Section 36 Township 24N Range 33E NMPM Union County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
5096 GR

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS ☐

PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

2. Describe Proposed or Completed Operations

SEE RULE 1103

(Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)

10/4/99
MIRUSU, SDON

2/8/00 OK REF

10/5/99
Kill well with fresh water, NU BOP, release packer. Pull and lay down 2 3/8" production tubing and packer. Run cast iron bridge plug on wireline, set CIBP at 2474 feet. Run 2 3/8" workstring and tag CIBP at 2474', displace casing with fresh water with corrosion inhibited fluid, pressure test casing to 500 psi, ok. Spot 5 sacks of Class C cement from 2474' - 2402', pull workstring to 2043', SDON.

10/6/99
Spot 10 sacks of cement from 2043' - 1890', pull workstring to 30 feet, fill casing with cement, ND BOP. cut off wellhead, install PXA marker, RDMOSU, cut off well anchors and clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE D J Holcomb TITLE Field Foreman

DATE 10-13-99

TYPE OR PRINT NAME Danny J. Holcomb

TELEPHONE NO. (505) 374-3010

This space for State Use

APPROVED BY [Signature]

TITLE DISTRICT SUPERVISOR

DATE 2/10/00

CONDITIONS OF APPROVAL, IF ANY