

to Appropriate
District OfficeDISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30-059-20107

5. Indicate Type of Lease

STATE ☐FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

BRAVO DOME CO2 GAS UNIT

8. Well No.

2035-301G

9. Pool name or Wildcat

BRAVO DOME CO2 GAS UNIT

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well

OIL
WELL ☐GAS
WELL ☐

OTHER

CO2

2. Name of Operator

AMOCO PRODUCTION COMPANY

3. Address of Operator

P.O. Box 303, AMISTAD, NEW MEXICO 88410

4. Well Location

Unit Letter G : 1980 Feet From The South Line and 1980 Feet From The East Line
Section 30 Township 20N Range 35E NMPM Union County10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4965 GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐PLUG AND ABANDON ☐TEMPORARILY ABANDON ☐CHANGE PLANS ☐PULL OR ALTER CASING ☐OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ALTERING CASING ☐COMMENCE DRILLING OPNS. ☐PLUG AND ABANDONMENT ☒CASING TEST AND CEMENT JOB ☐OTHER: ☐12. Describe Proposed or Completed Operations
SEE RULE 1103.

(Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)

10/23/99

MIRUSU, kill well with fresh water, NUBOP, release packer, lay down 2 3/8" production tubing and packer, run workstring to 2,358 feet, spot 20 sacks of Class C cement, pull workstring uphole, WOC.

10/24/99

Run workstring, tag cement at 2320', respot 15 sacks of cement from 2320' - 2176', WOC 4 hours, run workstring and tag cement at 2230' (perfs covered), pressure test casing to 500 psi, displace casing with corrosion inhibited fluid, spot 10 sacks of cement from 2230' - 2134', pull workstring to 1,860 feet, spot 15 sacks of cement from 1860' - 1716', pull workstring to 30 feet and spot 5 sacks of cement from 30' - 3', NDBOP, cut off wellhead, install PXA marker, RDMOSU, cut off well anchors and clean location.

2/7/00 - Inspected
OK RCB

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE D. Holcomb TITLE Field Foreman DATE 10-27-99TYPE OR PRINT NAME Danny J. Holcomb TELEPHONE NO. (505) 374-3010

(This space for State Use)

APPROVED BY R. E. Johnson TITLE DISTRICT SUPERVISOR DATE 2/10/00

CONDITIONS OF APPROVAL, IF ANY: