Submit 3 Copies to Appropriate District Office	State of New Mexico Energy, Minerals, and Natural Resources Department		Form C-183 Revised 1-1-89
<u>DISTRICT I</u> P.O. Box 1980, Hobbs, NM 88240	OIL CONSERVATION DIVISION P.O. Box 2088		WELL API NO. 30-059-20110
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Santa Fe, New Mexico 87504-2088		5. Indicate Type of Lease STATE FEE
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 874	\$ 10		6. State Oil & Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			7. Lease Name or Unit Agreement Name
1. Type of Well	GAS T		BRAVO DOME CO2 GAS UNIT
OL WELL 2. Name of Operator	₩ELL OTHER	C02	8. Well No.
AMOCO PRODUCTION COMPANY			2035-181F
3. Address of Operator P.O. Box 303, AMISTAD, NEW MEXICO 88410			9. Pool name or Wildcat BRAVO DOME CO2 GAS UNIT
4. Well Location	1090 Fact From The MOI	CTH Line and 1980	Feet From The WEST Line
Unit Letter F Section 18	1980 Feet From The NOF Township 20N	Range 35E NM	
10 Elevation (Show whether DF, RKB, RT, GR, etc.) 4667 GL			
Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data			
NOTICE C	OF INTENTION TO: PLUG AND ABANDON	SUBSEC REMEDIAL WORK	IUENT REPORT OF: ALTERING CASING
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING OPNS.	PLUG AND ABANDONMENT X
PULL OR ALTER CASING		CASING TEST AND CEMENT JOB	
OTHER: OTHER:			
12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.			
4/8/98 Move in, rig up service unit. Kill well with fresh water. Nipple up BOP. Pull and lay down 2-3/8" production tubing and packer. Run 2-3/8" workstring to 2325'. Spot 25 sacks class C cement @ 2325'.			
4/9/98 Tag top of cement @ 2180'. Pressure test 5-1/2" to 500 psi. Circulate well with mud laiden fluid with inhibitor. Spot 15 sacks of class C cement @ 1860' - 1716'. Spot 5 sacks of class C cement @ 30' - 3'. Cut off wellhead 3' below ground level. Cap well with steel plate. Install dry hole marker. Rig down, move out service unit. Clean and level location.			
I hereby certify that the information above is true and complete to the best of my knowledge and belief.			
I hereby certify that the information above in SIGNATURE	a true and complete to the best of my knowledge end belief.	Field Team Leader	DATE 4/16/98
TYPE OR PRINT NAME D. J. Ho	ic omb		TELEPHONE NO. (505) 374-3010
APPROVED BY DISTRICT SUPERVISOR DATE 8/10/98			
CONDITIONS OF APPROVAL, IF ANY:			