

Submit 3 Copies

to Appropriate

District Office

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

State of New Mexico
Energy, Minerals, and Natural Resources Department

Form C-103

Revised 1-1-89

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30-059-20257

5. Indicate Type of Lease

STATE ☐FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

BRAVO DOME CO2 GAS UNIT

8. Well No.

2431-271K

9. Pool name or Wildcat

BRAVO DOME CO2 GAS UNIT

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A

DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"

(FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well

OIL
WELL ☐GAS
WELL ☐

OTHER

CO2

2. Name of Operator

AMOCO PRODUCTION COMPANY

3. Address of Operator

P.O. Box 303, AMISTAD, NEW MEXICO 88410

4. Well Location

Unit Letter K : 1980 Feet From The South Line and 1980 Feet From The West Line
 Section 27 Township 24N Range 31E NMPM Unica County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

5658GR

11 Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐PLUG AND ABANDON ☐TEMPORARILY ABANDON ☐CHANGE PLANS ☐PULL OR ALTER CASING ☐OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ALTERING CASING ☐COMMENCE DRILLING OPNS. ☐PLUG AND ABANDONMENT ☒CASING TEST AND CEMENT JOB ☐OTHER: ☐

12 Describe Proposed or Completed Operations

(Clearly state all pertinent details and give pertinent dates, including estimated date of starting any proposed work)

SEE RULE 1103

6/24/00

MIRUSU

6/25/00

Kill well with fresh water, NUBOP, release packer, lay down production tubing and packer, run cast iron bridge plug with wireline, set CIBP at 2,457 feet, run workstring, tag CIBP at 2,457 feet, displace casing with corrosion inhibited fluid, pressure test casing to 500 psi, cap CIBP with 10 sacks of class C cement from 2457' - 2399', pull workstring to 2,077 feet, spot 15 sacks of cement from 2077' - 1990', pull workstring to 30 feet, fill casing with cement, NDBOP, RDMOSU.

6/26/00

Cut off wellhead, install PXA marker, cut off well anchors and clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief

SIGNATURE

TITLE

Field Foreman

DATE 6-29-2000

TYPE OR PRINT NAME

Danny J. Holcomb

TELEPHONE NO

(505) 374-3010

(This space for State Use)

APPROVED BY

TITLE

DISTRICT SUPERVISOR

DATE

7/13/00

CONDITIONS OF APPROVAL, IF ANY