Submit 3 Copies	State of New Mexico	Form C-103
to Appropriate District Office	Energy, Minerals, and Natural Resources Department	Revised 1-1-89
DISTRICT I	OIL CONSERVATION DIVISION	WELL API NO.
P.O. Box 1980, Hobbs, NM 88240	P.O. Box 2088	30-059-20279
DISTRICT II	Santa Fe, New Mexico 87504-2088	5. Indicate Type of Lease
P.O. Drawer DD, Artesia, NM 88210		STATE FEE
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410		6. State Oil & Gas Lease No.
	NOTICES AND REPORTS ON WELLS PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	
	SERVOIR. USE "APPLICATION FOR PERMIT"	7. Lease Name or Unit Agreement Name
(FOI	RM C-101) FOR SUCH PROPOSALS.)	-
I. Type of Well OIL GAS		BRAVO DOME CO2 GAS UNIT
WELL WELL		
2. Name of Operator		8. Well No.
AMOCO PRODUCTION C	OMPANY	1836-061F
3. Address of Operator		9. Pool name or Wildcat
P.O. Box 303, AMISTAE	D, NEW MEXICO 88410	BRAVO DOME CO2 GAS UNIT
4. Well Location Unit Letter F : 1650 Feet From The North Line and 1650 Feet From The West Line		
Section 6	Township 18N Range 36E NMI	
	10. Elevation (Show whether DF. RKB, RT. GR, etc.)	PM Union County
	<u>4465</u> <u>GR</u>	
Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK ALTERING CASING		
TEMPORARILY ABANDON CHANGE PLANS COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT X		
PULL OR ALTER CASING	CASING TEST AND CEMENT	JOB
OTHER:	OTHER	
12. Describe Proposed or Completed Operations SEE RULE 1103. (Clearly state all pertinent details. and give pertinent dates, including estimated date of starting any proposed work)		
6/8/2000 MIRUSU, kill well with fresh water, NUBOP, attempt to release packer, attempt to release on/off too, neither would release, squeeze 20 sacks of class C cement down production tubing and packer, displace to 1950', WOC, SDON.		
6/9/2000 Pressure test tbg to 500 psi, ok, run wireline and tag top of cement at 1971'. cut off production tubing at 1961', spot 10 sacks of cement from 1961' - 1903', displace casing with corrosion inhibited fluid, pull tubing to 1,568 feet, spot 25 sacks of cement from 1568' - 1423', pull tubing to 30 feet and spot 5 sacks of cement from 30' - 5', NDBOP, RDMOSU, cut off wellhead, install PXA marker, cut off well anchors and clean location.		
		Inspected 6/13/00 OK REJ
SIGNATURE	true and complete to the best of my knowledge and belief Cm	DATE 6/10/2000
TYPE OR PRINT NAME Danny J. Holcon	nb	TELEPHONE NO (505) 374-3010
APPROVED BY TITLE DISTRICT SUPERVISOR DATE 6/13/00		
CONDITIONS OF APPROVAL, IF ANY:		