

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals, and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

WELL API NO.

30-021-20201

5. Indicate Type of Lease

STATE ☐ FEE ☐

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

BRAVO DOME CO2 GAS UNIT

8. Well No.

1833-261K

9. Pool name or Wildcat

BRAVO DOME CO2 GAS UNIT

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A

DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"

(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well

OIL WELL ☐ GAS WELL ☐ OTHER CO2

2. Name of Operator

AMOCO EXPLORATION AND PRODUCTION COMPANY

3. Address of Operator

P.O. Box 606, CLAYTON, NEW MEXICO 88415

4. Well Location

Unit Letter K : 1980 Feet From The South Line and 1980 Feet From The West Line
Section 26 Township 18N Range 33E NMPM Harding County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

4730 GL

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK

☐

PLUG AND ABANDON

☒

TEMPORARILY ABANDON

☐

CHANGE PLANS

☐

PULL OR ALTER CASING

☐

OTHER:

☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK

☐

ALTERING CASING

☐

COMMENCE DRILLING OPNS.

☐

PLUG AND ABANDONMENT

☐

CASING TEST AND CEMENT JOB

☐

OTHER:

☐

12. Describe Proposed or Completed Operations

(Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)

SEE RULE 1103.

MIRU plugging unit. Kill well as necessary with fresh water. Nipple up BOP. Release Guiberson Uni 6 packer. Lay down production tubing, packer, tailpipe. Run and set with wireline a CIBP @ 2464'. Pressure test casing to 500 psi. Cap CIBP with 50 feet of cement. Run 2-3/8" tubing to just above cement cap on CIBP. Displace casing with 9.5# gelled brine water. Pull tubing to 1964'. Pump 16 sacks cement. Displace cement from tubing with 9.5# gelled brine water. Pull tubing to a depth plus or minus 30 feet. Fill top of casing with cement. Pull final joint of tubing from the well. Check surface casing for pressure. Cut off surface casing head. Weld steel plate on top of casing and install PXA marker. RD plugging unit. Remove well panels. Cut service unit anchors off 1' below ground level. Clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Bill E. Prichard

TITLE

Operations Specialist

DATE

7/23/97

TYPE OR PRINT NAME

Bill E. Prichard

TELEPHONE NO.

(505) 374-3050

(This space for State Use)

APPROVED BY

Ry Johnson

TITLE

DISTRICT SUPERVISOR

DATE

8/27/97

CONDITIONS OF APPROVAL, IF ANY: