

DISTRICT I

P.O. Box 1980, Hobbs, NM 88240

OIL CONSERVATION DIVISION

P.O. Box 2088

Santa Fe, New Mexico 87504-2088

DISTRICT II

P.O. Drawer DD, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.

30-059-20192

5. Indicate Type of LeaseSTATE ☐FEE ☐**6. State Oil & Gas Lease No.****7. Lease Name or Unit Agreement Name**

BRAVO DOME CO2 GAS UNIT

8. Well No.

1835-161M

9. Pool name or Wildcat

BRAVO DOME CO2 GAS UNIT

SUNDRY NOTICES AND REPORTS ON WELLS(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)**1. Type of Well**OIL
WELL ☐GAS
WELL ☐

OTHER

CO2

2. Name of Operator

AMOCO PRODUCTION COMPANY

3. Address of Operator

P.O. Box 303, AMISTAD, NEW MEXICO 88410

4. Well LocationUnit Letter M : 990 Feet From The South Line and 990 Feet From The West Line
Section 16 Township 18N Range 55E NMPM Union County 10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4650 GR**11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data****NOTICE OF INTENTION TO:**PERFORM REMEDIAL WORK ☐PLUG AND ABANDON ☐TEMPORARILY ABANDON ☐CHANGE PLANS ☐PULL OR ALTER CASING ☐OTHER ☐**SUBSEQUENT REPORT OF:**REMEDIAL WORK ☐ALTERING CASING ☐COMMENCE DRILLING OPNS ☐PLUG AND ABANDONMENT ☒CASING TEST AND CEMENT JOB ☐OTHER ☐**12. Describe Proposed or Completed Operations**

(Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)

SEE RULE 1103.

11/8/99 - MIRUSU, kill well with fresh water, NUBOP, release packer, SDON.

11/9/99 - Lay down production tubing and packer, run workstring to 2,495 feet, spot 70 sacks of class C cement from 2495' - 2089', pull workstring uphole, WOC, run workstring, no tag, re-spot 30 sacks of cement from 2495' - 2321', WOC, SDON.

11/10/99 - Run workstring, tag cement at 2418', displace casing with fresh water and corrosion inhibitor, pressure test casing to 500 psi, ok. Spot 10 sacks of cement from 2418' - 2360', pull workstring to 1,860 feet, spot 15 sacks of cement from 1860' - 1744', lay down workstring, SD for crew days off.

11/15/99 - Run workstring to 30 feet and spot 5 sacks of cement from 30' - 3', NDBOP, RDMOSU, cut off wellhead, install PXA marker, cut off well anchors and clean location.

2/7/00 OK Ref

I hereby certify that the information above is true and complete to the best of my knowledge and belief

SIGNATURE D. J. Holcomb TITLE Field Foreman DATE 11-19-99TYPE OR PRINT NAME Danny J. Holcomb TELEPHONE NO (505) 374-3010

(This space for State Use)

APPROVED BY Ry E. Johnson TITLE DISTRICT SUPERVISOR DATE 2/10/00

CONDITIONS OF APPROVAL IF ANY