

District I
1625 N. French Dr., Hobbs, NM 88240
District II
811 S. First St., Artesia, NM 88210
District III
1000 Rio Brazos Road, Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy Minerals and Natural Resources

Oil Conservation Division
1220 South St. Francis Dr.
Santa Fe, NM 87505

Received 3/9/2015
NMOCD Artesia

Form C-141
Revised August 8, 2011

Submit 1 Copy to appropriate District Office in
accordance with 19.15.29 NMAC.

Release Notification and Corrective Action

OPERATOR

☐ Initial Report ☒ Final Report

Name of Company	Devon Energy Production	Contact	Tracy Kidd
Address	6488 Seven Rivers Hwy Artesia, NM 88220	Telephone No.	575.513.0628
Facility Name	HB 10 Fed 1H	Facility Type	Oil Well
Surface Owner	Federal	Mineral Owner	Federal
		API No.	30-015-29157

LOCATION OF RELEASE

Unit Letter	Section	Township	Range	Feet from the	North/South Line	Feet from the	East/West Line	County
H	10	24S	29E	1650	North	990	East	Eddy

Latitude: 32.234873278

Longitude: -103.966670224

NATURE OF RELEASE

Type of Release	Spill	Volume of Release	10BBLS	Volume Recovered	0BBLS
Source of Release	Circulating pump line	Date and Hour of Occurrence	July 20, 2014 11:00 AM	Date and Hour of Discovery	July 20, 2014 11:00 AM
Was Immediate Notice Given?	<input checked="" type="checkbox"/> Yes <input type="checkbox"/> No <input type="checkbox"/> Not Required	If YES, To Whom?	Jeff Robertson; BLM & Thomas Oberding; OCD		
By Whom?	Joah Weidemann	Date and Hour	7/21/2014 2:15 PM & 3:36 PM		
Was a Watercourse Reached?	<input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	If YES, Volume Impacting the Watercourse	N/A		

If a Watercourse was Impacted, Describe Fully.*
N/A

Describe Cause of Problem and Remedial Action Taken.*

External corrosion on circulating pump line. Once the leak in the line was found it was de-energized and isolated. Line is in the process of being replaced and being wax taped to prevent corrosion in the future.

Describe Area Affected and Cleanup Action Taken.*

10 BBLS of oil leaked from the 2" steel circulating pump line where the line was buried under the firewall. The leak was due to external corrosion. The 10 BBLS were contained within the earthen containment. 0 BBLS were recovered. Size of the area affected: 60'x2'.

Action taken: Devon Energy contracted Talon/LPE to perform soil assessment and remediation services. Contaminated soil was hand excavated to a 4' depth and transported to Lea Land, LLC for disposal. The excavated areas were backfilled with new/ clean caliche from Lea Land. Soil samples were taken at 4' deep and sent to Cardinal Laboratories. Testing of these samples revealed that the soil was below the NMOCD Recommended Remedial Action levels.

I hereby certify that the information given above is true and complete to the best of my knowledge and understand that pursuant to NMOCD rules and regulations all operators are required to report and/or file certain release notifications and perform corrective actions for releases which may endanger public health or the environment. The acceptance of a C-141 report by the NMOCD marked as "Final Report" does not relieve the operator of liability should their operations have failed to adequately investigate and remediate contamination that pose a threat to ground water, surface water, human health or the environment. In addition, NMOCD acceptance of a C-141 report does not relieve the operator of responsibility for compliance with any other federal, state, or local laws and/or regulations.

Signature: <i>Sandra Farley</i>	<u>OIL CONSERVATION DIVISION</u>		
Printed Name: Sandra Farley	Approved by Environmental Specialist:		
Title: Field Admin Support	Approval Date: 3/10/2015	Expiration Date: N/A	
E-mail Address: Sandy.Farley@dv.com	Conditions of Approval:		Attached <input type="checkbox"/>
Date: December 19, 2014	Phone: 575.746.5587	Site Ranking should be 10	

* Attach Additional Sheets If Necessary

TPH above RRAL's left in
place

2RP-2390