Submit 3 Copies To Appropriate District	State of New M	lexico (∑ Form C-10
Office District I	Energy, Minerals and Na		Revised March 25, 199
1625 N. French Dr., Hobbs, NM 88240	2.10.67, 1.11.0.010 2.10 1.10		WELL API NO.
District II	OIL CONSERVATION	NI DINTRIONI	30-015-03261
811 South First, Artesia, NM 88210			5. Indicate Type of Lease
<u>District III</u> 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Fra		STATE TEE
District IV	Santa Fe, NM 8	37505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM			B-6570-24
87505	S AND REPORTS ON WELL	C	
SUNDRY NOTICE (DO NOT USE THIS FORM FOR PROPOSAL	ES AND REPORTS ON WELL	UCRACK TO AS	7. Lease Name or Unit Agreement Name:
DIFFERENT RESERVOIR. USE "APPLICA"	TION FOR PERMIT" (FORM C-101) F	OR SUCHA	
PROPOSALS.)		*	
1. Type of Well:		. Jili 2002	
Oil Well Gas Well	Other Plug & Aband	ion RECEIVED	WLHU G4S Unit Tract 36
2. Name of Operator		OCD - ARTESIA	8. Well No.
Yates Petroleum Corporat	ion		9 ₇ 2
3. Address of Operator	A A A	, V	9. Pool name or Wildcat
105 South Fourth Street 4. Well Location	- Artesia, NM 88210	<u>\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\\</u>	Loco Hills-Q-GB-SA
4. Well Location		655512020	
Unit Letter E : 2	310 feet from the North	line and 231	O San San Ala Wast II
Om Letter	leet from the Horeit	ine and 231	feet from the West line
Section 2	Township 18S R	ange 29E	NMPM Eddy County
	0. Elevation (Show whether D		
	3525		
11. Check App	ropriate Box to Indicate N		enort or Other Data
NOTICE OF INTE		1	EQUENT REPORT OF:
	LUG AND ABANDON 🔲	REMEDIAL WORK	
PERIORI NEMEDIAE VORK	EOG AND ABANDON	REMEDIAL WORK	☐ ALTERING CASING ☐
TEMPORARILY ABANDON C	HANGE PLANS	COMMENCE DRILL	ING OPNS. PLUG AND
	_	,	ABANDONMENT
PULL OR ALTER CASING	ULTIPLE	CASING TEST AND	
	OMPLETION	CEMENT JOB	
C		CEMENT JOB	
OTHER:	OMPLETION	CEMENT JOB OTHER:	
OTHER: 12. Describe proposed or completed or	OMPLETION perations. (Clearly state all per	CEMENT JOB OTHER: tinent details, and giv	e pertinent dates, including estimated date
OTHER: 12. Describe proposed or completed of starting any proposed work). SI	OMPLETION perations. (Clearly state all per	CEMENT JOB OTHER: tinent details, and giv	e pertinent dates, including estimated date wellbore diagram of proposed completion
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation.	OMPLETION perations. (Clearly state all per EE RULE 1103. For Multiple C	CEMENT JOB OTHER: tinent details, and giv completions: Attach v	wellbore diagram of proposed completion
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 6-26-2002 - Moved in and	ompletion perations. (Clearly state all per EE RULE 1103. For Multiple C	CEMENT JOB OTHER: tinent details, and giv completions: Attach v t and plugging	wellbore diagram of proposed completion equipment. Installed 2
OTHER: 12. Describe proposed or completed or of starting any proposed work). Sign or recompilation. 6-26-2002 - Moved in and anchors. Nippled down w	perations. (Clearly state all per EE RULE 1103. For Multiple C rigged up pulling unitellhead and changed or	CEMENT JOB OTHER: tinent details, and giv Completions: Attach v and plugging t wellhead. N	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up
OTHER: 12. Describe proposed or completed or of starting any proposed work). Sit or recompilation. 6-26-2002 - Moved in and anchors. Nippled down w floor and tubing equipme	perations. (Clearly state all per EE RULE 1103. For Multiple C rigged up pulling uni ellhead and changed ou nt. Tried to release	CEMENT JOB OTHER: tinent details, and giv Completions: Attach v and plugging t wellhead. N	wellbore diagram of proposed completion equipment. Installed 2
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in	perations. (Clearly state all per EE RULE 1103. For Multiple C rigged up pulling unit ellhead and changed ou nt. Tried to release for night.	CEMENT JOB OTHER: tinent details, and give completions: Attach want and plugging at wellhead. No packer - would	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer.	CEMENT JOB OTHER: tinent details, and give completions: Attach was t and plugging t wellhead. No packer - would Rigged up pump	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck . Circulated 60 bbls fresh
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80	CEMENT JOB OTHER: tinent details, and give completions: Attach with a completion of the completion o	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing.
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH	perations. (Clearly state all per EE RULE 1103. For Multiple Continued and changed on the Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wi	CEMENT JOB OTHER: tinent details, and give completions: Attach was at and plugging at wellhead. No packer - would Rigged up pump bbls fresh was th split collar	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing.
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar and	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down	CEMENT JOB OTHER: tinent details, and give completions: Attach well the and plugging the wellhead. No packer - would Rigged up pump bbls fresh was the split collain with 63 joints	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. r from packer. RIH with s. Shut well in for night.
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar and	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling under the ellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down	CEMENT JOB OTHER: tinent details, and give completions: Attach well and plugging at wellhead. No packer - would rigged up pump bbls fresh was the split collain with 63 joints to 2435'. Pur	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. r from packer. RIH with s. Shut well in for night. mped 80 bbls plugging mud.
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar and	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top	CEMENT JOB OTHER: tinent details, and give completions: Attach well and plugging at wellhead. No packer - would rigged up pump bbls fresh was the split collar with 63 joints to 2435'. Pur of packer at 24	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. r from packer. RIH with s. Shut well in for night. mped 80 bbls plugging mud. 435'. POOH with tubing.
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar and	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling undellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag.	CEMENT JOB OTHER: tinent details, and give completions: Attach well t and plugging at wellhead. No packer - would Rigged up pump bbls fresh was th split collar a with 63 joints a to 2435'. Pur of packer at 24 Spotted 30 sach	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. r from packer. RIH with s. Shut well in for night. mped 80 bbls plugging mud. 435'. POOH with tubing.
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC.	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag. Shut well in for night	CEMENT JOB OTHER: tinent details, and give completions: Attach well and plugging at wellhead. No packer - would rigged up pump bbls fresh was the split collar with 63 joints at 0.2435'. Pur of packer at 24 Spotted 30 sachet.	equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. If from packer. RIH with see Shut well in for night. Inped 80 bbls plugging mud. 435'. POOH with tubing.
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 6-26-2002 - Moved in and anchors. Nippled down we floor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC. 6-29-30-7-1-2002 - RIH weight work work with tubing.	perations. (Clearly state all per EE RULE 1103. For Multiple Continued and changed out. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wide tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag. Shut well in for night ith tubing and tagged	CEMENT JOB OTHER: tinent details, and give completions: Attach well and plugging at wellhead. No packer - would a packer - would be specially to 2435'. Pur of packer at 24 Spotted 30 saciat. plug at 2145'.	equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. r from packer. RIH with s. Shut well in for night. mped 80 bbls plugging mud. 435'. POOH with tubing. ks Class C Neat cement.
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 6-26-2002 - Moved in and anchors. Nippled down we floor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC. 6-29-30-7-1-2002 - RIH we up wireline. Perforated	perations. (Clearly state all per EE RULE 1103. For Multiple Continued and changed out. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing with 100 tubing and 100 tubing and 100 tubing and 100 tubing and 1100".	CEMENT JOB OTHER: tinent details, and give completions: Attach we complete to the completions of the complete to the complet	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. r from packer. RIH with s. Shut well in for night. nped 80 bbls plugging mud. 435'. POOH with tubing. ks Class C Neat cement. POOH with tubing. Rigged line and rigged down wireline.
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC. 6-29-30-7-1-2002 - RIH with packer and set	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling under the ellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag. Shut well in for night ith tubing and tagged 7" casing at 1100'. packer at 875'. Squee	CEMENT JOB OTHER: tinent details, and give completions: Attach well and plugging at wellhead. No packer - would respect to the split collar and the split collar at	wellbore diagram of proposed completion equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. r from packer. RIH with s. Shut well in for night. mped 80 bbls plugging mud. 435'. POOH with tubing. ks Class C Neat cement. POOH with tubing. Rigged line and rigged down wireline. eks Class C Neat cement.
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 6-26-2002 - Moved in and anchors. Nippled down we floor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC. 6-29-30-7-1-2002 - RIH we up wireline. Perforated	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling under the ellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag. Shut well in for night ith tubing and tagged 7" casing at 1100'. packer at 875'. Squee	CEMENT JOB OTHER: tinent details, and give completions: Attach we complete to the second of the se	equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. If from packer. RIH with s. Shut well in for night. Imped 80 bbls plugging mud. A35'. POOH with tubing. It is Class C Neat cement. POOH with tubing. Rigged line and rigged down wireline. Eks Class C Neat cement.
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC. 6-29-30-7-1-2002 - RIH with packer and set I hereby certify that the information about the pool of the proposed set in the pool of the packer and set I hereby certify that the information about the pool of the proposed set in the proposed set in the proposed set in the packer and set I hereby certify that the information about the proposed set in the propo	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag. Shut well in for night tubing and tagged 7" casing at 1100'. packer at 875'. Squeeve is true and complete to the beautiful to the squeeter of the squeeter to the squeeter t	CEMENT JOB OTHER: tinent details, and give completions: Attach we complete to the completions of the complete to the complet	equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. If from packer. RIH with seed the seed of the seed
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC. 6-29-30-7-1-2002 - RIH with packer and set	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag. Shut well in for night tubing and tagged 7" casing at 1100'. packer at 875'. Squeeve is true and complete to the beautiful to the squeeter of the squeeter to the squeeter t	CEMENT JOB OTHER: tinent details, and give completions: Attach we complete to the second of the se	equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. If from packer. RIH with s. Shut well in for night. Inped 80 bbls plugging mud. A35'. POOH with tubing. It is Class C Neat cement. POOH with tubing. Rigged line and rigged down wireline. Eks Class C Neat cement. and belief. ON NEXT PAGE:
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC. 6-29-30-7-1-2002 - RIH with packer and set I hereby certify that the information about the starting of the starting water and set of the starting water	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag. Shut well in for night tubing and tagged 7" casing at 1100'. packer at 875'. Squeeve is true and complete to the beautiful to the squeeter of the squeeter to the squeeter t	CEMENT JOB OTHER: tinent details, and give completions: Attach we complete to the completions of the complete to the complet	equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. If from packer. RIH with s. Shut well in for night. Imped 80 bbls plugging mud. A35'. POOH with tubing. It is Class C Neat cement. POOH with tubing. Rigged line and rigged down wireline. Its Class C Neat cement. And belief. ON NEXT PAGE: Associates DATE 7-3-2002
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down with floor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC. 6-29-30-7-1-2002 - RIH with the pool with packer and set of the proposed and set of the pool with the information about the pool with the pool with the information about the pool with the pool with the information about the pool with the pool with the information about the pool with the pool with the information about the pool with th	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag. Shut well in for night tubing and tagged 7" casing at 1100'. packer at 875'. Squeeve is true and complete to the beautiful to the squeeter of the squeeter to the squeeter t	CEMENT JOB OTHER: tinent details, and give completions: Attach we complete to the completions of the complete to the complet	equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. If from packer. RIH with seed the seed of the seed
OTHER: 12. Describe proposed or completed of starting any proposed work). Stor recompilation. 6-26-2002 - Moved in and anchors. Nippled down wfloor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC. 6-29-30-7-1-2002 - RIH with packer and set I hereby certify that the information about the starting of the starting water and set of the starting water	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag. Shut well in for night tubing and tagged 7" casing at 1100'. packer at 875'. Squeeve is true and complete to the beautiful to the squeeter of the squeeter to the squeeter t	CEMENT JOB OTHER: tinent details, and give completions: Attach we complete to the completions of the complete to the complet	equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. from packer. RIH with s. Shut well in for night. mped 80 bbls plugging mud. 435'. POOH with tubing. ks Class C Neat cement. POOH with tubing. Rigged line and rigged down wireline. eks Class C Neat cement. and belief. ON NEXT PAGE: Associates DATE 7-3-2002
OTHER: 12. Describe proposed or completed of starting any proposed work). Shor recompilation. 6-26-2002 - Moved in and anchors. Nippled down with floor and tubing equipme at 1800'. Shut well in 6-27-2002 - Worked tubin water - could not get pa Packer came loose. POOH 2-7/8" notched collar an 6-28-2002 - Worked tubin Spotted 30 sacks Class "WOC 4 hours. RIH with the POOH with tubing. WOC. 6-29-30-7-1-2002 - RIH with the pool with packer and set of the proposed and set of the pool with the information about the pool with the pool with the information about the pool with the pool with the information about the pool with the pool with the information about the pool with the pool with the information about the pool with th	perations. (Clearly state all per EE RULE 1103. For Multiple Corigged up pulling unitellhead and changed ount. Tried to release for night. g to release packer. cker loose. Pumped 80 with 2-3/8" tubing wid tubing. Worked down g. Pushed packer down C" Neat cement on top ubing - did not tag. Shut well in for night tubing and tagged 7" casing at 1100'. packer at 875'. Squeeve is true and complete to the beautiful to the squeeter of the squeeter to the squeeter t	CEMENT JOB OTHER: tinent details, and give completions: Attach we complete to the completions of the complete to the complet	equipment. Installed 2 ippled up BOP. Rigged up not release. Packer stuck Circulated 60 bbls fresh ter and worked tubing. If from packer. RIH with s. Shut well in for night. Imped 80 bbls plugging mud. A35'. POOH with tubing. It is Class C Neat cement. POOH with tubing. Rigged line and rigged down wireline. Its Class C Neat cement. And belief. ON NEXT PAGE: Associates DATE 7-3-2002

YATES PETROLEUM CORPORATION WLHU G4S Unit Tract 36-2 Section 2-T18S-R29E Eddy County, New Mexico

SUNDRY NOTICE CONTINUED:

Displaced to 1050'. Shut well in with 1500 psi. WOC 4 hours. Opened up well had too much pressure. Shut well in for night. 7-2-2002 - Opened up well. Rigged up wireline. RIH with bars and tagged plug at 903'. POOH with wireline and rigged down wireline. Released packer. POOH with packer. Rigged up wireline. Perforated 7" casing at 475'. POOH with wireline and rigged down wireline. RIH with packer to 125'. Squeezed with 75 sacks Class C Neat cement. Displaced to 375'. WOC 4 hours. Rigged up wireline. RIH with bars did not tag. POOH with wireline and rigged down wireline. Squeezed with 75 sacks Class C Neat cement. Displaced to 375'. WOC. Shut well in for night. 7-3-2002 - Rigged up wireline. TIH with bars and tagged plug at 358'. POOH with wireline and rigged down wireline. Released packer. POOH with packer. Rigged up wireline. Perforated 7" and 8-5/8" casing at 60'. POOH with wireline and rigged down wireline. Rigged down tubing equipment and floor. Nippled down BOP and wellhead. Installed 7" X 2" swedge with valve. Circulated 40 sacks Class C Neat cement down 7" casing and up to surface of 8-5/8" casing and on outside of 8-5/8" casing. WOC 4 hours. Stayed full of cement. Rigged down pulling unit and plugging equipment. Installed regulation abandonment marker. PLUGGED AND ABANDONED - FINAL REPORT. Plugging completed 7-2-2002.

Rusty Klein
Agent for BCM & Associates

July 3, 2002