201112137476	
1391011121314157613	
	FORM APPROVED
	- Rudget Bureau No. 1004-0135
M RECEIVED BUREAU OF LAND MANAGEMENTV-DIST.	Expires: March 31, 1993
ARTESUNDRY NOTICES AND REBOT TO ON WELLES	NM-0554221
Do not use this form for proposals to drill or to deepen or the state of the server of	oir. 6. If Indian, Allottee or Tribe Name
SUBMIT IN TRIPLICATE	
1. Type of Well	7. If Unit or CA, Agreement Designation
Oil Gas	Nash Unit
X Well Uther	8. Well Name and No.
2. Name of Operator	Nash Unit #33
3. Address and Telephone No. P. O. Box 1030	9. API Well No.
3. Address and Telephone No. P. O. BOX 1030 Roswell, New Mexico 88202-1030 505-622	2-1127 30-015-32476 10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)	Nash Draw Brushy Canyon
UT. M S.L. 10 FSL & 175 FWL - Section 12-23S-29E B.H.L. 2650' FSL & 2250' FWL Section 11-23S	
12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA	
TYPE OF SUBMISSION TYPE OF	ACTION
Notice of Intent Abandonment	(A) Change of Plans
X Recompletion	New Construction
X Subsequent Report Plugging Back Yew 7	Urth Change of Plans New Construction Non-Routine Fracturing Water Shut-Off Conversion to Injection
Casing Repair	Water Shut-Off
Final Abandonment Notice	Conversion to Injection
	Dispose Water
	(Note: Report results of multiple completion on Well
13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, includ	Completion or Recompletion Report and Log form.) ing estimated date of starting any proposed work. If well is
directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*	
02/19/03: Prep to re-complete. Flow dwn csg. Release pkr. Start out of hole w/tbg.	
02/20/03: PU, GIH w/RPB. Set plug at 6814'. PU. Circ hole. Prep to spot acid.	
02/21/03: RU. TOH w/tbg. RU. TIH w/Cement Bond Log. Run log from 6800' - 3000'. TOH w/logs. GIH w/4" select-fire guns. Perf 5 (.42) holes as follows: 6691', 94', 95', 97', 99'. TOH w/guns. RD. PU and GIH w/pkr. Set pkr at 6614'. RU. Break down perfs at 2000#. Prep to acidize.	
02/22/03: RU. Acidize w/750 gal 7 1/2% NeFe and 10 bail sealers. Ball well out. SISD.	
02/23/03: Rel pkr and TOH. SISD.	
02/24/03: RU. GIH w/4" select-fire guns. Perf 15 (.42) holes as follows: 6562', 67', 73', 76', 86', 94', 6600', 05', 07', 22', 23', 33', 34', 35', 38'. TOH w/guns. PU and GIH w/RBP and pkr. Set pkr at 6675'. Test to 2000#. Test okay. Circ hole. Set pkr at 6450'. RU. Break down perfs at 2500#. Open by-pass and spot acid to pkr. Acidize w/1600 gal 7 1/2% NeFe and 30 ball sealers. RU swab. Swab well down. SISD.	
02/25/03: Open well up. Flowing to battery.	
02/26/03: RU. Prep to frac via 5 1/2" csg w/61,100# 16/30 sand and tail-in with 20/40 resin coated sand. Gel 1000 bbls, 2% KCL w/YF-130 SP. Place 61,100# sand on formation at one to four pounds per gallon. SISD.	
14. I hereby certify that the foregoing is true and correct	ACCEPTED FOR RECORD
Signed Sulf M/Suff Title Production Records	Date 02/27/03
(This space for Federal or State office use)	
	MAH 1 0 2003
Approved by Title TitleTItteTItteTItteTItteTItteTItteTItteTItteTItteTItteTItteTItteTItteTI	Date
	ALEXIS C. SWOBODA
Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency	PETROLEUM ENGINEER of the United States any raise, fictuities or fraudulent states any raise,

* See Instruction on Reverse Side

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the representations as to any matter within its jurisdiction.