

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised March 25, 1999

OIL CONSERVATION DIVISION

2040 South Pacheco
Santa Fe, New Mexico 87505

DISTRICT I

1625 N. French Dr., Hobbs, NM 88240

DISTRICT II

811 S. First Street, Artesia, NM 88210

DISTRICT III

1000 Rio Brazos Rd., Aztec, NM 87410

WELL API NO.
30-005-63021

5. Indicate Type of Lease
STATE FEE

6. State Oil & Gas Lease No.
V-4978

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

RECEIVED
MAR 02 2005
OIL-ARTESIA

7. Lease Name or Unit Agreement Name
Hi-Way State

1. Type of Well:
OIL WELL GAS WELL OTHER

8. Well No.
1

2. Name of Operator
ELK OIL COMPANY

9. Pool Name or Wildcat
Wolfcamp

3. Address of Operator
POST OFFICE BOX 310, ROSWELL, NEW MEXICO 88202-0310

4. Well Location
Unit Letter J : 2417 Feet From The SOUTH Line and 2245 Feet From The EAST Line
Section 36 Township 10 SOUTH Range 27 EAST NMPM CHAVES County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
3698' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

 
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPLETION <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: _____ <input type="checkbox"/>		OTHER: _____ <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work)
SEE RULE 1103 For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

INTEND TO PLUG AND ABANDON WELL AS FOLLOWS:

- (1) Move in and rig up, rig up steel pit, nipple up BOP, pull out of hole with tubing and packer.
- (2) Set CIBP @ 6550', dump 35' cement (3 sxs) on top.
- (3) Circulate 10# Mud, spot 25 sxs @ 4500'-4400'.
- (4) Pull 3500' of 5 1/2" casing.
- (5) Spot 45 sxs @ 3550'-3450' and tag.
- (6) Spot 45 sxs @ 1550'-1450' and tag.
- (7) Spot 35 sxs @ 350'-250'.
- (8) Spot 10 sxs @ 30'- Surface, Cut Off, Install Dry Hole Marker, Rig down and move out.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE PRESIDENT DATE 03/01/05
TYPE OR PRINT NAME JOSEPH J. KELLY TELEPHONE NO. 505-623-3190

(This space for State Use)

APPROVED BY  TITLE Field Inspector DATE 3/4/05
CONDITIONS OF APPROVAL, IF ANY: