Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

Operator Copy

FORM APPROVED OMB NO. 1004-0137

Expires: January 31, 2018

REC'D/MIDLAND

5.	Lease Serial No.
	NMLC061672B

SUNDRY Do not use thi	NMLC061672B							
abandoned wel	6. If Indian, Allottee or	Tribe Name						
SUBMIT IN T	7. If Unit or CA/Agreement, Name and/or No.							
Type of Well Oil Well	8. Well Name and No. POKER LAKE 52							
Name of Operator XTO PERMIAN OPERATING	9. API Well No. 30-015-24147-00-S1							
3a. Address 6401 HOLIDAY HILL ROAD B MIDLAND, TX 79707	3b. Phone No. Ph: 432-218			10. Field and Pool or E WILDCAT	xploratory Area			
4. Location of Well (Footage, Sec., T	., R., M., or Survey Description)			11. County or Parish, State			
Sec 33 T25S R31E NENW		EDDY COUNTY, NM						
12. CHECK THE AF	PPROPRIATE BOX(ES)	TO INDICAT	E NATURE O	F NOTICE,	REPORT, OR OTH	ER DATA		
TYPE OF SUBMISSION		TYPE OF ACTION						
	☐ Acidize	☐ Acidize ☐ Deepen		☐ Production (Start/Resume)		☐ Water Shut-Off		
☑ Notice of Intent	☐ Alter Casing	☐ Hydr	☐ Hydraulic Fracturing ☐ Reclama		ation	■ Well Integrity		
☐ Subsequent Report	☐ Casing Repair	■ New Construction		☐ Recomp	olete	☐ Other		
☐ Final Abandonment Notice	☐ Change Plans	🛮 Plug	and Abandon	☐ Tempor	rarily Abandon			
	Convert to Injection	☐ Plug	g Back		Disposal			
13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.								
XTO Operating LLC, Respectfully request NOI to PA the well above:								
MASIP MAOP MAWP Surface Csg Yield 2,000 psi 1,000 psi 5,000 psi 2,472 psi								
 MIRU plugging company. Set open top steel pit for plugging. ND WH and NU 5K manual BOP. Function test BOP. RU, RIH 2-3/8? workstring and tag top of 7-5/8? CIBP 13,660?. Notify BLM. (EOT 12,525?). POOH laying down 2-3/8? workstring, standing back 2-3/8? tubing. RU, RIH 2-3/8? tbg w/ 7-5/8? CIBP to 13,200?. Set CIBP and spot 80 sxs Class H cmt on top of bridge plug. WOC and Tag at least 12,780?. POOH w/tbg. MIRU WL, and RIH WL. Perf 7-5/8? csg at 12,550? and squeeze 90 sxs Class H cmt. WOC 								
Below ground level dry hole marker required.								
14. I hereby certify that the foregoing is	true and correct. Electronic Submission # For XTO PERM itted to AFMSS for proces:	517129 verified	by the BLM Wel	I Information	n System			
Name (Printed/T)/ped) CASSIE E		ATORY AN						
Traine() Time() Type() OAGGIE		THE TREE	7(10)(17)	7.12.7.0.1				
Signature (Electronic S	Date 06/01/2	020						
	THIS SPACE FO	OR FEDERA	L OR STATE	OFFICE U	SE			
Approved By	a. limas		Title 5%	MET		6.3-20 Date		
Conditions of approval, if any, are attache certify that the applicant holds legal or equivilent would entitle the applicant to condu-	uitable title to those rights in th	Office CF	0					

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.


Additional data for EC transaction #517129 that would not fit on the form

32. Additional remarks, continued

& Tag at least 12,100?. (9-5/8? Csg Shoe, T/Perfs, TOL)
7) PUH w/tbg to 11,515? and spot 50 sxs Class H cmt. WOC and Tag at least 11,3652. (T/Wolfcamp)
8) PUH w/tbg to 10,050? and spot 50 sxs Class H cmt. WOC and Tag at least 9,900?. (TOO)
9) POOH w/tbg. RU WL, and RIH WL. Perf 9-5/8? csg at 8,180? and squeeze 110 sxs Class H cmt. WOC & Tag at least 8,000?. (T/Bone Spring)
10) POOH w/tbg. RU WL, and RIH WL. Perf 9-5/8? csg at 4,460? and squeeze 400 sxs Class C cmt. WOC & Tag at least 3,850?. (T/Delaware, 13-3/8? Csg Shoe, B/Salt)
11) POOH w/tbg. RU WL, and RIH WL. Perf 9-5/8? csg at 1,260? and squeeze 370 sxs Class C cmt. WOC & Tag at least 690?. (T/Salt)
12) POOH w/tbg. RU WL, and RIH WL. Perf 9-5/8? csg at 60? and squeeze 70 sxs Class C cmt. WOC & confirm TOC at Surface.
13) ND BOP and cut off wellhead 5? below surface. RDMO PU, transport trucks, and pump truck.
14) Set P&A marker.

15) Pull fluid from steel tank and haul to disposal. Release steel tank.

Poker Lake Unit #052 - Current and Proposed WBD's

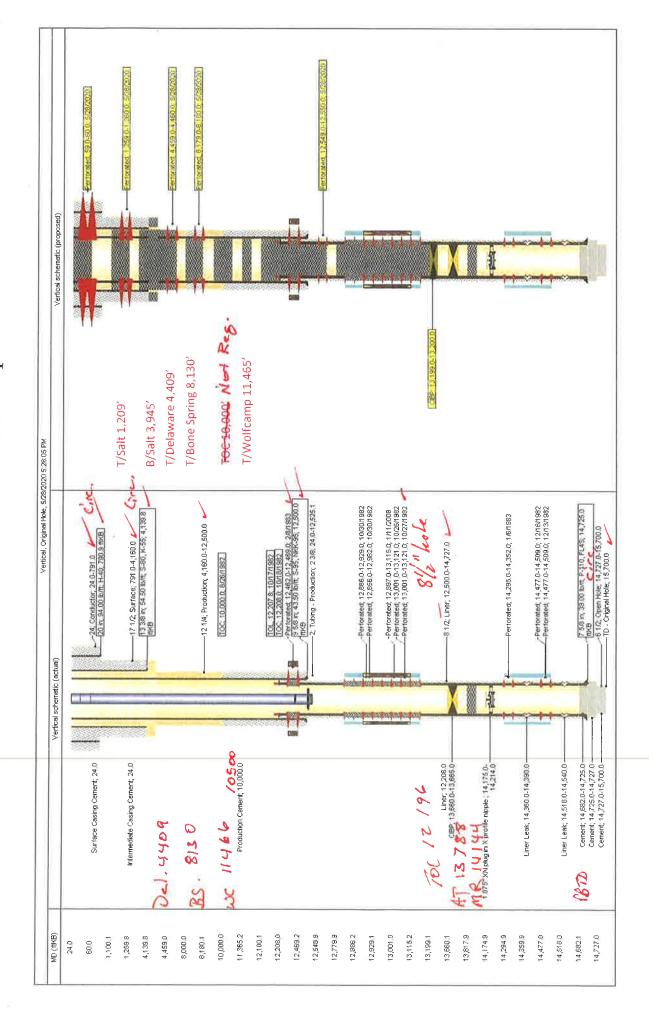

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:

From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted