
Submit 1 Copy To Appropriate District Office	State of New I	VIEXICO		Form C-103
<u>District I</u> 1625 N French Dr., Hobbs, NM 88240	Energy, Minerals and N	atural Resources	WELL API NO.	October 13, 2009
District II	OIL CONSEDUATIO	NI DIMETONI	30-005-6276	53
1301 W. Grand Ave , Artesia, NM 88210 District III	1220 South St. Francis Dr		5. Indicate Type of	
00 Rio Brazos Rd, Aztec, NM 87410  Santa Fe, NM 87505		STATE State Oil & Gas		
1220 S. St Francis Dr , Santa Fe, NM 87505			LG-7983	Lease IVO.
SUNDRY NOTICES (DO NOT USE THIS FORM FOR PROPOSALS	AND REPORTS ON WELL		7. Lease Name or	Unit Agreement Name
DIFFERENT RESERVOIR. USE "APPLICATION			Jan Sta	te
PROPOSALS)			8. Well Number	
1. Type of Well: Oil Well Gas Well Other		1		
2. Name of Operator  Armstrong Energy Corporation		9. OGRID Numbe 001092	r	
Armstrong Energy Corporation  3. Address of Operator		10. Pool name or V	Wildcat	
P.O. Box 1973, Roswell, NM 88202-1973		Foor Ranch		
4. Well Location	_			
	feet from the Sout			
Section 36	Township 8S . Elevation (Show whether Da	Range 26E		Chaves County
	. Dievation (Show whether Di	it, 1010, 101, 010,	./	4.
12. Check Appr	opriate Box to Indicate 1	Nature of Notice,	Report or Other I	Data
NOTICE OF INTENTION TO:		SUBSEQUEN	IT REPORT OF:	
	PLUG AND ABANDON	REMEDIAL WORK		ALTERING CASING 🔲
	CHANGE PLANS	COMMENCE DRIL	LLING OPNS. 🔲 🛚 F	P AND A
	MULTIPLE COMPL	L CASING/CEMENT		_
	WOETH EE COMM E	0.,0.,0.,0.	MONN OCU	24 has
PULL OR ALTER CASING   I	WOLTH LE GOWN L		TO GUY W	24 hrs. prior
DOWNHOLE COMMINGLE   OTHER:		OTHER:	Notify OCD To any wo	24 hrs. prior Drk done.
DOWNHOLE COMMINGLE	erations. (Clearly state all pe	ertinent details, and g	give pertinent dates, in	cluding estimated date
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce	erations. (Clearly state all pe E RULE 19.15.7.14 NMAC.	From Multiple Comp	oletions: Attach wellb	ore diagram of proposed
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  L. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4	erations. (Clearly state all pe E RULE 19.15.7.14 NMAC. ement on top of plug 000') 100' plug, 50 sx, 1/2 in	From Multiple Comp	oletions: Attach wellb	ore diagram of proposed
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m	erations. (Clearly state all pe E RULE 19.15.7.14 NMAC. ement on top of plug 000') 100' plug, 50 sx, 1/2 in ud	For Multiple Comp  1 – 1/2 out @ cut off	eletions: Attach wellb	RECEIVE
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  L. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4	erations. (Clearly state all per E RULE 19.15.7.14 NMAC. ement on top of plug 000') 100' plug, 50 sx, 1/2 ir ud olug, 100', 2275'-2375'. WOO	For Multiple Comp  1 – 1/2 out @ cut off	eletions: Attach wellb	ore diagram of proposed
OTHER:  OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p	erations. (Clearly state all perent on top of plug 000') 100' plug, 50 sx, 1/2 in ud lug, 100', 2275'-2375'. WOC lug 966'-1066'. WOC # hrs. blug 158'-258'.	For Multiple Comp  1 – 1/2 out @ cut off	eletions: Attach wellb	RECEIVE  APR 12 2012
DOWNHOLE COMMINGLE  OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  L. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s	erations. (Clearly state all pe E RULE 19.15.7.14 NMAC. ement on top of plug 000') 100' plug, 50 sx, 1/2 in ud olug, 100', 2275'-2375'. WOC olug 966'-1066'. WOC # hrs. olug 158'-258'. urface plug 60'-0'.	For Multiple Comp  1 – 1/2 out @ cut off	eletions: Attach wellb	RECEIVE  APR 12 2012
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dr 9. Cut off anchors and clean locat	erations. (Clearly state all per ERULE 19.15.7.14 NMAC. ement on top of plug 1000') 100' plug, 50 sx, 1/2 in udelug, 100', 2275'-2375'. WOO lug 966'-1066'. WOC hug 158'-258'. urface plug 60'-0'. y hole marker.	For Multiple Comp  1 – 1/2 out @ cut off  Hers. and tag plug.  and tag plug.	eletions: Attach wellb	RECEIVE  APR 12 2012
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dry 9. Cut off anchors and clean locat 10. Remove caliche and reseed roa	erations. (Clearly state all pe E RULE 19.15.7.14 NMAC. ement on top of plug 000') 100' plug, 50 sx, 1/2 in ud olug, 100', 2275'-2375'. WOC olug 966'-1066'. WOC# hrs. olug 158'-258'. urface plug 60'-0'. y hole marker. ion. d and location.	For Multiple Comp  1 - 1/2 out @ cut off  4 hrs. and tag plug.  Approval Granted pl	royiding work	RECEIVE  APR 12 2012
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dr 9. Cut off anchors and clean locat	erations. (Clearly state all pe E RULE 19.15.7.14 NMAC. ement on top of plug 000') 100' plug, 50 sx, 1/2 in ud olug, 100', 2275'-2375'. WOC olug 966'-1066'. WOC# hrs. olug 158'-258'. urface plug 60'-0'. y hole marker. ion. d and location.	For Multiple Comp  1 – 1/2 out @ cut off  Hers. and tag plug.  and tag plug.	royiding work	RECEIVE  APR 12 2012
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dry 9. Cut off anchors and clean locat 10. Remove caliche and reseed roa 11. Notify OCD for final inspection	erations. (Clearly state all per E RULE 19.15.7.14 NMAC. ement on top of plug 000') 100' plug, 50 sx, 1/2 in udelug, 100', 2275'-2375'. WOO lug 966'-1066'. WOC¶ hrs. lug 158'-258'. urface plug 60'-0'. whole marker. ition. d and location.	For Multiple Comp  1 – 1/2 out @ cut off  4 hrs. and tag plug.  Approval Granted plus is complete by	royiding work	RECEIVE
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dry 9. Cut off anchors and clean locat 10. Remove caliche and reseed roa 11. Notify OCD for final inspection	erations. (Clearly state all pe E RULE 19.15.7.14 NMAC. ement on top of plug 000') 100' plug, 50 sx, 1/2 in ud olug, 100', 2275'-2375'. WOC olug 966'-1066'. WOC# hrs. olug 158'-258'. urface plug 60'-0'. y hole marker. ion. d and location.	For Multiple Comp  1 – 1/2 out @ cut off  4 hrs. and tag plug.  Approval Granted plus is complete by	royiding work	RECEIVE  APR 1 2 2012
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dry 9. Cut off anchors and clean locat 10. Remove caliche and reseed roa 11. Notify OCD for final inspection SEE ATTACHED CONDITIONS OF	erations. (Clearly state all per E RULE 19.15.7.14 NMAC. ement on top of plug 000') 100' plug, 50 sx, 1/2 in udelug, 100', 2275'-2375'. WOO lug 966'-1066'. WOC¶ hrs. lug 158'-258'. urface plug 60'-0'. whole marker. ition. d and location.	For Multiple Comp  1 – 1/2 out @ cut off  4 hrs. and tag plug.  Approval Granted plus is complete by	royiding work	RECEIVE  APR 1 2 2012
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  2. L. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dry 9. Cut off anchors and clean locat 10. Remove caliche and reseed roa 11. Notify OCD for final inspection SEE ATTACHED CONDITIONS OF APPROVAL	erations. (Clearly state all per E RULE 19.15.7.14 NMAC. ement on top of plug 000') 100' plug, 50 sx, 1/2 in udelug, 100', 2275'-2375'. WOO lug 966'-1066'. WOC¶ hrs. lug 158'-258'. urface plug 60'-0'. whole marker. ition. d and location.	For Multiple Comp  n – 1/2 out @ cut off  Fhrs. and tag plug.  Approval Granted plus is complete by 2/2	roviding work	RECEIVEI  APR 12 2012
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  2. L. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dry 9. Cut off anchors and clean locat 10. Remove caliche and reseed roa 11. Notify OCD for final inspection SEE ATTACHED CONDITIONS OF APPROVAL	erations. (Clearly state all per E RULE 19.15.7.14 NMAC. ement on top of plug (000') 100' plug, 50 sx, 1/2 in ud (100', 2275'-2375'. WOO (100') 158'-258'. WOO (100') 158'-258'. Urface plug 60'-0'. Work (100') A hole marker. Sion. d and location. In the location of the l	For Multiple Comp  n – 1/2 out @ cut off  Fhrs. and tag plug.  Approval Granted plus is complete by 2/2	roviding work	RECEIVE  APR 1 2 2012  NMOCD ARTES
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement p 8. Cut off wellhead and install dry 9. Cut off anchors and clean locat 10. Remove caliche and reseed roa 11. Notify OCD for final inspection SEE ATTACHED CONDITIONS OF APPROVAL	erations. (Clearly state all per ERULE 19.15.7.14 NMAC. ement on top of plug 1000') 100' plug, 50 sx, 1/2 in udelug, 100', 2275'-2375'. WOO lug 966'-1066'. WOC hrs. lug 158'-258'. urface plug 60'-0'. whole marker. sion. d and location. In Rig Release I was and complete to the Land Land Land Land Land Land Land Land	For Multiple Comp  1 – 1/2 out @ cut off  2 hrs. and tag plugand t	roviding work  17 2012  ge and belief.  DATE	RECEIVE  APR 12 2012  NMOCD ARTES
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dr 9. Cut off anchors and clean locat 10. Remove caliche and reseed roa 11. Notify OCD for final inspection  SEE ATTACHED CONDITIONS OF APPROVAL  SIGNATURE Bruce A. Stubbs	erations. (Clearly state all per ERULE 19.15.7.14 NMAC. ement on top of plug 1000') 100' plug, 50 sx, 1/2 in udelug, 100', 2275'-2375'. WOO lug 966'-1066'. WOC hrs. lug 158'-258'. urface plug 60'-0'. whole marker. sion. d and location. In Rig Release I was and complete to the Land Land Land Land Land Land Land Land	For Multiple Comp  1 – 1/2 out @ cut off  2 hrs. and tag plugand t	roviding work  17 2012  ge and belief.  DATE	RECEIVE  APR 12 2012  NMOCD ARTES
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dr 9. Cut off anchors and clean locat 10. Remove caliche and reseed roa 11. Notify OCD for final inspection  SEE ATTACHED CONDITIONS OF APPROVAL  SIGNATURE  SIGNATURE  Bruce A. Stubbs	erations. (Clearly state all per E RULE 19.15.7.14 NMAC.  ement on top of plug (100°) 100° plug, 50 sx, 1/2 in und (100°) 2275°-2375°. WOO (100°) 966°-1066°. WOC¶ hrs. (100°)	For Multiple Comp  1 – 1/2 out @ cut off  2 hrs. and tag plugand t	roviding work  ge and belief.  DATE	RECEIVE  APR 1 2 2012  NMOCD ARTES  E 04/10/2012  NE: (575) 625-2222
OTHER:  13. Describe proposed or completed op of starting any proposed work). SE completion or recompletion.  1. Set CIBP @ 5275' w/ 35' of ce 2. Cut casing @ 3900' (TOC @ 4 3. Circ hole w/ 9.5 PPG, 35 vis m 4. Spot 50 sx. Class "C" cement p 5. Spot 50 sx. Class "C" cement p 6. Spot 25 sx. Class "C" cement p 7. Spot 20 sx. Class "C" cement s 8. Cut off wellhead and install dr 9. Cut off anchors and clean locat 10. Remove caliche and reseed roa 11. Notify OCD for final inspection  SEE ATTACHED CONDITIONS OF APPROVAL  SIGNATURE Bruce A. Stubbs	erations. (Clearly state all per ERULE 19.15.7.14 NMAC. ement on top of plug 1000') 100' plug, 50 sx, 1/2 in udelug, 100', 2275'-2375'. WOO lug 966'-1066'. WOC hrs. lug 158'-258'. urface plug 60'-0'. whole marker. sion. d and location. In Rig Release I was and complete to the Land Land Land Land Land Land Land Land	For Multiple Comp  1 – 1/2 out @ cut off  2 hrs. and tag plugand t	roviding work  17 2012  ge and belief.  DATE	RECEIVE  APR 1 2 2012  NMOCD ARTES  E 04/10/2012  NE: (575) 625-2222

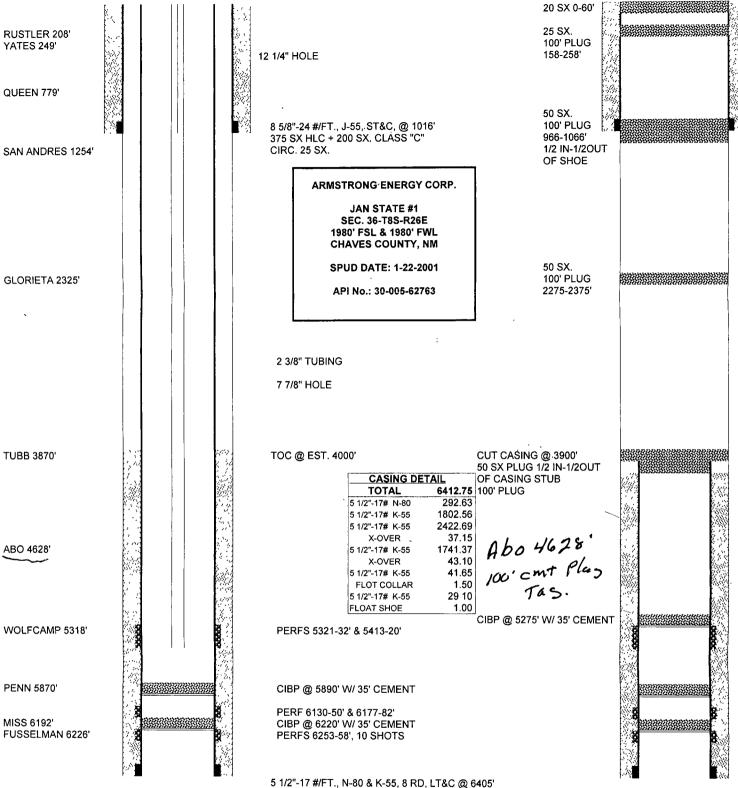

5 1/2 - 17 #/F1., N-80 & K-55, 8 RD, LT&C @ 6405' 400 SX 35/65 POZMIX W/ 2% GEL,, .3% HALAD-4, .2% CFR-2, 5 #/SX SALT TOC @ EST. 4000'

## NEW MEXICO OIL CONSERVATION DIVISION DISTRICT 2 OFFICE 811 S. FIRST STREET ARTESIA, NM 88210 (575)748-1283

## CONDITIONS OF APPROVAL FOR PLUGGING & ABANDONMENT

Operator: Armstrong Energy Cup.	
Well Name & Number: Jan 5747e	
API#: 30-005-62763	

- 1. Produced water <u>will not</u> be used during any part of the plugging & abandonment operation.
- 2. Notify NMOCD Dist. 2 office at least 24 hrs before beginning work.
- 3. Closed Loop System is to be used for entire plugging operation. Upon completion, contents of steel pit are to be hauled to a permitted disposal location.
- 4. Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator, as well as the contractor, to verify that this permit is place prior to performing work. Drivers shall produce a copy upon request of NMOCD Field Inspectors.
- 5. A subsequent C-103 will serve as notification that the well bore has been plugged ONLY. A C-103 FINAL shall be filed before any bonding can be released on the well. Upon receipt of the Final, an inspection will be performed to verify that the location has been satisfactorily cleaned to NMOCD standards.
- 6. If work has not begun within 90 days of the approval of this procedure, an extension request must be filed, stating reason that well has not been plugged.
- 7. Every attempt must be made to clean the well bore out to below the perfs, before any plugs can be set, by whatever means possible.

8. Cement Retainers may not be used.

9. Squeeze pressures not to exceed 500 psi., unless approval is given by NMOCD Plugging Supervisor.

10. Plugs may be combined after consulting with NMOCD P & A Supervisor.

11. Minimum WOC time for tag plugs will be 4 hrs.

DG

Date: 4//7/20/2



500 North Main Street, Suite 200 P.O. Box 1973 Roswell, New Mexico 88202-1973 (575) 625-2222 Fax (575) 622-2512

RECEIVED

APR 12 2012

NMOCD ARTESIA

April 10, 2012

Oil Conservation Division 1301 W. Grand Avenue Artesia, New Mexico 88210

Re: LG-7983

Jan State #1

Township 8 South, Range 26 East, NMPM

Section 36

Chaves County, New Mexico

Dear Sir/Madam:

Enclosed are the Sundry Notices and Reports on Wells, Notice of Intent, Plug and Abandon, for the Jan State #1 to be filed with your office.

If you have any questions, please contact Bruce Stubbs at 505-625-2222.

Sincerely,

ARMSTRONG ENERGY CORPORATION

Irma Cunningham, Geo Tech

Enclosure

the first of the second second

region to the first particular in the control of the first process of the control of the control