Form 3160-5 (April 3004)

Approved by

UNITED STATES OF ON ONE OF ORDER OF STATES OF ORDER O

Accepted for record

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals. SUBMIT IN TRIPLICATE - Other instructions on reverse side 1. Type of Well		SUNDRY NOTICES	AND REPORTS	ovAweesa. N//	88210	NM 01159	,	
Dippe of Well Gas Well Other SEP 2 8 2005 See 2 1005 See 2		Do not use this form for	proposals to drill (or to re-enter an		6. If Indian, Al	lottee or Tribe Name	
X Oil Well Gas Well Other SEP 2 8 7005 SOLY 4 Name and No. Holly 4 Feed Com. 1	SUBMIT IN TRIPLICATE - Other instructions on reverse side						7. If Unit or CA/Agreement, Name and/or No.	
X Oil Well Gas Well Other SEP 2 8 7005 SOLY 4 Name and No. Holly 4 Feed Com. 1	Type of Well		· · · · · · · · · · · · · · · · · · ·	REC	EIVEN			
Notes of Interest Check APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION Acides Deepen Production (Star/Resume) Water Shat-Off Red and provided or completed Operation (clearly state all perticular data) Deep the proposed or Completed Operation (clearly state all perticular) Plug and Abandon and Treporately Abandone Well integrity Attempted of the proposal is to despen directionally or recomplete horizontally, give subsurface (scations and measured and true vertical depths of all the field or determined that the final site is ready for final inspection. Shall be fined only sheet all reprimenents, such days Attempted to pull		Gas Well Other				I .		
3a. Address 3b. Phone No. (include area code) 30-015-24245		T		SEP :	2 /9 2005	Holly 4 Fe	d Com 1	
3a. Address 3b. Phone No. (include area code) 30-015-24245	EOG Resourc	es Inc.	USHIMBTERIA			9. API Well No.		
P.O. Rook 2267 Michaerd, Tessas 79702 1. Decation of Well Floodings, Sec. T. R. M. or Survey Description) 1980' FWIL & 660' FSIL Sec 4, T18S, R30E 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION 12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION 13. Notice of latent 14. Aber Casing 15. Subsequent Report 15. Change Plats 15. Subsequent Report 16. Change Plats 17. Production (Stat/Resume) 17. Temporatily Abandon 18. Subsequent Report 19. Subsequent Report Subsequent Reports subsequent Reports subsequent Reports shall be filed once with BILMBIA Required subsequent reports shall be filed once with BILMBIA Required subsequent reports shall be filed once with BILMBIA Required subsequent reports shall be filed once with BILMBIA Required subsequent reports shall be filed once with BILMBIA Required subsequent reports shall be filed once with BILMBIA Required subsequent reports shall be filed once with BILMBIA Required subsequent reports shall be filed once	3a. Address							
11. County or Parish, State Saddy Nin								
12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intern	4. Location of Well (Footage, Sec., T., R., M., or Survey Description)					Undesignated		
12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION Acidiz	1980' FWL &	660' FSL				<u> </u>		
12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Notice of Intern	Sec 4, T18S	, R30E						
TYPE OF SUBMISSION TYPE OF ACTION Notice of Intent								
Notice of Intent	12.	CHECK APPROPRIATE	BOX(ES) TO IND	DICATE NATURE OF I	NOTICE, REP	ORT, OR OTI	HER DATA	
Alter Casing Fracture Treat Reclamation Well Integrity	TYPE	E OF SUBMISSION		TYPE OF ACTION				
Alter Casing Fracture Treat Reclamation Well Integrity		Notice of Intent	Acidize	Deepen	Production	n (Start/Resume)	Water Shut-Off	
Casing Repair New Construction Recomplete Other			Alter Casing	Fracture Treat	Reclamati	on	Well Integrity	
Final Abandonment Notice	X Subsequent Report				H		=	
3. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be file within 30 days of the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed once testing has been completed or the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a form 3160-4 shall be filed oncy after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.) 4/06/05 MIRU 4/07/05 MIRU 4/07/05 Attempted to pull stuck tubing and packer @ 10408'. Notified BIM; Jim Amos approved cutting the tubing @ 10200'. Out & POOH w/ 329 jts 2 3/8" tubing. 4/08/05 RIH and set CIBP @ 10200'. Out & POOH w/ 329 jts 2 3/8" tubing. Spot 30 sx Class H plug from 6852' to 6448'. 4/11/05 Dan Cleghorm w/ BIM on location to witness cementing. Spot 30 sx Class H plug from 6852' to 6448'. 4/12/05 Tag cement @ 6355'. 4/15/05 Out 5 1/2" casing @ 5400'. POOH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4473'. 4/15/05 Tag cement @ 4964'. Gene Hunt w/ BIM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PPID 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. Title Name (PrintedTyped) Regulat					<u> </u>			
3. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final size is ready for final inspection.) 4/06/05 MIRU 4/07/05 Attempted to pull stuck tuibing and packer @ 10408'. Notified BIM; Jim Amos approved cutting the tuibing @ 10200'. Cut & FOCH w/ 329 jts 2 3/8" tuibing. 4/08/05 RIH and set CIBP @ 10200'. 4/11/05 Dan Cleghorn w/ BIM on location to witness cementing. Spot 30 sx Class H plug from 10200' to 9965'. Spot 30 sx Class H plug from 8464' to 8221'. Spot 50 sx Class H plug from 6852' to 6448'. 4/12/05 Tag cement @ 6355'. 4/15/05 Cut 5 1/2" casing @ 5400'. FOCH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Gene Hamt w/ BIM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PETD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request Ta approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (PrintedTyped) Regulatory Analyst Date 9/21/05	Final Abandonment Notice		Change Plans	Plug and Abandon	X Temporar	ily Abandon		
If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and trué vertical depths of all pertinent markers and zone. Attach the Bond under which the work will be performed or provide the Bond No. on file will BM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the final site is ready for final inspection.) 4/06/05 MIRU 4/07/05 Attempted to pull stuck tubing and packer @ 10408'. Notified BIM; Jim Amos approved cutting the tubing @ 10200'. Out & POOH w/ 329 jts 2 3/8" tubing. 4/08/05 RIH and set CIBP @ 10200'. 4/11/05 Dan Cleghorn w/ BIM on location to witness cementing. Spot 30 sx Class H plug from 10200' to 9965'. Spot 30 sx Class H plug from 8464' to 8221'. Spot 50 sx Class H plug from 6852' to 6448'. 4/12/05 Tag cement @ 6355'. 4/15/05 Cut 5 1/2" casing @ 5400'. POOH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Gene Hunt w/ BIM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (PrintedTyped) Stan Wagner Date 9/21/05			Convert to Injection	on Plug Back	Water Dis	posal		
4/07/05 Attempted to pull stuck tubing and packer @ 10408'. Notified BIM; Jim Amos approved cutting the tubing @ 10200'. Cut & POCH w/ 329 jts 2 3/8" tubing. 4/08/05 RIH and set CIBP @ 10200'. 4/11/05 Dan Cleghorn w/ BIM on location to witness cementing. Spot 30 sx Class H plug from 10200' to 9965'. Spot 30 sx Class H plug from 8464' to 8221'. Spot 50 sx Class H plug from 6852' to 6448'. 4/12/05 Tag cement @ 6355'. 4/15/05 Cut 5 1/2" casing @ 5400'. POCH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Geme Hunt w/ BIM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. Thereby certify that the foregoing is true and correct Name (PrintedTyped) Stan Wagner Date 9/21/05	Attach the Bo following con testing has be	ond under which the work will be per appletion of the involved operations. It is completed. Final Abandonment I	formed or provide the f the operation results i votices shall be filed on	Bond No. on file with BLM. n a multiple completion or re	BIA. Required : ecompletion in a	subsequent report new interval, a Fe	ts shall be filed within 30 days orm 3160-4 shall be filed once	
the tubing @ 10200'. Cut & POOH w/ 329 jts 2 3/8" tubing. 4/08/05 RIH and set CIBP @ 10200'. 4/11/05 Dan Cleghorn w/ BLM on location to witness cementing. Spot 30 sx Class H plug from 10200' to 9965'. Spot 30 sx Class H plug from 8464' to 8221'. Spot 50 sx Class H plug from 6852' to 6448'. 4/12/05 Tag cement @ 6355'. 4/15/05 Cut 5 1/2" casing @ 5400'. POOH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Gene Hunt w/ BLM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (PrintedTyped) State Wagner Date 9/21/05	4/06/05							
4/08/05 RIH and set CIBP @ 10200'. 4/11/05 Dan Cleghorn w/ BIM on location to witness cementing. Spot 30 sx Class H plug from 10200' to 9965'. Spot 30 sx Class H plug from 8464' to 8221'. Spot 50 sx Class H plug from 6852' to 6448'. 4/12/05 Tag cement @ 6355'. 4/15/05 Cut 5 1/2" casing @ 5400'. POCH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Gene Hunt w/ BIM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (PrintedTyped) Stam Wagner Date 9/21/05	4/07/05	Attempted to pull stuck tubing and packer @ 10408'. Notified BIM; Jim Amos approved cutting						
4/11/05 Dan Cleghorn w/ BLM on location to witness cementing. Spot 30 sx Class H plug from 10200' to 9965'. Spot 30 sx Class H plug from 8464' to 8221'. Spot 50 sx Class H plug from 6852' to 6448'. 4/12/05 Tag cement @ 6355'. 4/15/05 Cut 5 1/2" casing @ 5400'. POCH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Gene Hunt w/ BLM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PEND 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (Printed/Typed) Stam Wagner Date 9/21/05				jts 2 3/8" tubing	•			
Spot 30 sx Class H plug from 10200' to 9965'. Spot 30 sx Class H plug from 8464' to 8221'. Spot 50 sx Class H plug from 6852' to 6448'. 4/12/05 Tag cement @ 6355'. 4/15/05 Cut 5 1/2" casing @ 5400'. POOH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Gene Hunt w/ BIM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (Printed/Typed) Stan Wagner Date 9/21/05								
Spot 50 sx Class H plug from 6852' to 6448'. 4/12/05 Tag cement @ 6355'. 4/15/05 Cut 5 1/2" casing @ 5400'. POCH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Gene Hunt w/ BLM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. Thereby certify that the foregoing is true and correct Name (PrintedTyped) Stan Wagner Date 9/21/05	4/11/05	· · · · · · · · · · · · · · · · · · ·						
4/12/05 Tag cement @ 6355'. 4/15/05 Cut 5 1/2" casing @ 5400'. POOH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Geme Hunt w/ BIM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBID 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (PrintedTyped) Stam Wagner Date 9/21/05								
4/15/05 Cut 5 1/2" casing @ 5400'. POOH w/ 5 1/2" casing. 4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Gene Hunt w/ BIM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (PrintedTyped) State Wagner Date 9/21/05								
4/14/05 Spot 140 sx Class c plug from 5456' to 4873'. 4/15/05 Tag cement @ 4964'. Gene Hunt w/ BLM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. Title Name (Printed Typed) Stan Wagner Date 9/21/05		-						
4/15/05 Tag cement @ 4964'. Gene Hunt w/ BIM on location to witness tagging of cement and casing integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (PrintedTyped) Stan Wagner Date 9/21/05								
integrity test. Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request 'TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (Printed/Typed) Stam Wagner Regulatory Analyst Date 9/21/05								
Spot 50 sx Class C plug from 4616' to 4495'. Tag cement @ 4383'. Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (Printed/Typed) Stam Wagner Regulatory Analyst Date 9/21/05	4, 13, 03							
Set 8 5/8" CIBP @ 3223'. Dumped 35' cement on CIBP. PBTD 3188'. Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (PrintedTyped) Stan Wagner Date 9/21/05								
Ran casing integrity test to 500 psi for 30 min. Test good. *Request TA approval. Holding wellbore for possible horizontal Bone Spring potential. 14. I hereby certify that the foregoing is true and correct Name (PrintedTyped) State Wagner Date 9/21/05								
14. I hereby certify that the foregoing is true and correct Name (Printed/Typed) Stam Wagner Regulatory Analyst Date 9/21/05								
Name (Printed/Typed) State Wagner Regulatory Analyst Date 9/21/05	*Request	TA approval. Holding w	ellbore for pos	sible horizontal Bo	one Spring p	potential.		
State Wagner Regulatory Analyst Date 9/21/05				Title				
Man Wagn Date 9/21/05		,		Remile	tory Analso	+		
1000 W 7/1	211 1							
	the	i Wagn		Date 9/21/05				
THIS SPACE FOR FEDERAL OR STATE OFFICE USE		/ / THIS	SPACE FOR FED	ERAL OR STATE OF	ICE USE	10	REALITI DEDIAN	

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Title 18 U.S.C. Section 1001, and Title 43 U.S.C. Section 1212, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Office END

