

**JUN 16 2016**

FORM APPROVED  
OMB NO. 1004-0135  
Expires: July 31, 2010

**SUNDRY NOTICES AND REPORTS ON WELLS**  
*Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals.*

5. Lease Serial No.  
**NMNM53219**

6. If Indian, Allottee or Tribe Name

7. If Unit or CA/Agreement, Name and/or No.

8. Well Name and No.  
**MCKITTRICK 11 FEDERAL 4**

9. API Well No.  
**30-015-33168**

10. Field and Pool, or Exploratory  
**INDIAN BASIN UP PENN**

11. County or Parish, and State  
**EDDY COUNTY, NM**

**SUBMIT IN TRIPLICATE - Other instructions on reverse side.**

1. Type of Well  
 Oil Well  Gas Well  Other

2. Name of Operator  
**OXY USA WTP LP** Contact: **DAVID STEWART**  
E-Mail: **david\_stewart@oxy.com**

3a. Address  
**P.O. BOX 50250  
MIDLAND, TX 79710**

3b. Phone No. (include area code)  
Ph: **432-685-5717**  
Fx: **432-685-5742**

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)  
**Sec 2 T22S R24E SWSW 510FSL 740FWL  
32.399601 N Lat, 104.475266 W Lon**

**12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA**

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.)

 
5/10-23/2016 MIRU PU, NDWH, NU BOP. RIH w/ bit & drill collars, tag solid @ 4206', POOH. RIH w/ impression blk, tag up @ 4206', POOH, parted csg. Start to RIH w/ tbg. RUWL, RIH w/ downhole view to 4300', no view due to water influx, attempt several depths. RIH w/ pkr & attempt to set 3628', would not set, PUH to 2592', pkr got stuck. Work stuck pkr @ 2559', it would go down but not up. Run pkr to 4212', RIH w/ chem cutter, cut tbg @ 4200', POOH w/ tbg, RIH w/ mills, dc, RIH & tag up @ 2461', RU pwr swivel, dress out bad spots @ 2461' & 2591', RD PS, POOH w/ tbg & BHA. RIH w/ mills, tag up @ 3658', RU PS dress out csg @ 3658', RD PS, POOH. RIH to 3658', RU PS, dress out csg, RIH to 3721', Tag up possible TOF, RD PS, POOH. RIH w/ mill, tag up @ 3013', RU PS, mill @ 3013', RD PS, RIH to 3661'. Mill bad spot @ 3661', RIH w/ BHA to 4209', RD PS, POOH. RIH w/ overshot & tag TOF @ 4209', POOH. RU WL, run inspection log @ 2400' to surf, ran log for temp svy, inaccurate due to dry wb, contact BLM.  
5/24/2016 Contact & rec approval from Jim Amos-BLM to start pumping cmt @ 4200', POOH w/ BHA,

**Accepted for record  
N/M/O/C/D**

14. I hereby certify that the foregoing is true and correct.

**Electronic Submission #341807 verified by the BLM Well Information System  
For OXY USA WTP LP sent to the Carlsbad**

Name (Printed/Typed) **DAVID STEWART** Title **SR. REGULATORY ADVISOR**

Signature  (Electronic Submission) Date **06/13/2016**

**THIS SPACE FOR FEDERAL OR STATE OFFICE**

**Pending BLM approvals will  
subsequently be reviewed  
and scanned**

Approved By \_\_\_\_\_ Title \_\_\_\_\_

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Office \_\_\_\_\_

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

## Additional data for EC transaction #341807 that would not fit on the form

### 32. Additional remarks, continued

reverse ut and fishing tools. RIH w/ tbg & tag @ 4200'.

5/25/2016 M&P 400sx CL C cmt w/ 2% CaCl<sub>2</sub> + 1#/sx cellophane followed by 400sx CL C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC. RIH w/ tbg to 4200', no tag.

5/26/2016 Rec BLM approval to pump add'l cmt, M&P 300sx CL C cmt w/ CaCl<sub>2</sub>, PUH, WOC. RIH to 4200', no tag, M&P 300sx CI C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC, RIH & tag cmt @ 4163'.

5/27/2016 Start to pump & clear tbg, plugged, POOH, LD 2 plugged jts, RIH to 4163', M&P 300sx CL C cmt w/ CaCl<sub>2</sub>, PUH, WOC. RIH & tag cmt @ 4098', M&P 300sx CI C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC.

5/31/2016 RIH & tag cmt @ 4066', M&P 300sx CL C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC. RIH, no tag, M&P 400sx CI C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC.

6/1/2016 RIH & tag cmt up @ 4066', M&P 400sx CL C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC. RIH & tag @ 4066', M&P 400sx CL C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC.

6/2/2016 RIH & tag @ 4066', POOH. Contact Chris Walls-BLM, rec appr to dump pea gravel. Dump 50-5gal buckets of 3/8" pea gravel. RIH & tag @ 4000', M&P 400sx CL C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC.

6/6/2016 RIH & tag cmt @ 3028', M&P 85sx CL C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC. RIH & tag cmt @ 2948', M&P 85sx CL C cmt w/ CaCl<sub>2</sub>, PUH, WOC.

6/7/2016 RIH & tag cmt @ 2883', M&P 85sx CL C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC. RIH & tag cmt @ 2640', M&P 30sx CL C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC. RIH & tag cmt @ 2511', POOH.

6/8/2016 ND BOP, NDWH, spear 7" csg, RU csg tool, POOH w/ 61jts 7" csg.

6/9/2016 RIH w/ WL, run temp svy @ 2460', POOH. RIH w/ tbg & tag @ 2511', M&P 100sx CL C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC. RIH & tag cmt @ 2317', notified Chris Walls-BLM, M&P 300sx CI C cmt w/ 2% CaCl<sub>2</sub>, PUH, WOC.

6/10/2016 RIH & tag cmt @ 907', M&P 335sx CL C cmt, circ cmt to surf, POOH w/ tbg. ND BOP, top off csg, RDPU.