

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals & Natural Resources Department

Form C-103  
Revised 1-1-89

**DISTRICT I**

P. O. Box 1980 Hobbs, NM 88240

**DISTRICT II**

P. O. Drawer DD Artesia, NM 88210

**DISTRICT III**

1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**

P. O. Box 2088  
Santa Fe, NM 87504-2088

WELL API NO.

30-015-05173

5. Indicate Type of Lease

STATE ☒

FEE ☐

6. State Oil & Gas Lease No.

B-2613

**SUNDRY NOTICES AND REPORTS ON WELLS**

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT"  
(FORM C-101) FOR SUCH PROPOSALS.)

7. Lease Name or Unit Agreement Name

State "B"

1 Type of Well:

OIL

WELL ☒

GAS

WELL ☐

OTHER

2. Name of Operator

The Wiser Oil Company

8. Well No.

4

3. Address of Operator

P.O. Box 2568 Hobbs, New Mexico 88241 (505) 392-9797

9. Pool name or Wildcat

Grayburg Jackson SR-QN-GB-SA

4. Well Location

Unit Letter I : 1650 Feet From The South Line and 660 Feet From The East Line

Section 16 Township 17S Range 31E NMPM Eddy County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3859' GL

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

**NOTICE OF INTENTION TO**

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

CASING TEST AND CEMENT JOB ☐

OTHER: Clean out, log & acidize ☒

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3/17/03 MIRU Eunice Well Service. POH w/rods & pump. ND WH. RU BOP. POH w/2-3/8" tbg. LD BHA. RIH w/4-3/4" mill tooth bit, bit sub & DC's on 2-3/8" tbg. Tag fill @ 3440'. Drill to 3460'. Tag fish. Drill to 3488'. Circulate hole clean. Pull to 3000'.

3/18/03 POH w/tbg. & DC's. LD bit. RIH w/4-3/4" cone buster mill bit sub & DC's on 2-3/8" tbg. Tag @ 3460'. Drill on fish f/3488'-3502'. Tbg. parted. POH w/2-3/8" tbg. Left in hole: 12 jts. 2-3/8" tbg., 6 3-1/2" DC's, bit sub & 4-3/4" mill. RIH w/3-11/32" wide mouth overshot & 2-3/8" tbg. Tag top of fish @ 3120'. POH w/2-3/8" tbg. LD overshot. Recovered all of fish.

3/19/03 RIH w/4-3/4" new cone buster mill bit, bit sub & 6 3-1/2" DC's on 2-3/8" tbg. Tag fill @ 3668'. Drill to 3692'. Mill worn out. POH w/tbg., DC's & mill. RIH w/4-1/2" cutrite shoe, 1 jt. 4-1/2" wash pipe, 6 3-1/2" DC's on 2-3/8" tbg. Left swinging @ 2980'.

3/20/03 Continue in hole w/4-1/2" shoe. Tag @ 3685'. Wash to 3691'. Circulate hole clean. POH w/2-3/8" tbg. & DC's. LD wash pipe & shoe. Rec'd. 15' section of 2-3/8" tbg. in shoe. LD tools & DC's. RU Baker Atlas WL. RIH w/logging tools. Tag bottom @ 3690'. Log f/3683'-800'. RD WL.

3/21/03 RIH w/tbg. to 3675'. SN @ 3671'. Spot 220 gals. scale converter mixed w/25 bbls. produced water across open hole 3184'-3712'. RIH w/rods & PR.

3/24/03 POH w/rods. Circulate hole clean w/50 bbls. produced water. RU Cudd Pressure Service. Pickle tbg. w/200 gals. 15% HCL acid. Acidize Grayburg open hole 3184'-3712' w/1000 gals. 15% HCL acid w/anti-sludge & iron control. No block. ATP 1200# @ 2.0 bpm. MTP 1300# @ 2.5 bpm. ISIP 900#. 5 min. 720#. 10 min. 630#. 15 min. 575#. 1 hr. 375#. Circulate hole clean w/40 bbls. produced water. RIH w/rods & 1-1/2" x 10' pump. Left well pumping to State AB Battery. RDMO.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Mary Jo Turner TITLE Production Tech II DATE May 13, 2003

TYPE OR PRINT NAME Mary Jo Turner

(This space for State Use)

APPROVED BY

Accepted for record TITLE \_\_\_\_\_ DATE JUL 02 2003

CONDITIONS OF APPROVAL, IF ANY: