

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.O.S.	
LAND OFFICE	
OPERATOR	☒

OIL CONSERVATION DIVISION
P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-7

30-015-22543

5a. Indicate Type of Lease
State ☒ Fee ☐
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL ☒ GAS ☐ OTHER ☐ WELL WELL	7. Unit Agreement Name
2. Name of Operator Amoco Production Company	8. Farm or Lease Name Empire South Deep Unit
3. Address of Operator P. O. Box 68 Hobbs, NM 88240	9. Well No. 19
4. Location of Well UNIT LETTER <u>H</u> <u>2280</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>East</u> LINE, SECTION <u>36</u> TOWNSHIP <u>17-S</u> RANGE <u>28-E</u> NMPM.	10. Field and Pool, or Wildcat <u>Empire South Wolfcamp</u>
15. Elevation (Show whether DF, RT, GR, etc.) 3692.9 RDB	12. County Eddy

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOB ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1503.

MI-RUSU 11-26-86. POH w/production equip. RIH by wireline CIBP. Set at 7690 ft. RIH tubing. Test CIBP to 500#. OK. Circulate hole clean 170 bbls 10# brine water w/25# gel/bbl. Cap CIBP w/35 ft Class H neat cement. Pull to 6530 and spot 25 sacks cement (Class H neat) plug to 6340'. Pull up to 5495' and spot 25 sacks Class H cement plug to 5295'. Pull tubing. RIH w/3-1/8" casing gun and perf 3007' to 3006' 4 JSPF. RIH w/cement retainer and set at 2855. Establish inj rate 2-1/2 BPM at 300#. Pump 600 sx Class H cement and circulate 35 sacks cement. Sting out of retainer and dump cement on top of retainer. PU. Spot 25 sx Class H cement to 489-289. PU and spot 10 sx Class H cement plug 80 ft to surface. Dig out cellar. Cut off wellhead. Weld on PxA marker. Fill in cellar. RD-MOSU 12-3-86.

Post ID-2
12-26-86
P4A

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Steve Brownlee TITLE Admin. Analyst DATE 12-9-86

APPROVED BY Danell Mance TITLE Analyst DATE 6/2/87

CONDITIONS OF APPROVAL, IF ANY: