Office	Form C-103
Office District I – (575) 393-6161 Energy, Minerals and Natural Resources 1625 N. French Dr., Hobbs, NM 88240 115 011 CONSERVATION District II. (575) 748-1283	Revised July 18, 2013 WELL API NO.
District II = (373) 740-1203	30-015-39065
District III - (505) 334-6178	5. Indicate Type of Lease STATE X FEE
1000 Rio Brazos Rd., Aztec, NM 87410 <u>District IV</u> – (505) 476-3460 Santa Fe, NM 87505	6. State Oil & Gas Lease No.
1220 S. St. Francis Dr., Santa Fe, NM RECEIVED 87505	309164
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A	7. Lease Name or Unit Agreement Name
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH	Empire Abo Unit
PROPOSALS.) 1. Type of Well: Oil Well X Gas Well Other	8. Well Number 405
2. Name of Operator	9. OGRID Number
Apache Corporation 3. Address of Operator	10. Pool name or Wildcat
303 Veterans Airpark Lane, Ste. 3000, Midland, TX 79705	Empire; Abo 224040
4. Well Location	
Unit Letter B : 1210 feet from the N line and	2500 feet from the E line
Section 33 Township 17S Range 28E 11. Elevation (Show whether DR, RKB, RT, GR, e	NMPM County Eddy
3673' GR	A CONTRACTOR OF THE PROPERTY O
10 Clark Annual Development of New York	Post of an Other Date
12. Check Appropriate Box to Indicate Nature of Notic	e, Report or Other Data
	JBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK PLUG AND ABANDON REMEDIAL WORK TEMPORARILY ABANDON CHANGE PLANS COMMENCE I	ORK ☐ ALTERING CASING ☐ DRILLING OPNS.☐ P AND A 🛛
TEMPORARILY ABANDON	_
DOWNHOLE COMMINGLE	
CLOSED-LOOP SYSTEM	_
OTHER: OTHER:	
OTHER: OTHER: OTHER: OTHER:	and give pertinent dates, including estimated date.
OTHER: OTHER:	and give pertinent dates, including estimated date. Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion.	and give pertinent dates, including estimated date. Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 mac put. 2. 10/09/19 Spot 25 sx class "c" cmt @ 5750' w/disp @ 5500'. Tag TOC @ 5418'.	Completions: Attach wellbore diagram of
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple oproposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 mac and completed of the proposed completion of the proposed completion or recompletion. 2. 10/09/19 Spot 25 sx class "c" cmt @ 5750' w/disp @ 5500'. Tag TOC @ 5418'. 3. 10/10/19 Perforate @ 4164'. Squeeze 70 sx class "c" cmt @ 4164' w/disp @ 38	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'.
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple oproposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 mic Put. 2. 10/09/19 Spot 25 sx class "c" cmt @ 5750' w/disp @ 5500'. Tag TOC @ 5418'. 3. 10/10/19 Perforate @ 4164'. Squeeze 70 sx class "c" cmt @ 4164' w/disp @ 384. 10/11/19 Spot 30 sx class "c" cmt @ 3546' w/disp @ 3246'. Tag TOC @ 3339'.	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'.
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple oproposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 mac put. 2. 10/09/19 Spot 25 sx class "c" cmt @ 5750' w/disp @ 5500'. Tag TOC @ 5418'. 3. 10/10/19 Perforate @ 4164'. Squeeze 70 sx class "c" cmt @ 4164' w/disp @ 384. 10/11/19 Spot 30 sx class "c" cmt @ 3546' w/disp @ 3246'. Tag TOC @ 3339'. w/disp @ 3181'. Tag TOC @ 3181'. 5. 10/14/19 Perforate @ 2051'. Squeeze 110 sx class "c" cmt @ 2051' w/disp @ 3	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339'
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 mic Put. 2. 10/09/19 Spot 25 sx class "c" cmt @ 5750' w/disp @ 5500'. Tag TOC @ 5418'. 3. 10/10/19 Perforate @ 4164'. Squeeze 70 sx class "c" cmt @ 4164' w/disp @ 384. 10/11/19 Spot 30 sx class "c" cmt @ 3546' w/disp @ 3246'. Tag TOC @ 3339'. w/disp @ 3181'. Tag TOC @ 3181'. 5. 10/14/19 Perforate @ 2051'. Squeeze 110 sx class "c" cmt @ 2051' w/disp @ 78'. Tag TOC @ 1300'. Squeeze 85 sx class "c" cmt @ 978' w/disp @ 978'. Tag TOC @	Completions: Attach wellbore diagram of 264'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ @ 960'.
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 mac put. 2. 10/09/19 Spot 25 sx class "c" cmt @ 5750' w/disp @ 5500'. Tag TOC @ 5418'. 3. 10/10/19 Perforate @ 4164'. Squeeze 70 sx class "c" cmt @ 4164' w/disp @ 384. 4. 10/11/19 Spot 30 sx class "c" cmt @ 3546' w/disp @ 3246'. Tag TOC @ 3339'. w/disp @ 3181'. Tag TOC @ 3181'. 5. 10/14/19 Perforate @ 2051'. Squeeze 110 sx class "c" cmt @ 2051' w/disp @ 78'. Tag TOC @ 1300'. Squeeze 85 sx class "c" cmt @ 978' w/disp @ 978'. Tag TOC @ 6. 10/15/19 Perforate @ 565'. Spot & squeeze surface via 5 1/2" csg and circulate.	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'.
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 mic Put. 2. 10/09/19 Spot 25 sx class "c" cmt @ 5750' w/disp @ 5500'. Tag TOC @ 5418'. 3. 10/10/19 Perforate @ 4164'. Squeeze 70 sx class "c" cmt @ 4164' w/disp @ 384. 10/11/19 Spot 30 sx class "c" cmt @ 3546' w/disp @ 3246'. Tag TOC @ 3339'. w/disp @ 3181'. Tag TOC @ 3181'. 5. 10/14/19 Perforate @ 2051'. Squeeze 110 sx class "c" cmt @ 2051' w/disp @ 78'. Tag TOC @ 1300'. Squeeze 85 sx class "c" cmt @ 978' w/disp @ 978'. Tag TOC @	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'.
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple oproposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 00 00 00 00 00 00 00 00 00 00 00	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'.
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 mid Put. 2. 10/09/19 Spot 25 sx class "c" cmt @ 5750' w/disp @ 5500'. Tag TOC @ 5418'. 3. 10/10/19 Perforate @ 4164'. Squeeze 70 sx class "c" cmt @ 4164' w/disp @ 384. 10/11/19 Spot 30 sx class "c" cmt @ 3546' w/disp @ 3246'. Tag TOC @ 3339'. w/disp @ 3181'. Tag TOC @ 3181'. 5. 10/14/19 Perforate @ 2051'. Squeeze 110 sx class "c" cmt @ 2051' w/disp @ 1300'. Squeeze 85 sx class "c" cmt @ 978' w/disp @ 978'. Tag TOC @ 10/15/19 Perforate @ 565'. Spot & squeeze surface via 5 1/2" csg and circulate w/155 sx class "c" cmt. Verify cmt @ surf. RD all P&A equip. Dig out install dry hole marker, back drag location. P&A completed.	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'.
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple oproposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 00 00 00 00 00 00 00 00 00 00 00	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'.
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 00 000 000 000 000 000 000 000 0	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'.
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple oproposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 00 000 000 000 000 000 000 000 0	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'. e cmt on surface thru perf @ 565' wellhead & anchors, cut & remove,
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple proposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 00 000 000 000 000 000 000 000 0	Completions: Attach wellbore diagram of 964'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'. e cmt on surface thru perf @ 565' wellhead & anchors, cut & remove,
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC: For Multiple oproposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 0	Completions: Attach wellbore diagram of 264'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'. e cmt on surface thru perf @ 565' wellhead & anchors, cut & remove,
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple operations of proposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 m 10 10 10 10 10 10 10 10 10 10 10 10 10	Completions: Attach wellbore diagram of 264'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'. c cmt on surface thru perf @ 565' wellhead & anchors, cut & remove,
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple oproposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 1000 mat Put. 2. 10/09/19 Spot 25 sx class "c" cmt @ 5750' w/disp @ 5500'. Tag TOC @ 5418'. 3. 10/10/19 Perforate @ 4164'. Squeeze 70 sx class "c" cmt @ 4164' w/disp @ 384. 10/11/19 Spot 30 sx class "c" cmt @ 3546' w/disp @ 3246'. Tag TOC @ 3339'. w/disp @ 3181'. Tag TOC @ 3181'. 5. 10/14/19 Perforate @ 2051'. Squeeze 110 sx class "c" cmt @ 2051' w/disp @ 1300'. Squeeze 85 sx class "c" cmt @ 978' w/disp @ 978'. Tag TOC @ 10/15/19 Perforate @ 565'. Spot & squeeze surface via 5 1/2" csg and circulate w/155 sx class "c" cmt. Verify cmt @ surf. RD all P&A equip. Dig out install dry hole marker, back drag location. P&A completed. Spud Date: Rig Release Date: Title Agent Title Agent Title Sunsetwellse	Completions: Attach wellbore diagram of 264'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 960'. e cmt on surface thru perf @ 565' wellhead & anchors, cut & remove,
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple of proposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 000 0000 0000 0000 0000 0000 00	Completions: Attach wellbore diagram of 264'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 2960'. The completion of the complete state of the complete sta
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple of proposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 10 00 000 0000 0000 0000 0000 0000 00	Completions: Attach wellbore diagram of 264'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 2960'. The completion of the complete state of the complete sta
OTHER: 13. Describe proposed or completed operations. (Clearly state all pertinent details, of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple oproposed completion or recompletion. 1. 10/08/19 Notified OCD of intent. 1000 mat Put. 2. 10/09/19 Spot 25 sx class "c" cmt @ 5750' w/disp @ 5500'. Tag TOC @ 5418'. 3. 10/10/19 Perforate @ 4164'. Squeeze 70 sx class "c" cmt @ 4164' w/disp @ 384. 10/11/19 Spot 30 sx class "c" cmt @ 3546' w/disp @ 3246'. Tag TOC @ 3339'. w/disp @ 3181'. Tag TOC @ 3181'. 5. 10/14/19 Perforate @ 2051'. Squeeze 110 sx class "c" cmt @ 2051' w/disp @ 1300'. Squeeze 85 sx class "c" cmt @ 978' w/disp @ 978'. Tag TOC @ 10/15/19 Perforate @ 565'. Spot & squeeze surface via 5 1/2" csg and circulate w/155 sx class "c" cmt. Verify cmt @ surf. RD all P&A equip. Dig out install dry hole marker, back drag location. P&A completed. Spud Date: Rig Release Date: Title Agent Title Agent Title Sunsetwellse	Completions: Attach wellbore diagram of 264'. Tag TOC @ 3952'. Squeeze 70 sx class "c" cmt @ 3339' 1632'. Tag TOC @ 1598'. Perforate @ 2960'. The completion of the complete state of the complete sta