

, B.	UNITED STATE DEPARTMENT OF THE I UREAU OF LAND MAN	NTERIOR NU	OCD Art	sia	OMB Expires: Serial No.	1 APPROVED No. 1004-0137 January 31, 2015	8		
SUNDR Do not use th	Y NOTICES AND REPO is form for proposals t II. Use Form 3160-3 (A	DRTSDIGINET	enter an	AO.C.D. 6. If India	LC-02 nn, Allottee or Tri	9415-B be Name			
SUBMIT	7. If Unit	7. If Unit of CA/Agreement, Name and/or No.							
1. Type of Well				9 11/-11 N					
	8. Well IN	8. Well Name and No. PUCKETT B 001							
2. Name of Operator HUDSON O	IL COMPANY OF TEXAS			9. API W	9. API Well No. 38-015-05373				
<sup>3a. Address</sup> 616 TEXAS STREE FORT WORTH, TX		3b. Phone No. (inch (817) 336-7109	ude area code	oratory Area	<u> </u>				
4. Location of Well (Footage, Sec.,				MALJA	TY or Parish, State				
	FROM THE SOUTH AND 660								
	CHECK THE APPROPRIATE B	OX(ES) TO INDICA	TE NATURE	OF NOTICE, REPO	ORT OR OTHER	DATA			
TYPE OF SUBMISSION		·		PE OF ACTION					
✓ Notice of Intent	Acidize	Deepen Hydraulic	Fracturing	Production (Sta	nrt/Resume)	Water Shut-O Well Integrity			
Subsequent Report	Casing Repair	New Cons		Recomplete		Other	19		
Final Abandonment Notice	Change Plans	Plug and A		Temporarily Al	oandon	Other	NMOCID		
is ready for final inspection.) 1. MIRU well service rig ar 2. Set CIBP @ 3,250'. RI POOH with tubing and WO 3. POOH with tbg. Shoot s 4. RIH and perforate 7" ca: 5. RIH and perforate 7" an 6. Cut off well head and ve 7. Cut off anchors, Rip and	Notices must be filed only after ad plugging equipment. Unloa H with tubing and tag CIBP. T C. RIH with tbg and tag ceme squeeze holes @ 2,040'. Squ sing @ 800'. Squeeze cemer d 8-1/4" casing @ 60'. Squee rify cement to surface around I remove caliche, contour to s : "Rip and remove cal	d work string. RIH Fest casing to 500 p ent @ 3,000'. If ned eeze cement plug t across 10-3/4" sh ize 50 sx cement to both casing strings urrounding topogra	I with 7" Swa psi. Displace cessary, pun from 2,040' - noe from 800 o surface. s. Install bel phy. and res	ge to possible colla e well with 9.5 ppg padditional cemel - 1,650'. WOC. RI - 595'. WOC. RI ow ground dry hole seed location.	apsed casing @ mud. Spot 65 nt to bring top to H and tag ceme A and tag ceme SEE A T marQNDI	329'. Swage o sx cement on to 3,000'. ent. POOH. nt. POOH with TTACHE TIONS (	ut casing. op of CIBP. tubing. D FOR DF APPROVA ENTERED IN AFMSS		
14. I hereby certify that the foregoir	g is true and correct. Name (Pri	nted/Typed)		·			DW 10/23		
KAREN ZORNES			REGULATORY CONSULTANT						
Signature Janen -	Date	Date 10/15/2019							
	THE SPACE	FOR FEDERA	L OR ST	ATE OFICE US	E				
Approved by	es Q. Como	2	Title <b>(</b>	SALT	Date	11-3	3-19		
Conditions of approval, if any, are a certify that the applicant holds legal which would entitle the applicant to	or equitable title to those rights		Office	10	<b>* · · · · · · ·</b> · · ·				
Title 18 U.S.C Section 1001 and Tit any false, fictitious or fraudulent sta	le 43 U.S.C Section 1212, make tements or representations as to a	it a crime for any per any matter within its	rson knowing jurisdiction.	ly and willfully to ma	ake to any departr	nent or agency o	f the United States		
(Instructions on page 2)									

Æ

# Hudson Oil of Texas – P&A Procedure – 10/14/2019

# **Puckett "B" #1**

î

API #: 35-015-05373 AFE#: Field: Maljamar Surf Location: Sec 24, T17S – R31E 660' FSL & 660' FWL Latitude: 00.0000° N / Longitude: -00.0000° W Eddy County, NM Spud Date: 1-21-41

#### **Directions to Location**

From Maljamar: West on Hwy 82 for 4 miles. Turn south into location.

Description	Size	Wght	Grade	ID	Drift	Burst	Collapse	Btm MD	TOC
Surface	10-3/4"	40		10.05"	9.89"			695'	
Production	7"	20		4.95"	4.825"			3,302'	2,845' Est
Tubing									

**KB:** 3,874' **GL:** 3,872' **PBTD**: 3,942' **TD:** 3,951'

#### Current Perfs: 3,302' – 3,942' Open Hole

**Objective:** P&A Well Bore in compliance with the rules and regulations for the state of New Mexico.

Proposed Perfs: None

#### Procedure

1. MIRU well service rig and plugging equipment. Unload work string. RIH with 7" Swage to possible collapsed casing @ 329'. Swage out casing.

2. Set CIBP @ 3,250'. RIH with tubing and tag CIBP. Test casing to 500 psi. Displace well with 9.5 ppg mud. Spot 65 sx cement on top of CIBP. POOH with tubing and WOC. RIH with tbg and tag cement @ 3,000'. If necessary, pump additional cement to bring top to 3,000'.

3. POOH with tbg. Shoot squeeze holes @ 2,040'. Squeeze cement plug from 2,040' – 1,650'. WOC. RIH and tag cement. POOH.

4. RIH and perforate 7" casing @ 800". Squeeze cement across 10-3/4" shoe from 800'-595'. WOC. RIH and tag cement. POOH with tubing.

5. RIH and perforate 7" and 8-1/4" casing @ 60'. Squeeze 50 sx cement to surface.

6. Cut off well head and verify cement to surface around both casing strings. Install below ground dry hole marker.


7. Cut off anchors, Rip and remove caliche, contour to surrounding topography. and reseed location.


THIS PROCEDURE HAS BEEN PROPOSED IN CONSIDERATION OF AND WITH RESPECT GIVEN TO THE MANY VARIABLES AND POTENTIAL PROBLEMS THAT MAY BE ENCOUNTERED IN THIS WELL IN THIS GEOGRAPHICAL AREA. THEREFORE, THIS PROCEDURE IS TO SERVE AS A GENERAL GUIDELINE AND WILL BE REVIEWED AND MODIFIED WHEN REQUIRED AS DETERMINED BY ACTUAL WELLBORE CONDITIONS ENCOUNTERED IN THE OPERATIONS. SAFETY AND PRUDENT PRACTICES WILL TAKE PRIORITY AT ALL TIMES.

Notify Blm Prior to any Changes to Approval

Prior to rig up of any operations and prior to the actual operations, always hold safety meeting to discuss any potential hazards, accurately record names of all personnel on location, pick meeting place, discuss evacuation plans, designate hospital of choice and have coordinates and phone numbers for care flight operations if necessary. Completely discuss the operation and/or rig-up so that all personnel understand the plan, responsibilities and any potential changes that may take place during the rig up or operation

Prepared By: Greg Milner Petroleum Engineer Date: 10-14-19

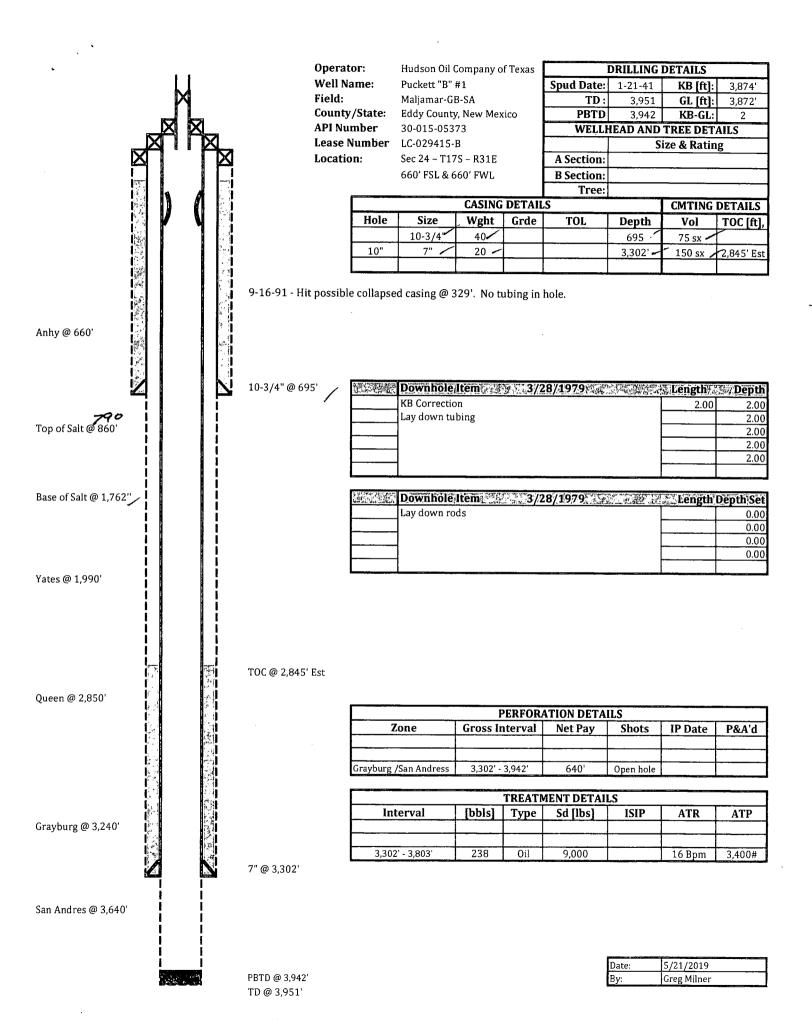

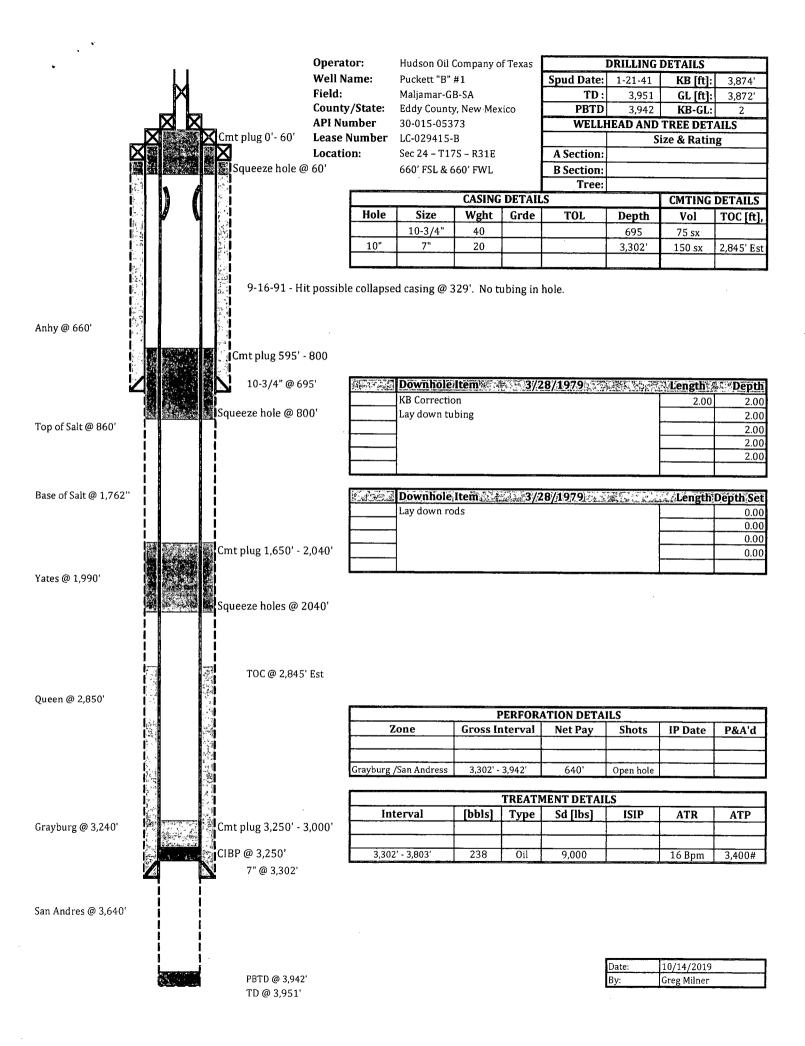

### BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

.

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement</u>: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat . Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

٠

6. <u>Below Ground Level Cap (Lesser Prairie-Chicken Habitat)</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u> From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted