

Form 1160-5
(July 1989)
(Formerly 9-111)

U. S. DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

RECEIVED
OFFICE FOR N
OTHER INSTRUCTIONS ON RE-
VERSE SIDE

W.H. Howell District
Hollified Form No.
1160-3160-4

5. LEASE DESIGNATION AND SERIAL NO.

NM 06767

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Hackberry

9. WELL NO.

1

10. FIELD AND FOOT, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR R.R. AND
SURVEY OR AREA

25 T19S R30E

12. COUNTY OR PARISH 13. STATE
Eddy NM

1. WELL ☒ GAS WELL ☐ OTHER P-A

2. NAME OF OPERATOR

Julian Ard

3. ADDRESS OF OPERATOR

303 Main Street, Suite 302 Fort Worth, Texas 76102

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.
See also space 11 below.)
At surface

1980' F.N.L. 1980 F.E.L. Sec. 25 T19S R30E

14. PERMIT NO.

15. ELEVATIONS (Show whether NP, RT, GR, etc.)
3306 GR 3327 RKB

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACURE TREAT

SHOOTING OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETION

ABANDON*

CHANGE PLANT

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT*

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. WORKING PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting at proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

1. Displace hole with mud.
2. Set C.I. B.P. @ 9200' ± 35' cement on top.
3. Cut 5½ csg. @ 7180' ± 150' cement plug @ stub. Must tag this plug.
Will set plug with 2 7/8" bg.
4. Set 150' Cement plug @ 5600' ± 2 7/8" bg.
5. Set 100' Cement plug @ 8 5/8" csg. shoe. Tag plug.
6. Set 100' Cement plug @ 3100' ± S.A.
7. Set 100' Cement plug @ D.V. 'Rxl 2184'.
8. Set 100' Cement plug @ 820' ± 13 3/8" csg. shoe.
9. Set 50' Cement plug @ surface, with permanent marker. Dry Hole. Witnessed
10. Move equipment off, level off location, close all pits. Sanches w/

18. I hereby certify that the foregoing is true and correct

SIGNED

TITLE President

DATE 12-11-89

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

Approved by: [Signature]
L. [Signature]
S. [Signature]

*See Instructions on Reverse Side

RECEIVED

10. Hackberry #1
Drilled

50 ft. plug at surface

100 ft. at 820

100 ft. 2184

100 ft. plug at 3100'

150 ft. plug tagged

