Submit 3 Copies To Appropriate District Office	State of Ne		Form C-103
District 1	Energy, Minerals and	d Natural Resources	May 27, 2004 WELL API NO.
1625 N French Dr., Hobbs, NM 88240 District II	OH CONGERNA		30-015-02978
1301 W Grand Ave , Artesia, NM 88210	OIL CONSERVA		5. Indicate Type of Lease FEDERAL
District III 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South S		STATE FEE
District IV	Santa Fe, 1	NM 87505	6. State Oil & Gas Lease No.
1220 S St Francis Dr , Santa Fe, NM 87505			Federal Lease No. NMLC028731B
	CES AND REPORTS ON V	VELLS	Federal Unit No. NMNM111789X  7. Lease Name or Unit Agreement Name
(DO NOT USE THIS FORM FOR PROPOS			7. Lease Name of Offit Agreement Name
DIFFERENT RESERVOIR USE "APPLIC	CATION FOR PERMIT" (FORM C	-101) FOR SUCH	Dodd Federal Unit
PROPOSALS)  1. Type of Well: Oil Well	Gas Well  Other	WIW	8. Well Number
	Ous wen	JUN 18 2008	27
2. Name of Operator			9. OGRID Number
3. Address of Operator	oob Energy Corporation	OCD-ARTESIA	14049 10. Pool name or Wildcat
-	27, Artesia, NM 88211-022	7	Grbg Jackson SR Q Grbg SA
4. Well Location			
	660 feet from the	North line and	1980 feet from the West line
Section 14	Township 17S R		MPM Eddy County
Section 14	11. Elevation (Show wheth		
		3638' GL	
Pit or Below-grade Tank Application 🗆 o			
Pit typeDepth to Groundwa	aterDistance from neares	t fresh water well Dist	ance from nearest surface water
Pit Liner Thickness: mil	Below-Grade Tank: Volum	e bbls; Co	onstruction Material
12. Check A	Appropriate Box to Indic	cate Nature of Notice,	Report or Other Data
NOTICE OF IN	TENTION TO	OUD	OF OUT DEPORT OF
NOTICE OF IN PERFORM REMEDIAL WORK □			SEQUENT REPORT OF:  K
<del></del>	CHANGE PLANS		_
	MULTIPLE COMPL [		
_			_
OTHER:	lated amountions (Clearly et	OTHER: Conv	vert to Water Injection Well
			d give pertinent dates, including estimated date tach wellbore diagram of proposed completion
or recompletion.	INJ. GEE ROBE 1103. TO	Multiple Completions. Att	acii wenoore diagram of proposed completion
·			
	337 11		
Converted to Water Injection	n Well	wa.	- 827
***See Chart & Completed	Procedure Attached***	wr ~	-827 12/17/07
		•	2/17/01
I hereby certify that the information-	shove is true and complete to	the hest of my knowledge	and belief. I further certify that any pit or below-
grade tank has been/will be constructed or o	losed according to NMOCD guid	elines [], a general permit [] o	or an (attached) alternative OCD-approved plan
SIGNATURE MAIN	TIT WON INC	L.C. Dun desation Associated	DATE (417/00
SIGNATURE JUNIUS	my my	LEProduction Analyst	DATE6/17/08
Type or print name Diana J. Brigg	s E-mail address: pr	oduction@marbob.com	Telephone No. (575) 748-3303
For State Use Only			,
APPROVED BY: <b>Putaro</b>	LAKE -	LE COMPLIANCE D	The state of the state of
APPROVED BY: (LUMAN) Conditions of Approval (if any):	111	LE UMPLIANCE	Fice DATE 6/24/08
= =			_

-

## MARBOB ENERGY CORPORATION DODD FEDERAL UNIT #27 WIW

MARY DODD B #6

## 660 FNL 1980 FWL, SEC. 14-T17S-R29E, UNIT C 30-015-02978, GRBG JACKSON SR Q GRBG SA EDDY COUNTY, NM

EDDY COUNTY, NM	
3/4/08 CONVERT TO INJ WELL: RU WOU. UNSEAT PMP. POOH W/ RODS	
WAREHOUSE 172 - 3/4" RODS. LD PMP. WATSON HOT OIL PMPD 75 BBLS WT	R
DN CSG TO KILL GAS. ND TBG. NU BOP. POOH & LD 68 JTS TBG & WELL	
STARTED FLOWING OUT TBG. COULDN'T GET KILL TRUCK. SWI. SDFTD	
3/5/08 BASIC PMPD 30 BBLS WTR DN TBG. FINISH POOH W/ 66 JTS OF TBG. L/D. L&F	₹
BROUGHT 145 JTS WORK STRING. RIH W/ 3 7/8" BIT, 4 1/2" CSG SCRAPER &	
134 JTS TO 4336'. POOH W/ TBG & SCRAPER. RIH W/ CIBP, RTTS & 105 JTS.	
SET CIBP @ 3400'. SET PKR ABV PLUG. BASIC LOADED TBG. TEST TO 2000 #	
WOULDN'T HOLD. UNSEAT PKR. MOVE UP 1 JT. WOULDN'T TEST. MOVE PKR	
DN ON TOP OF PLUG & WOULDN'T HOLD #. POOH W/ TBG & PKR. RIH W/ R-4	
PKR & TBG. SET PKR 1' ABV PLUG & TEST TO 2000# & HELD. PKR WOULDN'T	
RLS. TRY TO WORK LOOSE & WOULDN'T COME LOOSE. SWI. SDFTD	
MANUEL TO MARKET TO A CONTROL OF THE	
3/6/08 TRY TO WORK PKR LOOSE. WOULDN'T COME LOOSE. CALL ROTARY W/L. RU	j
ROTARY W/L TO CUT TBG @ 3400'. RD ROTARY W/L. POOH W/ TBG 10'. CUT	_
OFF PIECE OF TBG. RIH W/ O/S, BUMPER SUB, HYD JARS, 6 - 3 1/4" DCS & TBG GOT ON CUT OFF JT & JAR ON PKR TO WORK IT LOOSE. O/S CAME OFF. POO	
W/ TBG, DCS & TOOLS. SWI. SDFTD MANUEL	11
3/7/08 RIH W/ 2 5/16 GRAPPLE ON O/S, BUMPER SUB, HYD JARS, DCS & TBG. GOT C	M
CUT OFF JT & JAR ON PKR. GOT PKR LOOSE. POOH W/ TBG, DCS & HAD PAR	
OF PKR. LEFT 2 SLIPS, TOP CONE, RUBBER, BTM RING & COLLAR OFF PKR II	
HOLE. SWI. SDFTD MANUEL	•
3/8/08 RIH W/ 3 15/16 CUT RITE SHOE, DCS & TBG. TAG @ 3396'. PU SWIVEL & DRILL	_
TO 3398'. L/D SWIVEL. POOH W/ TBG, DCS & SHOE. HAD CONE OFF PKR	
INSIDE SHOE. MADE 2 MAGNET RUNS ON SANDLINE. GOT PIECE OF METAL 8	<u> </u>
METAL SHAVINGS. SWI. SDFTD MANUEL	
3/10/08 RIH W/ TAPER TAP & TBG. TAG COLLAR ON TOP OF PLUG TO GET COLLAR.	
POOH W/ TBG & TAPER TAP. DIDN'T GET COLLAR. RIH W/ MILL SHOE, DC &	
TBG. TAG @ 3398'. PU SWIVEL & DRILL DN TO 3399'. LD SWIVEL & POOH W/	
TBG, DC & HAD SHEAR RING. COLLAR STUCK INSIDE SHOE. SWI. SDFTD	
3/11/08 RIH W/ MIL SHOE, DC & TBG. TAG @ 3399'. PU PWR SWIVEL. DO PLUG. LD	
SWIVEL. RIH TO 4330'. POOH W/ TBG & DC. RIH W/ DRILL BIT, 4 1/2" CSG SCRAPER & TBG TO TD. POOH W/ TBG & SCRAPER. RIH W/ CIBP, RTTS & TBG	•
SET @ 3992'. SET RTTS & TEST PLUG TO 2000#. HELD. POOH W/ TBG & RTTS	
SWI. SDFTD MANUEL	•
3/12/08 RIH W/ CMNT RETAINER & 84 JTS OF TBG. HLS PMPD 12 BBLS THROUGH	
RETAINER @ 2725'. HLS PMPD 28 BBLS TO LOAD CSG & PRESS UP TO 500#.	
HLS PMPD 15 BBLS OF WTR EST RATE 2 BPM @ 85#. PMP CMNT & SQUEEZE	
SAN ANDRES PERFS. 600 SX CMNT. PO STINGER & CLN CMNT OUT OF TBG.	
RD HLS. POOH W/ TBG. SWI. SDFTD MANUEL	
3/13/08 RIH W/ 3 7/8" DRILL BIT, DC & TBG. TAG @ 2719. PU SWIVEL & DRILL CMNT &	

3/14/08 START DRILLING OUT CMNT @ 2728'. DRILL DN TO 3148'. CIRC CLN. PU 2 JTS. SWI. SDFTD. - MANUEL

MANUEL

RETAINER @ 2725' & CMNT WAS STILL GREEN. PU 2 JTS. SWI. SDFTD. -

## MARBOB ENERGY CORPORATION DODD FEDERAL UNIT #27 WIW

MARY DODD B #6

## 660 FNL 1980 FWL, SEC. 14-T17S-R29E, UNIT C 30-015-02978, GRBG JACKSON SR Q GRBG SA EDDY COUNTY, NM

3/17/08	START DO CMNT @ 3148'. FELL OUT OF CMNT @ 3320'. CIRC CLN. TEST CSG
	TO 1000# WATCH FOR 10 MIN & HELD. LD SWIVEL. RIH W/ 20 JTS OF TBG. TAG
	CIBP @ 4035'. PU SWIVEL. DO PLUG. FELL OUT @ 4053'. LD SWIVEL. RIH W/ 9
	JTS. TAG @ 4330'. POOH W/ TBG & LD DCS. RIH W/ DRILL BIT, 4 1/2" CSG
3/18/08	L&R DELIVERED 130 JTS PC TBG. HAUL OFF W/S 145 JTS. TALLY TBG. RIH W/
	R-4 NP PKR & 125 JTS 2 3/8" PC TBG. BASIC PMPD 25 BBLS PKR FL. WAIT 10
	MIN. SET PKR @ 4010'. LOAD CSG W/ 25 BBLS PKR FL. PRESS UP TO 300# ON
	CHART. COULDN'T GET TEST. OCD WAS NOTIFIED. SWI. SDFTD MANUEL
3/19/08	BASIC PRESS UP TO 300#. LVL @ 260#. FL FORMED & COULDN'T GET GOOD
	TEST. COME BACK @ LATER DATE MANUEL
5/29/08	RU OK HOT OIL ON CSG. 1/2 BBLS TO LOAD CSG. PRESS TEST TO 345# FOR 30
	MIN WITH A CHART RECORDER. TEST OK. RD OK HOT OIL. SWI. FINAL
	REPORT MANUEL