

Submit 3 Copies To Appropriate District Office
District I
1625 N French Dr., Hobbs, NM 88240
District II
1301 W Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
June 19, 2008

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

S

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-23696
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐ AUG 15 2008		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Chesapeake Operating, Inc. OCD-ARTESIA		6. State Oil & Gas Lease No.
3. Address of Operator P. O. Box 18496 Oklahoma City, OK 73154-0496		7. Lease Name or Unit Agreement Name Malaga C
4. Well Location Unit Letter D : 1980' feet from the North line and 660' feet from the West line Section 36 Township 23S Range 28E NMPM County Eddy		8. Well Number 1
11. Elevation (Show whether DR, RKB, RT, GR, etc) 2990'		9. OGRID Number 147179
		10. Pool name or Wildcat Culebra Bluff, Atoka; South

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Dear Sirs/Madams.

Please find the attached information for the intent to plug & abandon this well:
Well-Bore Schematic Actual and Proposed
Plugging Procedure
NMOCD's C-144 CLEZ pit permit

**Notify OCD 24 hrs. prior
to any work done.**

Approval Granted providing work
is complete by 12/1/08

Spud Date:

03/28/1981

Rig Release Date:

10/27/1981

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Linda Good

TITLE Sr.Reg. Compl. Sp.

DATE 08/14/2008

Type or print name Linda Good

E-mail address: linda.good@chk.com

PHONE (405)767-4275

For State Use Only

APPROVED BY:

[Signature]

TITLE Compliance Officer

DATE 8/15/08

Conditions of Approval (if any):




Proposal - Workover

MALAGA C 1

Field: SOUTH CULEBRA BLUFF ATOKA GAS
County: EDDY
State: NEW MEXICO
Elevation: GL 2,990.00 KB 3,013.00
KB Height: 23.00
Location: SEC 36, 23S-28E, 1980 FNL & 660 FWL

Spud Date: 3/21/1981
Initial Compl. Date
API #: 3001523696
CHK Property #: 891235
1st Prod Date: 8/1/1982
PBDT. Original Hole - 11505.0
TD 13,472.0

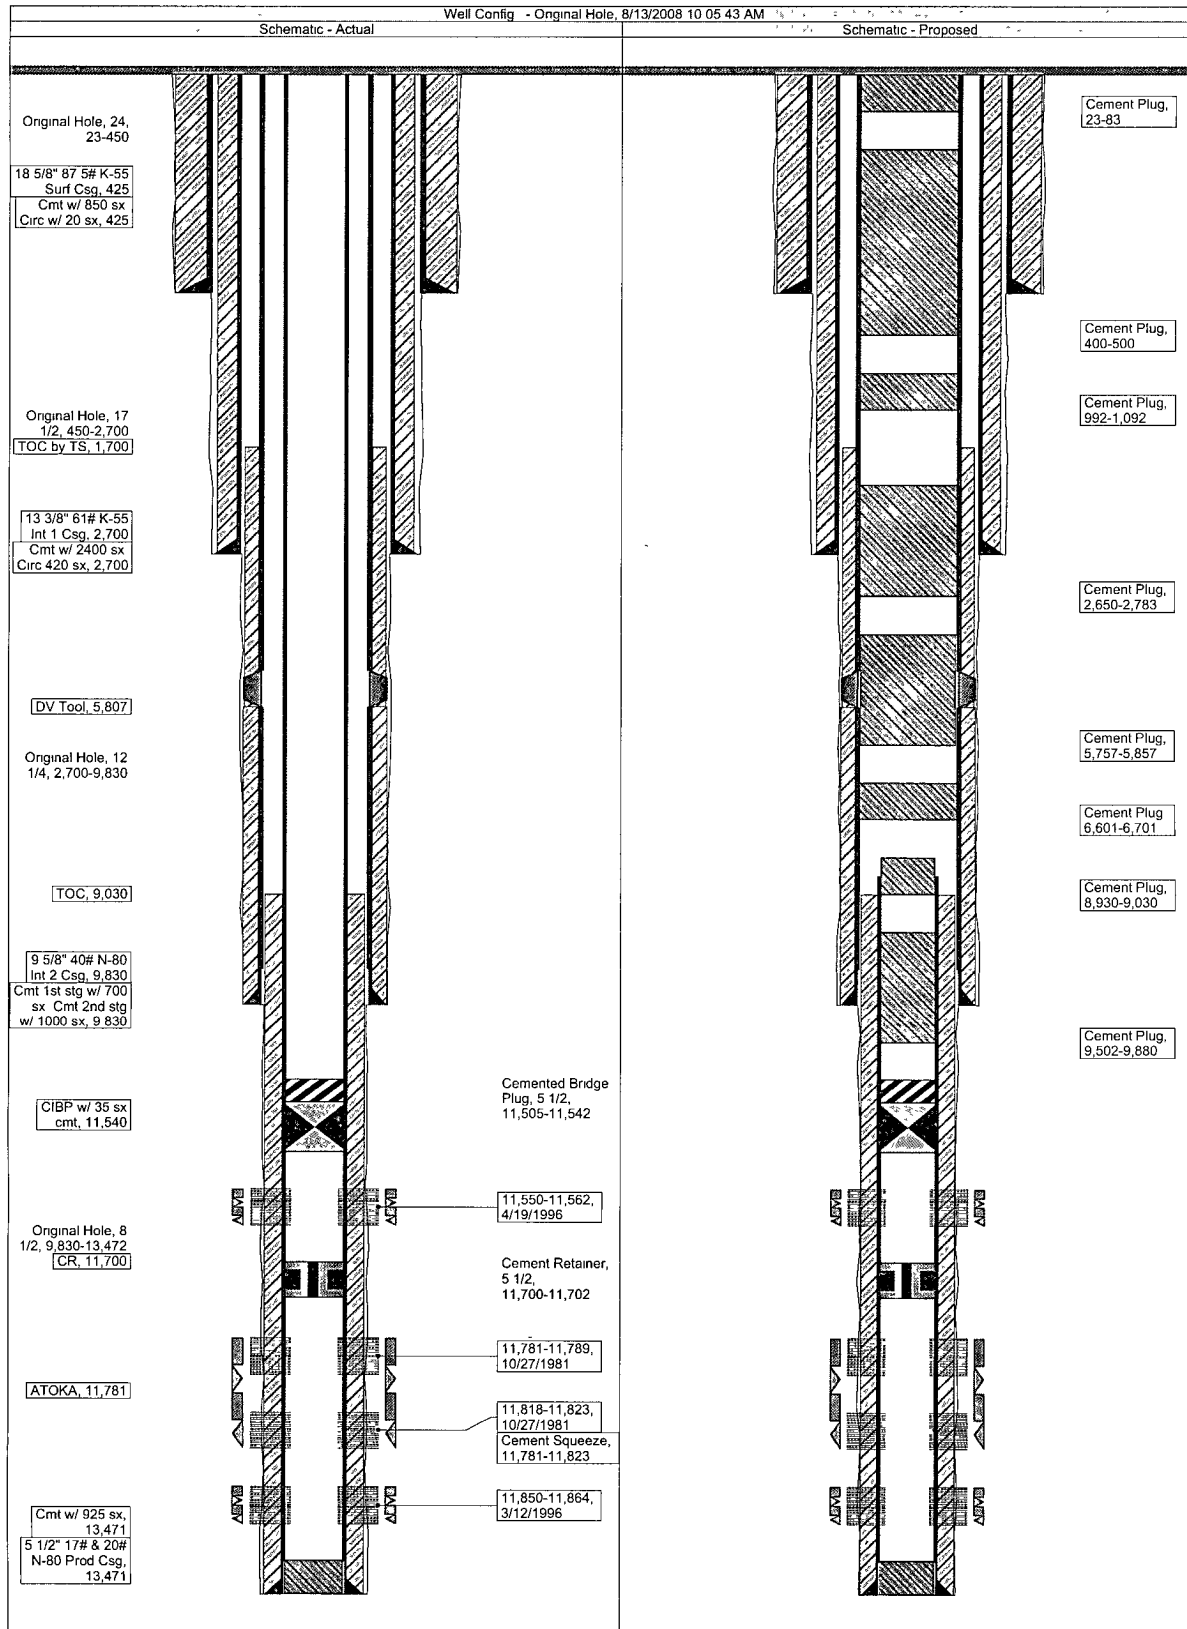

Malaga C 1
Eddy County, New Mexico
Plugging Procedure

Date: August 6, 2008

Location: 1980' FNL & 660' FWL Sec. 36-T23S-R28E

Production Casing: 5 1/2" 17# & 20# N-80 0'-13,472'

PBTD/TD: 11,700' / 13,472'

Current Perfs: Wolfcamp, 11,550-11,562'

Recommended Procedure:

1. MIRU PU. NDWH/NUBOP.
2. RIH w/ open ended tbg to 9,880' and set a 378' plug. (Covers Wolfcamp and casing shoe). WOC and tag plug. POH w/ tbg.
3. Cut and pull 5 1/2" casing at 8,980'
4. RIH w/ open ended tbg to 9,030' and set a 25 sxs cement plug. PUH and WOC. Tag plug to verify.
5. PUH to 6,701' and set a 25 sx cement plug. (Covers Bone Springs). PUH and WOC. Tag plug to verify.
6. PUH to 5,857' and set a 25 sx cement across DV Tool. PUH and WOC. Tag plug to verify.
7. PUH to 2,783' and set a 25 sx plug. (Covers casing shoe and base of salt). PUH and WOC. Tag plug to verify.
8. PUH up to 1,092' and set a 25 sx plug. (Covers top of salt. PUH and WOC. Tag plug to verify.
9. PUH to 500' and set a 25 sx plug. (Covers casing shoe). PUH and WOC. Tag plug to verify.
10. Fill casing back to surface with 60' of cement. POH w/ tbg. Top off casing with cement.
11. RD and move off. Install dry hole marker and cut off dead men. Restore location.

Contacts

Workover Foreman
Lynard Barrera
Office 575-391-1462
Cell. 575-631-4942

Production Foreman
Rip Clary
Office 575-391-1462
Cell 575-631-4864

Asset Manager
Jeff Finnell
Office 405-767-4347
Cell 405-919-3305

Field Engineer
Doug Rubick
Office 575-391-1462
Cell. 575-441-7326