

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION
P. O. BOX
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	☒
FILE	☒
U.S.O.S.	
LAND OFFICE	
OPERATOR	☒

RECEIVED BY
MAY 20 1985

O. C. D.
NEW MEXICO

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.

OIL ☐ GAS ☒ OTHER-

Name of Operator

Stevens Operating Corporation

Address of Operator

P. O. Box 2203, Roswell, New Mexico 88201

Location of Well

UNIT LETTER L 1980 FEET FROM THE South LINE AND 745 FEET FROM
THE West LINE, SECTION 1 TOWNSHIP 9S RANGE 28E NMPM.

7. Unit Agreement Name

8. Farm or Lease Name

O'Brien "C"

9. Well No.

#4

10. Field and Pool, or Wildcat

Wildcat Bough "C"

15. Elevation (Show whether DF, RT, GR, etc.)

3938 GR

12. County

Chaves

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
☐

REMEDIAL WORK ☒
COMMENCE DRILLING OPS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER Perf, treatment, squeeze ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐
☐

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

7-18-84

Rig up pulling unit, drop standing valve & pressure test tbq to 2000# (held ok), POH w/214 jts 2 3/8 tbq & 5 1/2 Loc-set, hit tight spot @ 5662), trip back in w/86 jts 2 3/8 x 4.7# tbq & 5 1/2" cup type Howco RBP set @ 2690' spot 3 sxs sand over RBP, pull out of hole & pick up RHS pkr trip in 77 jts & set pkr @ 2410' load & pressure annulas to 300#, rig up Howco & squeeze San Andres Perfs w/150 sxs class "H" cmnt w/2% cacl, final squeeze PSI 2000#, unseat pkr reverse out, pull 5 stands reset pkr & pressure up to 1500#, shut in w/pressure over nite. Prep to drill out.

See Attached

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

Signed [Signature]

TITLE Production Controller

DATE 5/17/85

APPROVED BY [Signature]
ORIGINAL SIGNED BY LARRY BROOKS
GEOLOGIST - NMOCD

TITLE _____

DATE

MAY 20 1985