

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

RECEIVED

DEC 29 1978

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

O. C. C.

ARTESIA, OFFICE

SUNDY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT TO DRILL" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- P & A		5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
2. Name of Operator Yates Petroleum Corporation		5. State Oil & Gas Lease No. L-6998
3. Address of Operator 207 South 4th Street - Artesia, NM 88210		7. Unit Agreement Name
4. Location of Well UNIT LETTER L 1980 FEET FROM THE South LINE AND 660 FEET FROM THE West LINE, SECTION 14 TOWNSHIP 9S RANGE 26E NMPM.		6. Farm or Lease Name Smith JR State Com
15. Elevation (Show whether DF, RT, GR, etc.) 3807' GR - 3815' KB		9. Well No. 1 1
		10. Field and Pool, or Wildcat Wildcat Devonian
		12. County Chaves

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:	
REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 6457; PBTD 4940' - Set CIBP at 4700', dumped 35' of cement on top of plug. Cut off casing at 4038'. RIH with tubing and plugged well as follows: Set 35 sacks plug at 4086', WOC. Tagged top of cement at 3994'. Displaced hole w/mud. Pulled tubing to 2251' & spotted 35 sacks plug. Picked up to 1542' & spotted 35 sack, WOC. Tagged top of cement at 1433'. Set 10 sack plug at surface w/dry hole marker.

Location will be cleaned and ready for inspection.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Geological Secretary DATE 12-28-78

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY: