

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

NMCOB Artesian

FORM APPROVED
Dudger Bureau No. 1004-C
Expires: March 31, 1991

3. Lease Designation and Serial:
NM-0477614

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Description

8. Well Name and No.

Midwest Federal #3

9. API Well No.

30-005-60524

10. Field and Pool, or Exploratory

Sand Ranch

11. County or Parish, State

Chaves Co., NM

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

1. Type of Well

☐ Oil Well ☐ Gas Well ☒ Other

2. Name of Operator

CENTRAL RESOURCES, INC.

3. Address and Telephone No.

300 West Texas, Suite 830, Midland, TX 79701 915-570-9013

4. Location of Well (Fouage, Sec., T., R., M., or Survey Description)

1980' FNL, 660' FEL, Sec. 22, T10S, R29E

12. CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

- ☒ Notice of Intent
☐ Subsequent Report
☐ Final Abandonment Notice

TYPE OF ACTION

- ☒ Abandonment
☐ Recompletion
☐ Plugging Back
☐ Casing Repair
☐ Altering Casing
☐ Other _____
- ☐ Change of Plans
☐ New Construction
☐ Non-Routine Fracturing
☐ Water Shut-Off
☐ Conversion to Injection
☐ Dispose Water

(Note: Report return of multiple completion or Recompletion Report and 1

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting and proposed work. If well is directional give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)

RECEIVED

Current well status is presented on the attached wellbore sketch.

JAN 29 1995

Plug as follows:

1. Cut 4 1/2" casing @ 8,000' and pull out of hole.
2. Spot 75 sacks cement from 8,135' up to 7,865' with tubing.
3. Spot 35 sacks cement from 2,910' up to 2,790' with tubing.
4. Cut 8 5/8" casing @ 1,600' and pull out of hole.
5. Spot 135 sacks cement from 1,700' up to 1,500' with tubing.
6. Spot 65 sacks cement from 375' up to 325' with tubing.
7. Set 50 sack cement plug at surface. 50' minimum
8. Cut casing and remove wellheads 6' below ground level and weld up marker with well identification.
9. Remove equipment and remediate location to acceptable standards.

Note: a) mud laden fluid will be left between all plugs.

b) if casing cannot be pulled, a retriever/packer will be used to squeeze plug in place.

* Additional plug 6200'-6040'

14. I hereby certify that the foregoing is true and correct

Signed Rodney L. Seale

Title Rodney L. Seale, Superintendent

Date 11/27/95

(This space for Federal or State office use)

Approved by

Conditions of approval, if any:

See attached slips

Title Peter W. Chiles

Date JAN 24 1996

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See instruction on Reverse Side

BUREAU OF LAND MANAGEMENT
ROSWELL RESOURCE AREA