

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

L CONSERVATION DIVISION

RECEIVED BY: O. BOX 2088
SANTA FE, NEW MEXICO 87501

FEB -5 1987

O. C. D.

ARTESIA OFFICE

Form C-103
Revised 10-1-78

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.

5a. Indicate Type of Lease	
State ☐	Fee ☒
5. State Oil & Gas Lease No.	
7. Unit Agreement Name	
8. Farm or Lease Name Powell	
9. Well No. 1	
10. Field and Pool, or Wildcat Wildcat S.A.	
12. County Chaves	

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER-	2. Name of Operator Phoenix Resources Company
3. Address of Operator 6525 North Meridian, Oklahoma City, OK 73116	4. Location of Well UNIT LETTER <u>C</u> <u>660'</u> FEET FROM THE <u>north</u> LINE AND <u>1980</u> FEET FROM THE <u>west</u> LINE, SECTION <u>23</u> TOWNSHIP <u>7S</u> RANGE <u>28E</u> NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) 4011.6' GR	

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐
PULL OR ALTER CASING ☐	OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐	ALTERING CASING ☐
COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOBS ☐	OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plug and abandon as follows:

Set CIBP @ 2300' and spot 35' cement plug on top of BP.
Circulate hole w/salt water mud using 25 sx salt gel/100 bbls water.
Pull up to 1530' and spot 25 sx cement plug from 1530' to 1200' (TOC @ 1470' CBL).
POOH LD tubing. Perforate 4-1/2" casing @ 350'. Establish circulation with fresh water.
Cement through 4-1/2" casing til get cement returns on 4-1/2x8-5/8" annulus.
Cut off casing (8-5/8" and 4-1/2") 3' below ground level.
Weld on P&A marker.
Clean location.
Rig down and move out.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED David A. Rudolph TITLE Sr Production Engr. DATE 1/29/87
APPROVED BY John Williams TITLE OIL AND GAS INSPECTOR DATE FEB 16 1987
CONDITIONS OF APPROVAL, IF ANY: