

Operator MEW Enterprises
 Well O'Brien F20 '18' #3
 Unit N Section 18 Township 8 Range 29
 API # 30-0 -

TOPS

Gates 922'
Queen 1562'
San Andres 2036'

← 50' Surface Plug.

- * Contact OCD 24-hrs. prior to any work done.
- * Salt gel mud consisting of 10# brine with 25# of gel per barrel must be placed between each plug.
- * Install dry hole marker as per Rule 202.B.2
- * Plugs are to be set from point indicated up.
- * Plugs must not be less than 100' or 25 Sacks of cement, whichever is greater, unless specifically indicated.
- * Shoe and stub plugs will be 50' above and below shoe or stub and tagged.
- * Surface plug will be from 0' - 60'
- * Where plugs are required, cement must be placed inside and outside of all casing string(s) in the correct footage or sacks required, if no cement exists.
- * Plugs to be tagged will be indicated.

← 164' shoe Plug. TAG

← 1552'

← 2506' TAG
 Perfs - 2606' - 2670'

8 5/8" @ 114'
 CIRC

5 1/2" @ 2910'
 125 SXS. CHIT