

Stevens Operating Co.

O'Brien DQ # 1

Sec. 30-7-29-M

1. Spot a 40 sx. plug at 6750' and tag. Have at least 100' of plug.
2. Spot a 25 sx. plug at 6395'.
3. Spot a 25 sx. plug at 5950'. Calc. toc at 5900'.
4. Cut 5 1/2 csg at 5250' if free. Pull and lay down pipe.
5. Spot a 30 sx. plug 50' in and out of stub.
6. Spot 40 sx. plug at 2794' WOC and tag plug.
7. Spot a 40 sx. plug at 470'.
8. Spot a 20 sx. surface plug and set PA marker.
9. Clean and level location.
10. Hole shall be loaded with salt-gel at 25 lb. per bbl of brine water.