

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

WATER CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.
N/A

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name N/A
2. Name of Operator Threshold Development Company	8. Farm or Lease Name J.T. Jennings etux
3. Address of Operator Suite II-A, 777 Taylor St. Ft. Worth, Tx. 76102	9. Well No. #1
4. Location of Well UNIT LETTER F, 1980 FEET FROM THE North LINE AND 1980 FEET FROM THE West LINE, SECTION 25 TOWNSHIP 11S RANGE 25E NMPM.	10. Field and Pool, or Wildcat Abo Wildcat
15. Elevation (Show whether DF, RT, GR, etc.) 3343' GR, 3453' KB	12. County Chaves

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☒
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

We propose to plug and abandon the J.T. Jennings as follows:

- (1) MIRU PU. POH w/tbg & pkr.
- (2) RIH on WL w/4½" CIBP & set & 3950' w/3 sx cmt.
- (3) RIH w/free-point. Indicated cmt top from CBL @ 2656'. Shoot csg off @ ± 2650'. POH w/4½" csg.
- (4) Load hole w/ 9.8# mud. RIH w/tbg & spot 35 sx cmt plug @ 4½" stub (½ in & ½ out). SD 2-3 hrs to allow cmt to set-up. Tally in hole w/tbg & tag top of plug.
- (5) Spot 35 sx cmt plug @ 1222' in shoe of 8-5/8" intermediate. SD 2-3 hrs to allow cmt to set-up. Tally in hole w/tbg & tag top of plug.
- (6) Spot 35 sx cmt plug @ 480'.
- (7) Set 10 sx plug @ surface w/4' steel marker.
- (8) Fill pits, level location, & clear junk.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Bucky Burch TITLE Area Manager DATE Aug. 17, 1982

APPROVED BY Leslie A. Clement TITLE SUPERVISOR, DISTRICT 11 DATE AUG 23 1982

CONDITIONS OF APPROVAL, IF ANY:

Notify N.M.C.C.C. in sufficient time to witness

P1