

State of New Mexico
Energy, Minerals and Natural Resources Department

DISTRICT

P.O. Box 980, Hobbs NM 88240

DISTRICT

P.O. Drawer CD, Artesia NM 88210

DISTRICT

1000 Rio Brazos Rd., Aztec NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-005-60951

5. Indicate Type of Lease

State FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well

OIL GAS
WELL WELL ☒ OTHER

2. Name of Operator

Yates Petroleum Corporation

3. Address of Operator

105 South 4th., Artesia, NM 88210

4. Well Location

Unit Letter I : 1980 Feet From The SOUTH Line and 710 Feet From The EAST Line

Section 18 Township 6S Range 24E NMPM CHAVES COUNTY

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

3951' GR

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK PLUG AND ABANDON ☒
TEMPORARILY ABANDON CHANGE PLANS
PULL OR ALTER CASING
OTHER

SUBSEQUENT REPORT OF:

REMEDIAL WORK ALTERING CASING
COMMENCE DRILLING OPNS. PLUG AND ABANDONMENT
CASING TEST AND CEMENT JOB
OTHER

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU WSU - Bleed pressure off tubing & load tubing & casing w/ 30+/- bbls KCL water; ND wellhead & NU BOP; POH w/ tubing. Pump 2% KCL water as needed to keep well dead.
2. RU wireline & RIH w/ 4-1/2" guage ring to 3100' to make sure casing is clear; RIH w/ 4-1/2" CIBP & set plug at 3100'. MU dump bailer & RIH w/ bailer & durnp 35' of cement on top of CIBP - RD wireline.
3. RIH w/ tubing to 3065' & circ hole w/ 10.0 ppg brine plugging mud w/ 25 lbs of gel/bbl in mud; pull tubing to 1850' & spot a 35 sack plug f/ 1850' to 1600' across the 8-5/8" casing shoe; wait 3 hours & tag plug then pull tubing up to 60' & set a 10 sack plug to surface. *1850-1540 100' plug 5/3-6/3 - Tag*
4. ND BOP & remove wellhead; install regulation dry hole marker & clean location.

Notify OCD 24 hrs. prior to any work done

I hereby certify that the information above is true and complete to the best of my knowledge and belief

SIGNATURE

Donna Clack

TITLE

Operations Technician

DATE

3/18/02

TYPE OR PRINT NAME

DONNA CLACK

TELEPHONE NO

505-748-1471

(This space for State Use)

APPROVED BY

TITLE

Wild Sep ID

DATE

MAR 26 2002

CONDITIONS OF APPROVAL, IF ANY