

DISTRICT I P.O. Box 1980, Hobbs, NM 88240

DISTRICT II P.O. Drawer DD, Artesia, NM 88210

DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION P.O. Box 2088 Santa Fe, New Mexico 87504-2088

WELL API NO. 30-005-60962
5. Indicate Type of Lease STATE [] FEE [X]
6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE 'APPLICATION FOR PERMIT' (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: OIL WELL [X] GAS WELL [] OTHER []

2. Name of Operator MARBOB ENERGY CORPORATION

3. Address of Operator P.O. DRAWER 227, ARTESIA N.M. 88210 505-748-3303

4. Well Location Unit Letter D : 330 Feet From The NORTH Line and 330 Feet From The WEST Line Section 5 Township 9-S Range 29-E NMPM CHAVES County

7. Lease Name or Unit Agreement Name TWIN LAKES SAN ANDRES UN.

8. Well No. 62

9. Pool name or Wildcat TWIN LAKES SAN ANDRES (ASSOC.)

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data. NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK [], PLUG AND ABANDON [], TEMPORARILY ABANDON [], PULL OR ALTER CASING [], OTHER: []. SUBSEQUENT REPORT OF: REMEDIAL WORK [], ALTERING CASING [], COMMENCE DRILLING OPNS. [], PLUG AND ABANDONMENT [X], CASING TEST AND CEMENT JOB [], OTHER: []

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 1. Rig up wire line att. to RIH w/ 4 1/2" CIBP. Stop at 220' call to O.C.D. office w/ Mike Stubblefield to approve job - RIH w/ 2 3/8" tbg. O.E. and tag. plug. at 2,054 spot. 25 sxs. w/ 5% col.c. plug. at 2054' pooh w/ tbg. W.O.C. 4 hrs. Rig up wire line. RIH w/ S/B. tag. cement. plug. at 1585' pooh w/ S/B.
2. Circ. hol. w/ mud. Laid down 17 jts. spot. 25 sxs. cement. w/ 3% col.c. at 747' pooh w/ tbg. and. W.O.C. prepare to tag. RIH w/ 2 3/8" tbg. o.e. unable to tag. cement. plug. at 747', con't RIH w/ tbg. stop. at. 2054' all plugs. going. Call to O.C.D. off w/ mike stubblefield to approval.
3. RIH w/ 4 1/2" CIBP and. set. at. 2050' cap w/ 10 sxs. cement. on top of CIBP. Circ. hole w/ mud. spot 30 sxs. cement. plug. w/ 5% col.c. at 747' POOH w/ tbg W.O.C. Rig up wire line. RIH w/ S/B and tag. cement plug at 1439' plug is to low.
4. Rig up wire line. RIH w/ 4 1/2" CIBP. and. set. at. 755' POOH w/ setting tool. RIH w/ 2 3/8" tbg. and tag. CIBP at. 755' spot 10 sxs. cement. on top of CIBP at 755' perf. 4 holes in 4 1/2 csg. at. 180'. CIRC 52 sxs. cement. to surf. cut wellhead off. set PXA marker. 7-24-97

Post ID-2 9-12-97 P&A

APPROVED

AUG 21 1997

OIL CON. DIV

I hereby certify that the information above is true and complete to the best of my knowledge and belief. SIGNATURE Rudy Butwin TITLE Supervisor DATE 8-9-97

(This space for State Use) APPROVED BY Keith Livingston TITLE OIL AND GAS INSPECTOR DATE 10-6-97

CONDITIONS OF APPROVAL, IF ANY: